


### **PROBLEM SUMMARY**

Sample Rating Trend

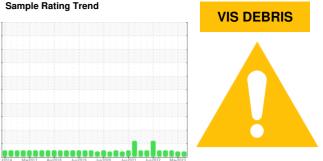

# EISEN BEISS L-8 130 REDUCTION

Component Gearbox

PETRO CANADA ENDURATEX EP 220 (20 GAL)

**COMPONENT CONDITION SUMMARY** 

No relevant graphs to display

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

### PROBLEMATIC TEST RESULTS

Sample Status ABNORMAL ABNORMAL NORMAL Debris scalar \*Visual NONE ▲ MODER ▲ MODER VLITE

Customer Id: CERCLA Sample No.: PCA0091853 Lab Number: 05921558 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS

02 May 2023 Diag: Don Baldridge

VIS DEBRIS



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



15 Feb 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



15 Nov 2022 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





### **OIL ANALYSIS REPORT**

Sample Rating Trend



Machine Id

## **EISEN BEISS L-8 130 REDUCTION**

Component

Gearbox

PETRO CANADA ENDURATEX EP 220 (20 GAL)

### DIAGNOSIS

#### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

Moderate concentration of visible dirt/debris present in the oil.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

GAL)		:t2014 Mar2	017 Apr2018 Jun2019	Jun2020 Jun2021 Jun2022	May2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0091853	PCA0091903	PCA0091898
Sample Date		Client Info		09 Aug 2023	02 May 2023	15 Feb 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METAL	.S	method	limit/base	current	history1	history2
PQ		ASTM D8184		9		13
Iron	ppm	ASTM D5185m	>200	4	2	2
Chromium	ppm	ASTM D5185m	>15	0	<1	0
Nickel	ppm	ASTM D5185m	>15	<1	<1	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	<1	0
Lead	ppm	ASTM D5185m	>100	<1	0	0
Copper	ppm	ASTM D5185m	>200	1	0	0
Tin	ppm	ASTM D5185m	>25	<1	0	0
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	60	10	14	16
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0	<1	<1	0
Magnesium	ppm	ASTM D5185m	0	0	2	<1
Calcium	ppm	ASTM D5185m	0	0	0	0
Phosphorus	ppm	ASTM D5185m	270	391	465	415
Zinc	ppm	ASTM D5185m	0	244	0	1
Sulfur	ppm	ASTM D5185m	11200	5948	7311	4790
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	11	17	19
Sodium	ppm	ASTM D5185m		5	<1	0
Potassium	ppm	ASTM D5185m	>20	<1	1	<1
FLUID DEGRAI	OITAC	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.40	0.99	1.14	1.10
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	▲ MODER	VLITE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML

NEG

NEG

>0.2

**Emulsified Water** 

scalar \*Visual

scalar \*Visual


NEG

ion: BEGICE JAMES VEGERCLA

NEG



### **OIL ANALYSIS REPORT**

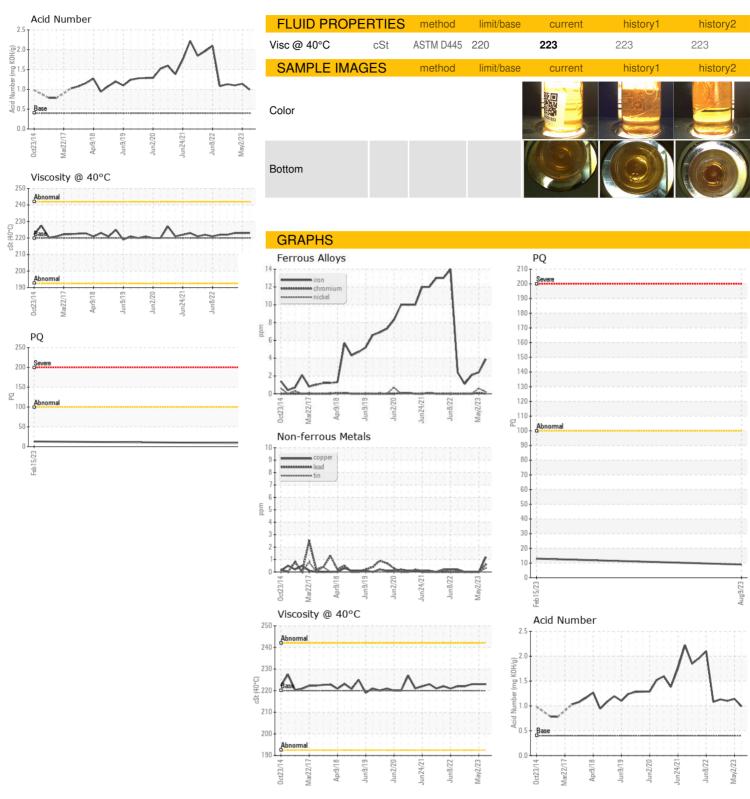





Laboratory Sample No. Lab Number **Unique Number** 

: PCA0091853 : 05921558 : 10593472 Test Package : PLANT

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 10 Aug 2023

Diagnosed : 14 Aug 2023 : Jonathan Hester Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

**CERTAINTEED VINYL PLANT** 

2651 PENNY RD CLAREMONT, NC US 28613

Contact: BRUCE JAMES

bruce.a.james@saint-gobain.com

T: (828)459-3320 F: (828)459-3329

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: BRUCE JAMES - CERCLA