


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

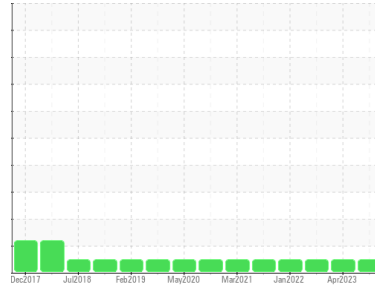

Machine Id
FREIGHTLINER 484150
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 10W30 (18 QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0100946	PCA0094465	PCA0068532
Sample Date	Client Info		04 Aug 2023	05 Apr 2023	03 May 2022
Machine Age	mls	Client Info	0	263625	0
Oil Age	mls	Client Info	0	0	0
Oil Changed	Client Info		Changed	Changed	Changed
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<1.0	<1.0	<1.0
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >130	52	15	40
Chromium	ppm	ASTM D5185m >10	1	2	<1
Nickel	ppm	ASTM D5185m >4	0	<1	<1
Titanium	ppm	ASTM D5185m >2	<1	15	0
Silver	ppm	ASTM D5185m >2	0	0	<1
Aluminum	ppm	ASTM D5185m >20	6	6	9
Lead	ppm	ASTM D5185m >20	<1	0	0
Copper	ppm	ASTM D5185m >125	2	2	1
Tin	ppm	ASTM D5185m >4	<1	0	<1
Antimony	ppm	ASTM D5185m	---	---	---
Vanadium	ppm	ASTM D5185m	<1	<1	0
Cadmium	ppm	ASTM D5185m	<1	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	12	118	15
Barium	ppm	ASTM D5185m 0	<1	0	0
Molybdenum	ppm	ASTM D5185m 50	74	45	62
Manganese	ppm	ASTM D5185m 0	1	<1	<1
Magnesium	ppm	ASTM D5185m 950	1010	857	822
Calcium	ppm	ASTM D5185m 1050	1325	1612	1177
Phosphorus	ppm	ASTM D5185m 995	1103	1158	937
Zinc	ppm	ASTM D5185m 1180	1401	1462	1152
Sulfur	ppm	ASTM D5185m 2600	3534	4444	2571

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	4	7	5
Sodium	ppm	ASTM D5185m	4	2	9
Potassium	ppm	ASTM D5185m >20	3	3	0



INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >6	0.9	1.1	0.8
Nitration	Abs/cm	*ASTM D7624 >20	14.1	13.8	13.7
Sulfation	Abs/.1mm	*ASTM D7415 >30	26.3	24.2	24.4

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	26.1	24.0	22.7
Base Number (BN)	mg KOH/g	ASTM D2896	6.0	5.2	6.3









OIL ANALYSIS REPORT

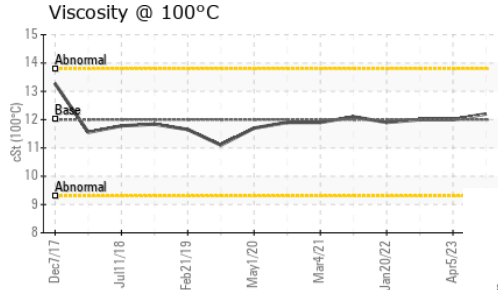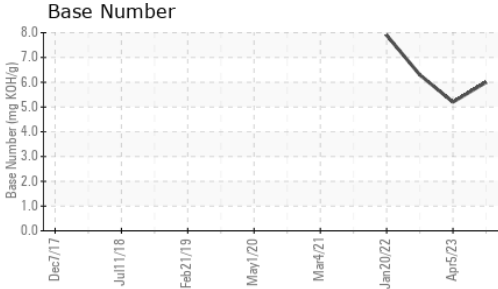

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	12.2	12.0

GRAPHS

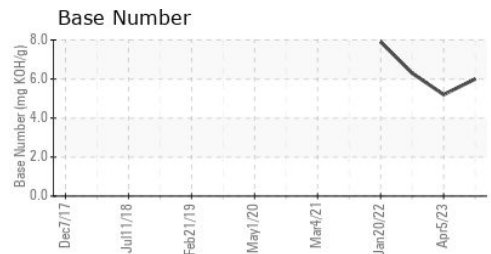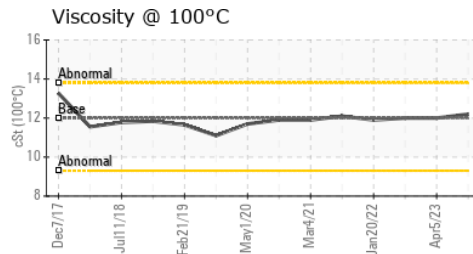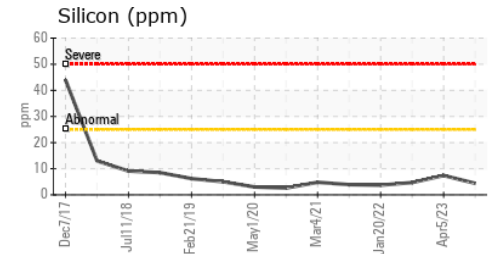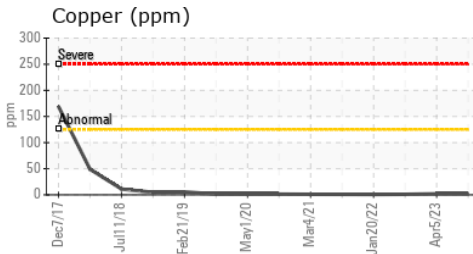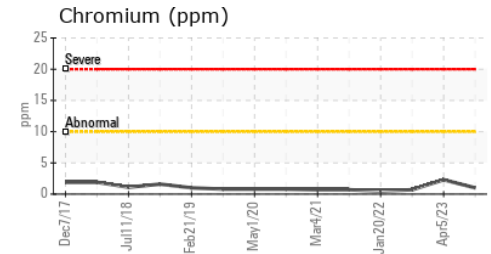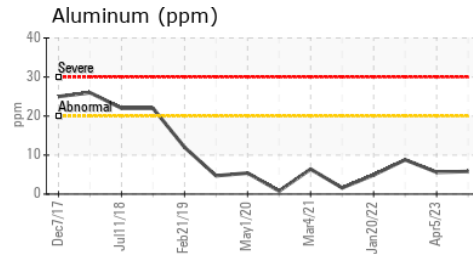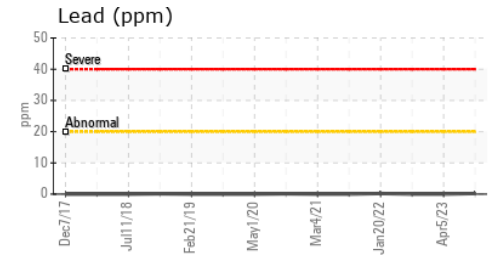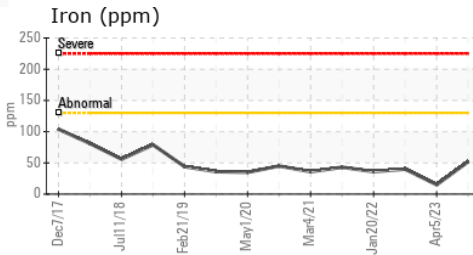

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0100946 **Received** : 14 Aug 2023
Lab Number : 05922998 **Diagnosed** : 14 Aug 2023
Unique Number : 10602945 **Diagnostician** : Sean Felton
Test Package : MOB 1 (Additional Tests: TBN)

MILLER TRUCK LEASING #114
 63 REPAUPO STATION ROAD
 LOGAN TOWNSHIP, NJ
 US 08085
 Contact: ED DAVIS
 edavis@millertransgroup.com
 T: (856)214-3521
 F: (856)214-3663

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)