


PROBLEM SUMMARY

Sample Rating Trend



VIS DEBRIS

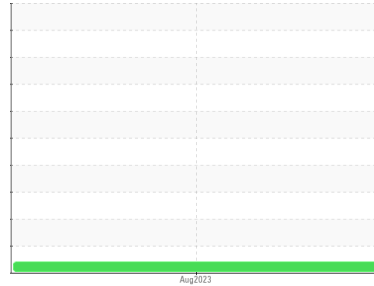

Machine Id
SHIP A - NORTH COIL CAR
 Component
Hydraulic System
 Fluid
PETRO CANADA HYDREX AW 46 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---

Customer Id: SDITER
Sample No.: PCA0095464
Lab Number: 05924172
Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com


RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

OIL ANALYSIS REPORT

Sample Rating Trend

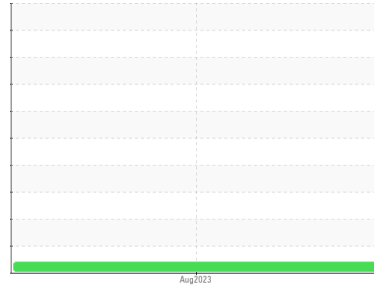VIS DEBRIS

 Machine Id
[] SHIP A - NORTH COIL CAR

 Component
Hydraulic System

 Fluid
PETRO CANADA HYDREX AW 46 (--- GAL)

DIAGNOSIS

▲ Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0095464	---	---
Sample Date	Client Info	14 Aug 2023	---	---
Machine Age	hrs	Client Info	0	---
Oil Age	hrs	Client Info	0	---
Oil Changed	Client Info	Not Changed	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2		
Iron	ppm	ASTM D5185m	>20	<1	---	---
Chromium	ppm	ASTM D5185m	>20	0	---	---
Nickel	ppm	ASTM D5185m	>20	0	---	---
Titanium	ppm	ASTM D5185m		0	---	---
Silver	ppm	ASTM D5185m		0	---	---
Aluminum	ppm	ASTM D5185m	>20	0	---	---
Lead	ppm	ASTM D5185m	>20	0	---	---
Copper	ppm	ASTM D5185m	>20	<1	---	---
Tin	ppm	ASTM D5185m	>20	0	---	---
Vanadium	ppm	ASTM D5185m		0	---	---
Cadmium	ppm	ASTM D5185m		0	---	---

ADDITIVES

method	limit/base	current	history1	history2		
Boron	ppm	ASTM D5185m	0	0	---	---
Barium	ppm	ASTM D5185m	0	0	---	---
Molybdenum	ppm	ASTM D5185m	0	0	---	---
Manganese	ppm	ASTM D5185m	0	0	---	---
Magnesium	ppm	ASTM D5185m	0	7	---	---
Calcium	ppm	ASTM D5185m	50	58	---	---
Phosphorus	ppm	ASTM D5185m	330	341	---	---
Zinc	ppm	ASTM D5185m	430	434	---	---
Sulfur	ppm	ASTM D5185m	760	1007	---	---

CONTAMINANTS

method	limit/base	current	history1	history2		
Silicon	ppm	ASTM D5185m	>15	<1	---	---
Sodium	ppm	ASTM D5185m		<1	---	---
Potassium	ppm	ASTM D5185m	>20	0	---	---



FLUID DEGRADATION

method	limit/base	current	history1	history2		
Acid Number (AN)	mg KOH/g	ASTM D8045	0.70	0.30	---	---

VISUAL

method	limit/base	current	history1	history2		
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---	---
Free Water	scalar	*Visual		NEG	---	---

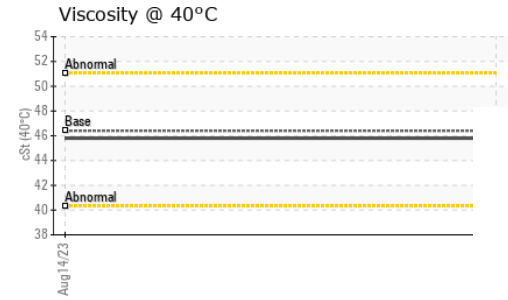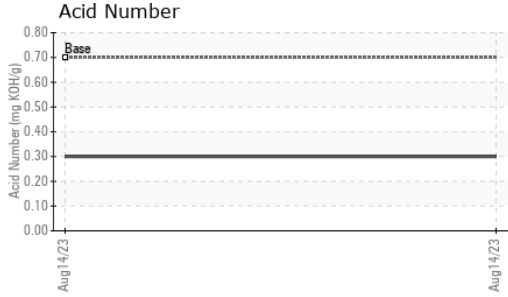

OIL ANALYSIS REPORT







FLUID PROPERTIES

method	limit/base	current	history1	history2
Visc @ 40°C	cSt ASTM D445	46.4	45.8	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

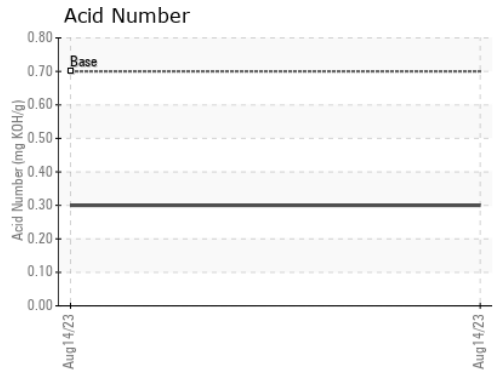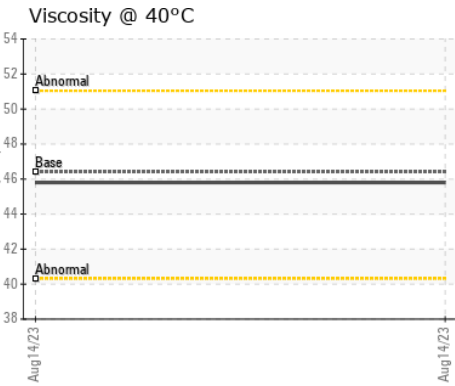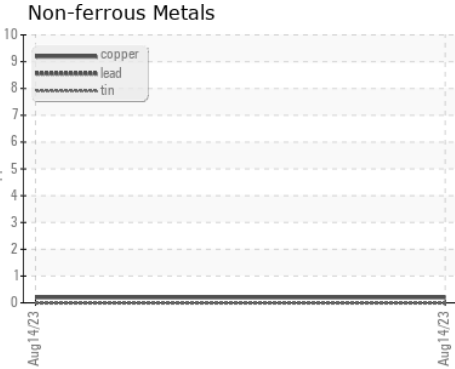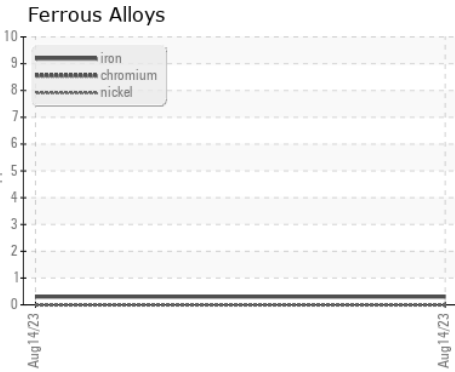

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0095464 **Received** : 14 Aug 2023
Lab Number : **05924172** **Diagnosed** : 15 Aug 2023
Unique Number : 10604119 **Diagnostician** : Don Baldrige
Test Package : PLANT

SDI - Steel Dynamics Inc. - Heartland
 455 West Industrial Drive
 Terre Haute, IN
 US 47802
 Contact: BRAD ELLIS
 brad.ellis@steeldynamics.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: