


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

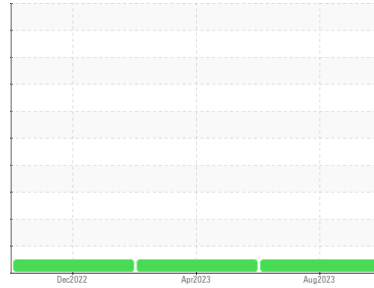

Machine Id
639280

Component
Diesel Engine

Fluid
PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0093319	PCA0078801	PCA0078772
Sample Date	Client Info		02 Aug 2023	07 Apr 2023	08 Dec 2022
Machine Age	mls	Client Info	62115	45016	28653
Oil Age	mls	Client Info	0	0	0
Oil Changed	Client Info		N/A	Changed	Changed
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	<1.0	<1.0
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >100	32	17	44
Chromium	ppm	ASTM D5185m >20	<1	<1	<1
Nickel	ppm	ASTM D5185m >4	0	<1	<1
Titanium	ppm	ASTM D5185m	7	6	<1
Silver	ppm	ASTM D5185m >3	<1	<1	<1
Aluminum	ppm	ASTM D5185m >20	11	9	30
Lead	ppm	ASTM D5185m >40	<1	0	<1
Copper	ppm	ASTM D5185m >330	6	3	12
Tin	ppm	ASTM D5185m >15	1	<1	2
Vanadium	ppm	ASTM D5185m	<1	0	<1
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	4	10	23
Barium	ppm	ASTM D5185m 0	0	0	<1
Molybdenum	ppm	ASTM D5185m 50	55	51	14
Manganese	ppm	ASTM D5185m 0	1	1	3
Magnesium	ppm	ASTM D5185m 950	961	931	767
Calcium	ppm	ASTM D5185m 1050	1288	1201	1404
Phosphorus	ppm	ASTM D5185m 995	995	1042	792
Zinc	ppm	ASTM D5185m 1180	1293	1276	939
Sulfur	ppm	ASTM D5185m 2600	3615	3869	3451

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	10	9	14
Sodium	ppm	ASTM D5185m	4	2	5
Potassium	ppm	ASTM D5185m >20	30	21	109



INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	0.5	0.3	0.4
Nitration	Abs/cm	*ASTM D7624 >20	11.1	9.0	11.7
Sulfation	Abs/.1mm	*ASTM D7415 >30	23.1	17.9	25.7

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	19.1	15.2	19.3
Base Number (BN)	mg KOH/g	ASTM D2896	5.2	6.5	5.9









OIL ANALYSIS REPORT

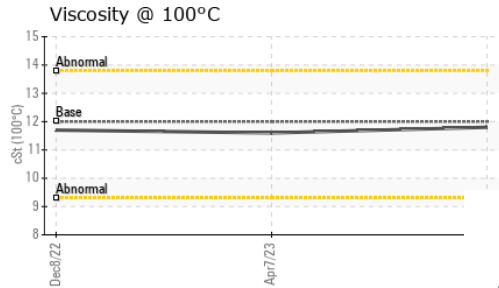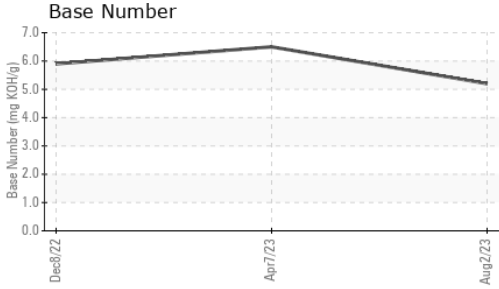

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	11.8	11.6

GRAPHS

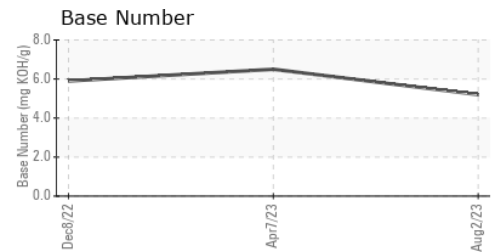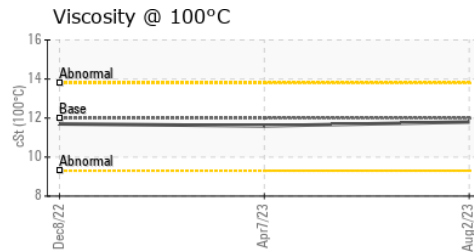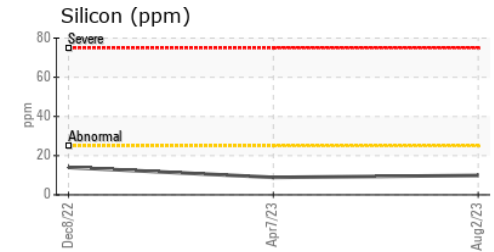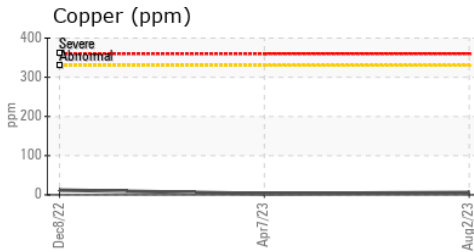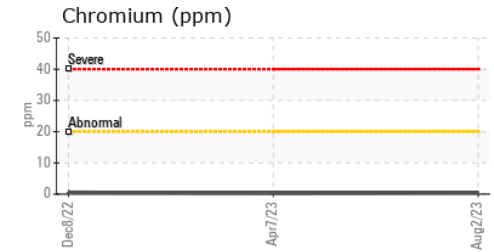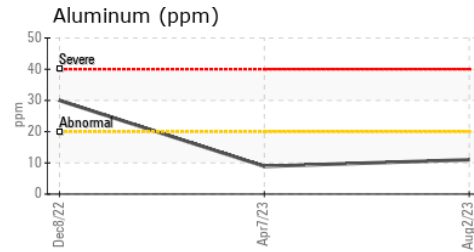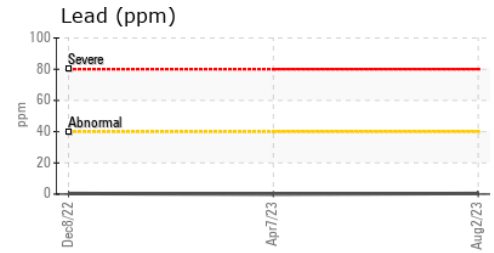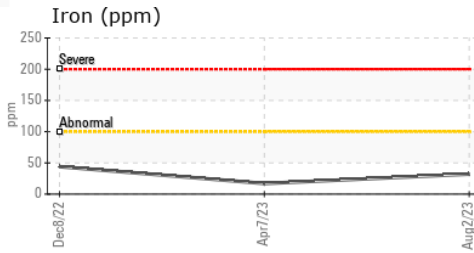

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0093319 **Received** : 16 Aug 2023
Lab Number : 05925721 **Diagnosed** : 17 Aug 2023
Unique Number : 10605668 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: TBN)

MILLER TRUCK LEASING #117
 2666 LEISCZS BRIDGE RD
 LEESPORT, PA
 US 19533
 Contact: JAMEY RITZ
 jritz@millertransgroup.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: