


# **OIL ANALYSIS REPORT**

# (59095Z) Walgreens [Walgreens] 136A624333

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

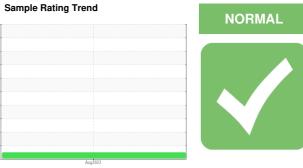

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the


## **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

GAL)				Aug2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0093987		
Sample Date		Client Info		01 Aug 2023		
Machine Age	mls	Client Info		27391		
Oil Age	mls	Client Info		27391		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	34		
Chromium	ppm	ASTM D5185m	>5	2		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>30	16		
Lead	ppm	ASTM D5185m	>30	<1		
Copper	ppm	ASTM D5185m	>150	152		
Tin	ppm	ASTM D5185m	>5	4		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	38		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	42		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	582		
Calcium	ppm	ASTM D5185m	1050	1701		
Phosphorus	ppm	ASTM D5185m	995	743		
Zinc	ppm	ASTM D5185m	1180	928		
Sulfur	ppm	ASTM D5185m	2600	2543		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	6		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	32		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	8.8		
Sulfation	Abs/.1mm	*ASTM D7415	>30	23.0		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	22.3		
Base Number (BN)		ASTM D2896		7.5		
()	0 - 3					





# **OIL ANALYSIS REPORT**

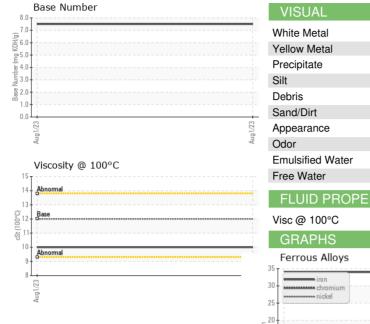



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		

FLUID FROF	LULIES	method			HISTOLAL	HISTOLYZ
Visc @ 100°C	cSt	ASTM D445	12.00	10.0		

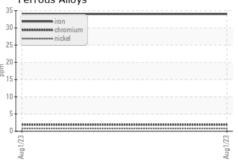

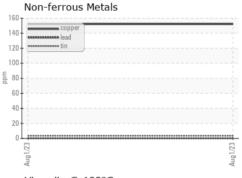

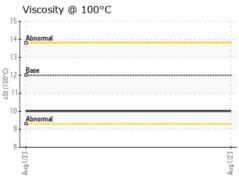

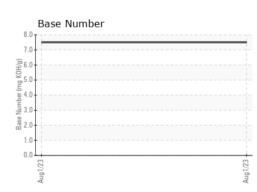



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10605760

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0093987 : 05925813

Received Diagnosed Test Package : FLEET

: 16 Aug 2023 : 17 Aug 2023 Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Transervice - Shop 1372 - Berkeley-Moreno Valley

17500 Perris Blvd. Moreno Valley, CA US 92551

F: (951)924-7151

Contact: Ryan Cruz rcruz@transervice.com T: (951)924-7131

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)