

OIL ANALYSIS REPORT

Sample Rating Trend







Machine Id **429112**

Component

2 Differential

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. (Customer Sample Comment: 2nd Axle / Tag)

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil

Fluid Condition


The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFOR	RMATION	method				history2
Sample Number		Client Info		GFL0089389		
Sample Date		Client Info		12 Aug 2023		
Machine Age	mls	Client Info		220080		
Oil Age	mls	Client Info		220080		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	_S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>500	246		
Chromium	ppm	ASTM D5185m	>10	3		
Nickel	ppm	ASTM D5185m	>10	10		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	37		
_ead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>100	<1		
Борро. Гin	ppm	ASTM D5185m	>100	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	''	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		173		
Barium		ASTM D5185m		5		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		13		
Magnesium	ppm	ASTM D5185m		4		
Calcium	ppm	ASTM D5185m		19		
	ppm			1472		
Phosphorus	ppm	ASTM D5185m				
Zinc	ppm	ASTM D5185m		45		
Sulfur	ppm	ASTM D5185m		29399		
CONTAMINAN		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	70		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	MODER		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	ERT <u>IES</u>	method	limit/base	current	history1	history2

Submitted By: TECHNICIAN ACCOUNT





OIL ANALYSIS REPORT

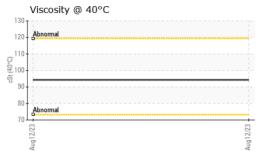




GRAPHS

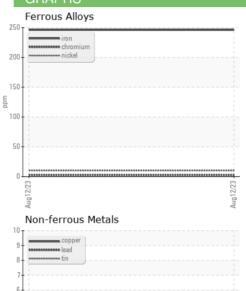

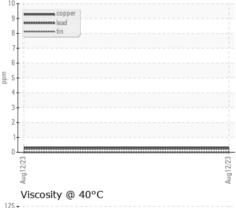

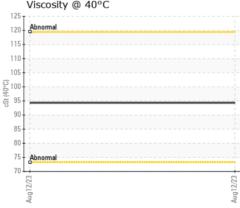



Certificate L2367

Laboratory Sample No.

Lab Number Unique Number : 10608436 Test Package : FLEET

: GFL0089389 : 05928489

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician : Don Baldridge

: 18 Aug 2023 : 21 Aug 2023 GFL Environmental - 983 - Sugar Land Hauling

16011 West Belfort Street Sugar Land, TX US 77498

Contact: TECHNICIAN ACCOUNT

wcgfldemo@gmail.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: