


OIL ANALYSIS REPORT

Sample Rating Trend





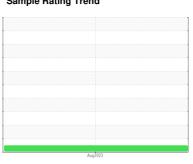



420094 Component 1 Differential NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: 1st Axle / Pusher)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition


The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0089397		
Sample Date		Client Info		15 Aug 2023		
Machine Age	mls	Client Info		109690		
Oil Age	mls	Client Info		109690		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>870	152		
Chromium	ppm	ASTM D5185m	>8	1		
Nickel	ppm	ASTM D5185m	>25	13		
Titanium	ppm	ASTM D5185m	>4	<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>40	4		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>60	0		
Tin	ppm	ASTM D5185m	>5	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		139		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		4		
Magnesium	ppm	ASTM D5185m		3		
Calcium	ppm	ASTM D5185m		21		
Phosphorus	ppm	ASTM D5185m		947		
Zinc	ppm	ASTM D5185m		17		
Sulfur	ppm	ASTM D5185m		21268		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>285	215		
Sodium	ppm	ASTM D5185m		7		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2

130





OIL ANALYSIS REPORT

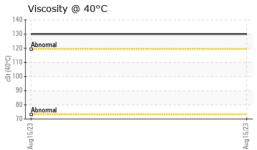




GRAPHS

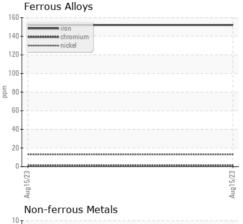

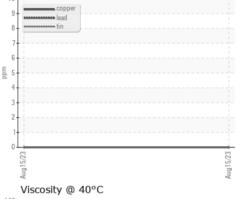

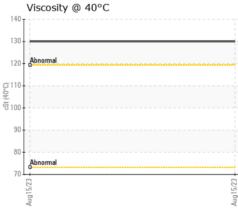





Laboratory Sample No. Lab Number Unique Number : 10608438

: GFL0089397 : 05928491 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Aug 2023 Diagnosed : 21 Aug 2023 Diagnostician : Don Baldridge

GFL Environmental - 983 - Sugar Land Hauling 16011 West Belfort Street

Sugar Land, TX US 77498

Contact: TECHNICIAN ACCOUNT

wcgfldemo@gmail.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL983 [WUSCAR] 05928491 (Generated: 08/21/2023 15:06:12) Rev: 1

F: