


# **OIL ANALYSIS REPORT**



NORMAL

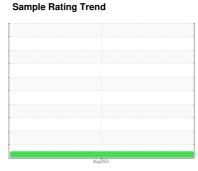

Machine Id 933023 Component

**Transmission** 

**PETRO CANADA DuraDrive HD Synthetic** 

# DIAGNOSIS

## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the fluid.

# **Fluid Condition**


The condition of the fluid is acceptable for the time in service.

668 ( GAL)				Aug 2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0087201		
Sample Date		Client Info		15 Aug 2023		
Machine Age	hrs	Client Info		1201		
Oil Age	hrs	Client Info		1201		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	39		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>50	14		
Lead	ppm	ASTM D5185m	>50	2		
Copper	ppm	ASTM D5185m	>200	7		
Tin	ppm	ASTM D5185m	>10	4		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		80		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		63		
Phosphorus	ppm	ASTM D5185m		283		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		1234		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	3		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	5		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2

35.7





# **OIL ANALYSIS REPORT**

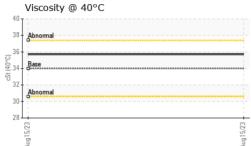


	SAMPLE IMAGES	method	limit/base	current	history1	history2
	Color			no image	no image	no image
-	Bottom			no image	no image	no image

# **GRAPHS**

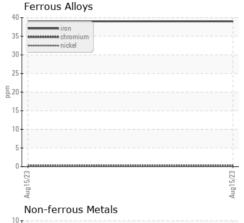

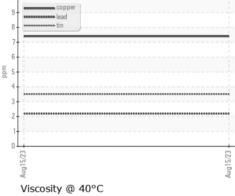

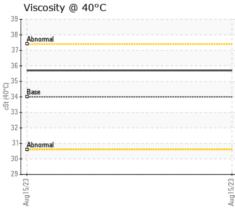



Certificate L2367

Laboratory Sample No. Lab Number Test Package : FLEET

Unique Number : 10608475

: GFL0087201 : 05928528

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 18 Aug 2023 Diagnosed : 21 Aug 2023 Diagnostician : Don Baldridge

GFL Environmental - 836 - Kansas City Hauling

7801 East Truman Road Kansas City, MO US 64126 Contact: Robert Hart

rhart@gflenv.com T: (580)461-1509

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)