


OIL ANALYSIS REPORT



NORMAL

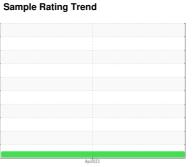

Machine Id **2227004**

Component

Rear Differential

GEAR OIL SAE 75W90 (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Apr2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0095535		
Sample Date		Client Info		28 Apr 2023		
Machine Age	mls	Client Info		17522		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	96		
Chromium	ppm	ASTM D5185m	>10	2		
Nickel	ppm	ASTM D5185m	>10	2		
Titanium		ASTM D5185m	>10	<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	υ <1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m		υ <1		
Tin		ASTM D5185m	>100	<1		
Vanadium	ppm		>10	0		
	ppm	ASTM D5185m ASTM D5185m		0		
Cadmium	ppm					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	400	190		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	3		
Manganese	ppm	ASTM D5185m		16		
Magnesium	ppm	ASTM D5185m	12	10		
Calcium	ppm	ASTM D5185m	150	61		
Phosphorus	ppm	ASTM D5185m	1650	1158		
Zinc	ppm	ASTM D5185m	125	41		
Sulfur	ppm	ASTM D5185m	22500	28859		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	50		
Sodium	ppm	ASTM D5185m		6		
Potassium	ppm	ASTM D5185m	>20	6		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	LIGHT		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate		*) ('	NONE	NONE		
Silt	scalar	*Visual	NONE	NONL		
Oilt	scalar scalar	*Visual	NONE	NONE		
Debris						
	scalar	*Visual	NONE	NONE		
Debris	scalar scalar	*Visual	NONE NONE	NONE NONE		
Debris Sand/Dirt	scalar scalar scalar	*Visual *Visual *Visual	NONE NONE	NONE NONE NONE		
Debris Sand/Dirt Appearance	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NONE NORML	NONE NONE NONE NORML		
Debris Sand/Dirt Appearance Odor	scalar scalar scalar scalar scalar	*Visual *Visual *Visual *Visual *Visual	NONE NONE NONE NORML	NONE NONE NONE NORML NORML		





OIL ANALYSIS REPORT

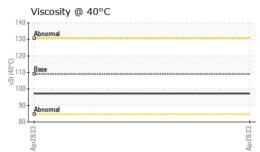



GRAPHS

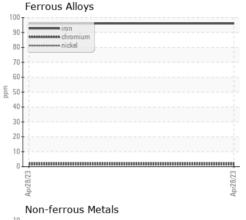

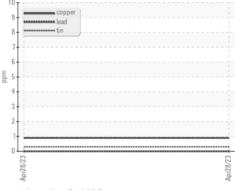

	<	A
	Viscosity @ 40°C	
135	Abnormal	
130		
125		
120		
115		
9 110	Base	
를 105		
100		
95		
90		
85	A1 1	
	Ţ.	
80		- 53
	Apr28/23	Apr28/23
	Ар	Αp





Laboratory Sample No. Lab Number

Unique Number : 10616354 Test Package : FLEET

: PCA0095535 : 05931083

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician : Don Baldridge

: 22 Aug 2023 : 23 Aug 2023 **PERDUE FARMS - BRIDGEVILLE** 8634 E NEWTON RD

BRIDGEVILLE, DE US 19933

Contact: GEORGE LACATES

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: