


# **OIL ANALYSIS REPORT**



425041-402302

Component **Diesel Engine** 

PETRO CANADA DURON SHP 15W40 (--- GAL)

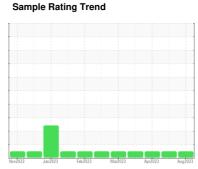



## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0090434	GFL0086291	GFL0081502
Sample Date		Client Info		21 Aug 2023	21 Jun 2023	27 Apr 2023
Machine Age	hrs	Client Info		17835	17592	17319
Oil Age	hrs	Client Info		516	273	0
Oil Changed		Client Info		Not Changd	Not Changd	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	<1.0	<1.0	<1.0
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	5	24	34
Chromium	ppm	ASTM D5185m	>20	<1	1	1
Nickel	ppm	ASTM D5185m	>5	0	<1	1
Titanium	ppm	ASTM D5185m	>2	<1	<1	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>20	4	16	12
Lead	ppm	ASTM D5185m	>40	<1	0	1
Copper	ppm	ASTM D5185m	>330	2	2	4
Tin	ppm	ASTM D5185m	>15	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	19	4	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	78	58	60
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	1010	943	954	912
Calcium	ppm	ASTM D5185m	1070	1133	1039	1034
Phosphorus	ppm	ASTM D5185m	1150	1071	1007	966
Zinc	ppm	ASTM D5185m	1270	1325	1270	1215
Sulfur	ppm	ASTM D5185m	2060	3880	3547	2616
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	5	16	19
Sodium	ppm	ASTM D5185m		26	2	3
Potassium	ppm	ASTM D5185m	>20	42	2	2
Glycol	%	*ASTM D2982		NEG	NEG	NEG
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>4	0.1	0.2	0.2
	% Abs/cm	*ASTM D7844 *ASTM D7624		0.1 4.7	0.2 9.0	0.2 8.8
Soot %						
Soot % Nitration	Abs/cm Abs/.1mm	*ASTM D7624	>20	4.7	9.0	8.8
Soot % Nitration Sulfation	Abs/cm Abs/.1mm	*ASTM D7624 *ASTM D7415	>20 >30	4.7 16.9	9.0 19.7	8.8 19.1



# **OIL ANALYSIS REPORT**

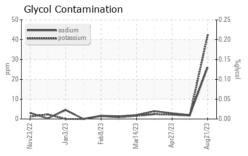

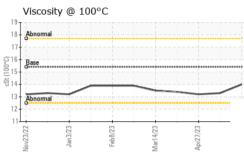


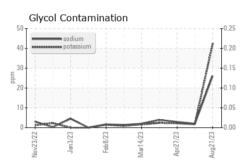



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROPERTIES		method				history2
Visc @ 100°C	cSt	ASTM D445	15.4	14.0	13.3	13.2

## **GRAPHS**

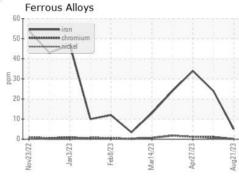

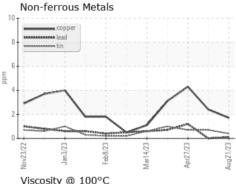

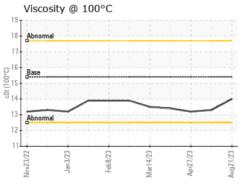

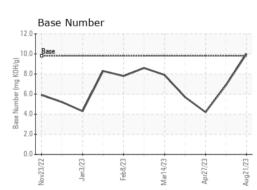





Laboratory Sample No. Lab Number Unique Number

: 10620057

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : GFL0090434 : 05934786

Received Diagnosed

: 25 Aug 2023 : 29 Aug 2023 Diagnostician : Jonathan Hester

Test Package : FLEET ( Additional Tests: Glycol ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 868 - Childersburg Fines Hauling (Alpine)

13737 Plant Rd Childersburg, AL

US 35044 Contact: JONATHAN WILLIAMS

jonathan.williams@gflenv.com

T:

F: