





PROBLEM SUMMARY

Sample Rating Trend



Machine Id
427191
 Component
2 Differential
 Fluid
NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

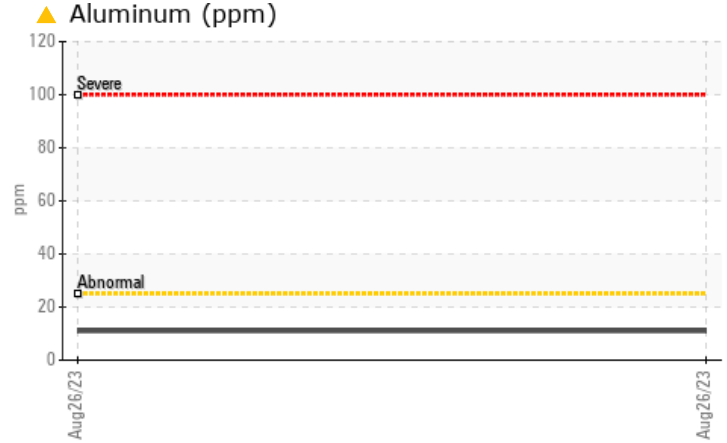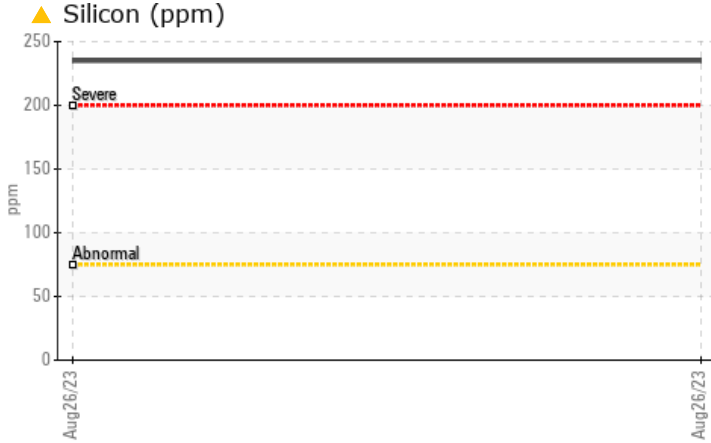

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. (Customer Sample Comment: 2nd Axle / Tag)

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Aluminum	ppm	ASTM D5185m	>25	▲ 11	---	---
Silicon	ppm	ASTM D5185m	>75	▲ 235	---	---

Customer Id: GFL983
 Sample No.: GFL0089463
 Lab Number: 05940409
 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Check Dirt Access	---	---	?	We advise that you check all areas where dirt can enter the system.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



DIRT

Machine Id
427191
 Component
2 Differential
 Fluid
NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check all areas where dirt can enter the system. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. (Customer Sample Comment: 2nd Axle / Tag)

Wear

All component wear rates are normal.

Contamination

Elemental levels of silicon (Si) and aluminum (Al) indicate alumina-silicate (coarse dirt) ingress.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	GFL0089463	---	---
Sample Date	Client Info	26 Aug 2023	---	---
Machine Age	mls Client Info	340693	---	---
Oil Age	mls Client Info	340693	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		ABNORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm	ASTM D5185m >500	431	---	---
Chromium ppm	ASTM D5185m >10	3	---	---
Nickel ppm	ASTM D5185m >10	25	---	---
Titanium ppm	ASTM D5185m	<1	---	---
Silver ppm	ASTM D5185m	0	---	---
Aluminum ppm	ASTM D5185m >25	▲ 11	---	---
Lead ppm	ASTM D5185m >25	0	---	---
Copper ppm	ASTM D5185m >100	2	---	---
Tin ppm	ASTM D5185m >10	<1	---	---
Vanadium ppm	ASTM D5185m	0	---	---
Cadmium ppm	ASTM D5185m	0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm	ASTM D5185m	158	---	---
Barium ppm	ASTM D5185m	0	---	---
Molybdenum ppm	ASTM D5185m	<1	---	---
Manganese ppm	ASTM D5185m	10	---	---
Magnesium ppm	ASTM D5185m	2	---	---
Calcium ppm	ASTM D5185m	434	---	---
Phosphorus ppm	ASTM D5185m	1277	---	---
Zinc ppm	ASTM D5185m	140	---	---
Sulfur ppm	ASTM D5185m	21378	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon ppm	ASTM D5185m >75	▲ 235	---	---
Sodium ppm	ASTM D5185m	3	---	---
Potassium ppm	ASTM D5185m >20	6	---	---

VISUAL




method	limit/base	current	history1	history2
White Metal scalar	*Visual NONE	NONE	---	---
Yellow Metal scalar	*Visual NONE	NONE	---	---
Precipitate scalar	*Visual NONE	NONE	---	---
Silt scalar	*Visual NONE	NONE	---	---
Debris scalar	*Visual NONE	NONE	---	---
Sand/Dirt scalar	*Visual NONE	NONE	---	---
Appearance scalar	*Visual NORML	NORML	---	---
Odor scalar	*Visual NORML	NORML	---	---
Emulsified Water scalar	*Visual >.2	NEG	---	---
Free Water scalar	*Visual	NEG	---	---

FLUID PROPERTIES

method	limit/base	current	history1	history2
Visc @ 40°C cSt	ASTM D445	103	---	---






OIL ANALYSIS REPORT

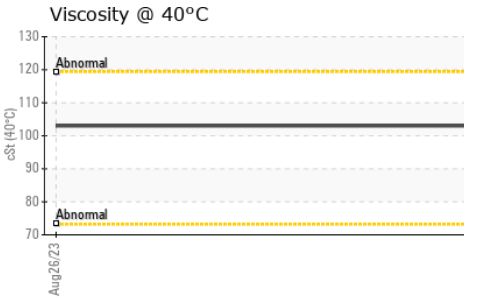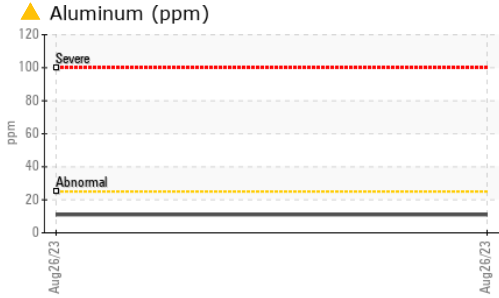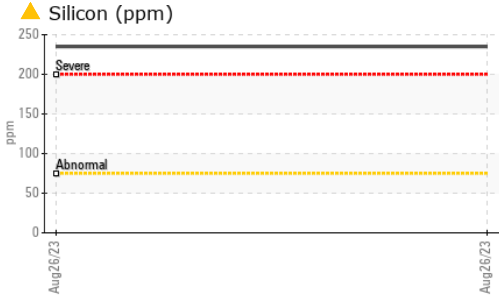

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

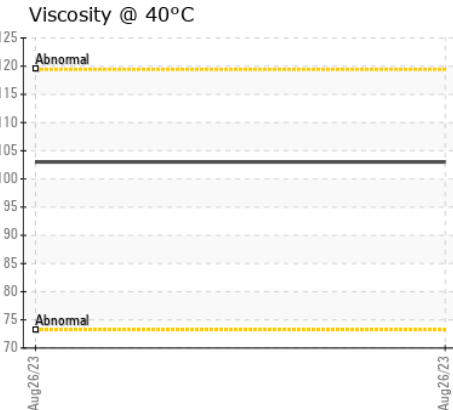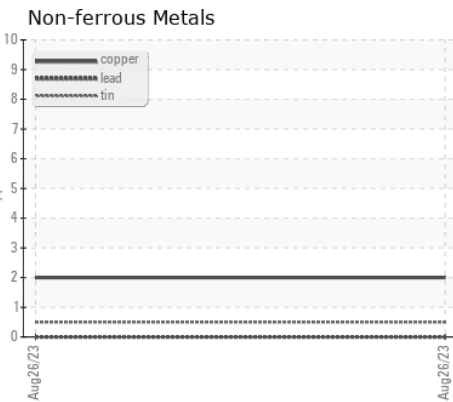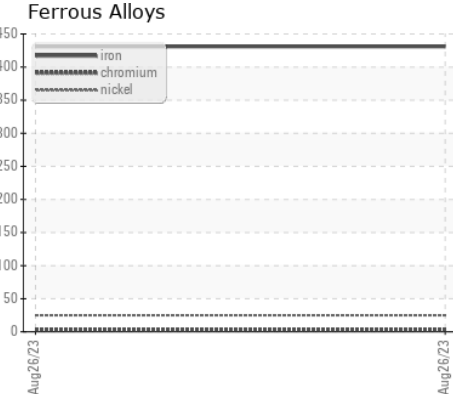

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0089463 **Received** : 31 Aug 2023
Lab Number : 05940409 **Diagnosed** : 05 Sep 2023
Unique Number : 10631021 **Diagnostician** : Don Baldrige
Test Package : FLEET

GFL Environmental - 983 - Sugar Land Hauling
 16011 West Belfort Street
 Sugar Land, TX
 US 77498
 Contact: TECHNICIAN ACCOUNT
 wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: