

PROBLEM SUMMARY

Sample Rating Trend

WEAR






Machine Id 912076 Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (--- GAL)

COMPONENT CONDITION SUMMARY

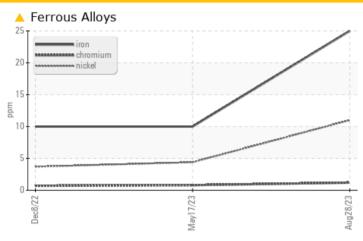

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS						
Sample Status				ABNORMAL	NORMAL	NORMAL
Nickel	ppm	ASTM D5185m	>5	<u> 11</u>	4	4

Customer Id: GFL455 Sample No.: GFL0080773 Lab Number: 05940538 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

17 May 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. Metal levels are typical for a new component breaking in. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



08 Dec 2022 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Metal levels are typical for a components first oil change. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.






OIL ANALYSIS REPORT



912076 Component **Diesel Engine**

PETRO CANADA DURON SHP 15W40 (--- GAL)

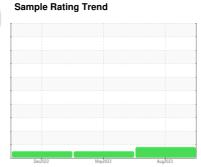



DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Valve wear is indicated. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

N 3HP 13W40 (- GAL)	Des	2022	May2023 Aug20	23	
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0080773	GFL0080736	GFL0067269
Sample Date		Client Info		28 Aug 2023	17 May 2023	08 Dec 2022
Machine Age	hrs	Client Info		3377	600	600
Oil Age	hrs	Client Info		0	600	600
Oil Changed		Client Info		Not Changd	Not Changd	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	<1.0	<1.0	<1.0
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>120	25	10	10
Chromium	ppm	ASTM D5185m	>20	1	<1	<1
Nickel	ppm	ASTM D5185m	>5	<u> 11</u>	4	4
Γitanium	ppm	ASTM D5185m	>2	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	<1	<1
Aluminum	ppm	ASTM D5185m	>20	<1	2	1
Lead	ppm	ASTM D5185m	>40	1	0	3
Copper	ppm	ASTM D5185m	>330	6	3	8
Γin	ppm	ASTM D5185m	>15	<1	1	1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	2	2	5
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	65	60	60
Manganese	ppm	ASTM D5185m	0	1	<1	<1
Magnesium	ppm	ASTM D5185m	1010	1079	997	933
Calcium	ppm	ASTM D5185m	1070	1197	1114	1129
Phosphorus	ppm	ASTM D5185m	1150	1059	1041	962
Zinc	ppm	ASTM D5185m	1270	1393	1336	1317
Sulfur	ppm	ASTM D5185m	2060	3060	3530	3166
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	5	5	5
Sodium	ppm	ASTM D5185m		6	3	3
Potassium	ppm	ASTM D5185m	>20	3	2	2
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>4	0.7	0.4	0.3
Nitration	Abs/cm	*ASTM D7624	>20	10.0	8.2	7.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.8	20.1	20.1
FLUID DEGRA	OATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	19.6	16.1	15.5
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	4.9	6.9	8.9
Dasc Namber (DIV)	mg NOH/g	10 HVI D2030	5.0	7.3	0.0	0.0



OIL ANALYSIS REPORT

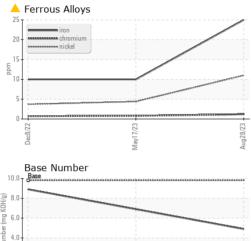

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG

limit/base

current

13.5


13.6

13.5

10.0 _T	Base	
® 8.0		
금 0.0		
2		
Base Number (mg KOH/g) -0.8		
per		
§ 4.0+		
2		
g 2.0+		
0.0		
0.0	7	23
,	Dec8/22	72
	ă	May 17/23
		≥




FLUID PROPERTIES

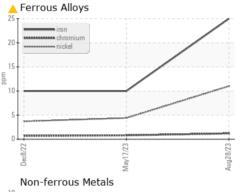



cSt


method

ASTM D445 15.4

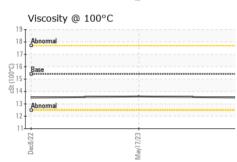

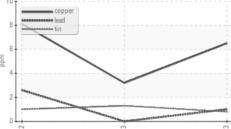

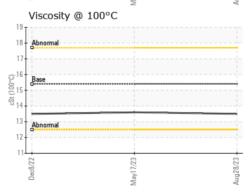

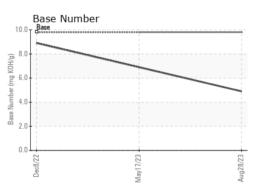





Certificate L2367

Laboratory

Sample No. Lab Number Unique Number : 10631150 Test Package : FLEET

: GFL0080773 : 05940538

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 01 Sep 2023 Diagnosed : 05 Sep 2023 Diagnostician : Don Baldridge GFL Environmental - 455 - Flint

2051 W. Bristol Rd Flint Township, MI US 48507 Contact: MARK WOMBLE mwomble@gflenv.com T: (586)825-9514

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL455 [WUSCAR] 05940538 (Generated: 09/05/2023 15:39:20) Rev: 1