




PROBLEM SUMMARY

Sample Rating Trend

ISO




Area
SCOF [98467499]
Machine Id
6210/6220
Component
South Gearbox
Fluid
GEAR OIL ISO 460 (--- GAL)

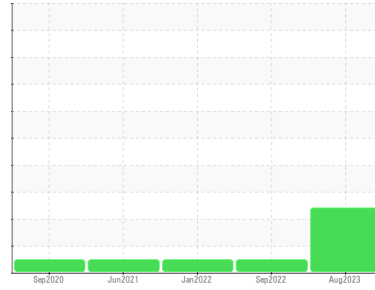

COMPONENT CONDITION SUMMARY

▲ Particle Trend

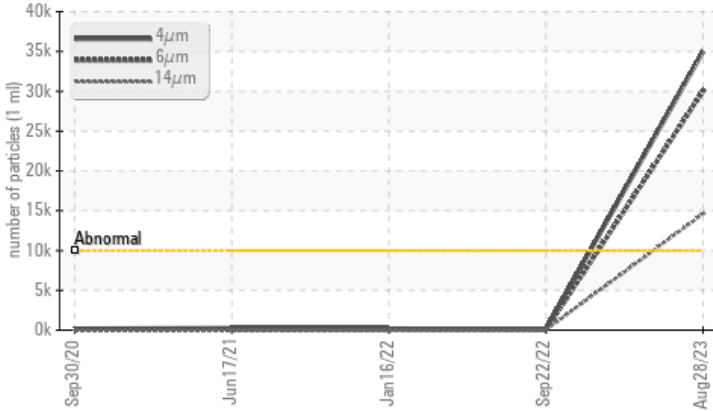

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	NORMAL
Particles >4µm	ASTM D7647	>10000	▲ 34973	136	198
Particles >6µm	ASTM D7647	>2500	▲ 30007	37	36
Particles >14µm	ASTM D7647	>640	▲ 14593	8	6
Particles >21µm	ASTM D7647	>160	▲ 7281	2	2
Particles >38µm	ASTM D7647	>40	▲ 280	1	0
Oil Cleanliness	ISO 4406 (c)	>20/18/16	▲ 22/22/21	14/12/10	15/12/10

Customer Id: KRASPRMO
Sample No.: PCA0094571
Lab Number: 05945701
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

22 Sep 2022 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



16 Jan 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



17 Jun 2021 Diag: Doug Bogart

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



OIL ANALYSIS REPORT

Sample Rating Trend

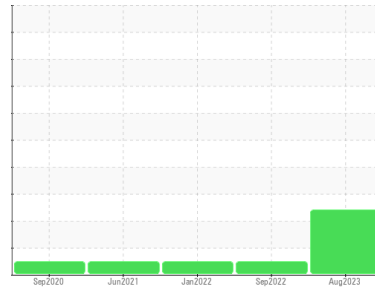

ISO



Area
SCOF [98467499]
 Machine Id
6210/6220
 Component
South Gearbox
 Fluid
GEAR OIL ISO 460 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0094571	PCA0076139	PCA0065341
Sample Date	Client Info	28 Aug 2023	22 Sep 2022	16 Jan 2022
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	Filtered	Filtered	Filtered
Sample Status		ABNORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >200	<1	2	<1
Chromium	ppm	ASTM D5185m >15	0	0	0
Nickel	ppm	ASTM D5185m >15	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >25	2	2	<1
Lead	ppm	ASTM D5185m >100	0	0	0
Copper	ppm	ASTM D5185m >200	0	0	0
Tin	ppm	ASTM D5185m >25	0	<1	0
Antimony	ppm	ASTM D5185m >5	---	---	0
Vanadium	ppm	ASTM D5185m	<1	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m 50	0	0	<1
Barium	ppm	ASTM D5185m 15	0	0	0
Molybdenum	ppm	ASTM D5185m 15	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m 50	0	<1	0
Calcium	ppm	ASTM D5185m 50	0	<1	0
Phosphorus	ppm	ASTM D5185m 350	314	281	126
Zinc	ppm	ASTM D5185m 100	0	6	0
Sulfur	ppm	ASTM D5185m 12500	384	380	138

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >50	<1	1	<1
Sodium	ppm	ASTM D5185m	<1	<1	0
Potassium	ppm	ASTM D5185m >20	<1	<1	0

FLUID CLEANLINESS


method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >10000	▲ 34973	136	198
Particles >6µm	ASTM D7647 >2500	▲ 30007	37	36
Particles >14µm	ASTM D7647 >640	▲ 14593	8	6
Particles >21µm	ASTM D7647 >160	▲ 7281	2	2
Particles >38µm	ASTM D7647 >40	▲ 280	1	0
Particles >71µm	ASTM D7647 >10	▲ 1	0	0
Oil Cleanliness	ISO 4406 (c) >20/18/16	▲ 22/22/21	14/12/10	15/12/10

FLUID DEGRADATION


method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.85	0.26	0.29	0.27

OIL ANALYSIS REPORT


▲ Particle Trend

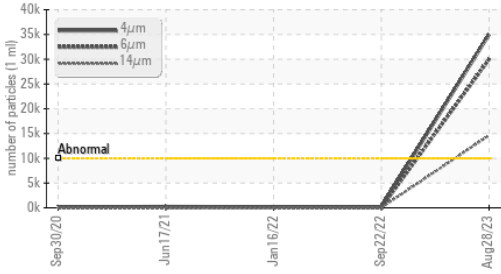


▲ Particle Trend

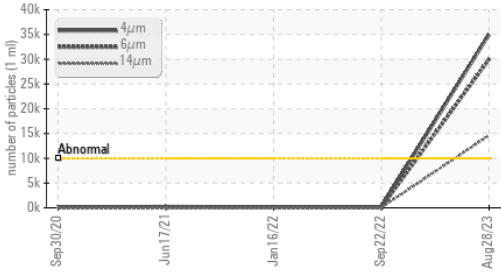

Acid Number

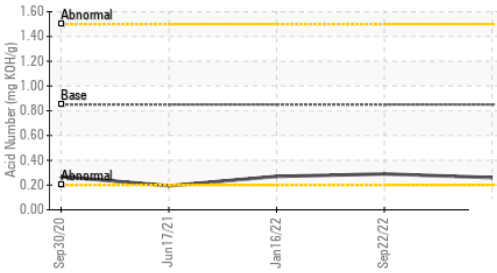

Viscosity @ 40°C

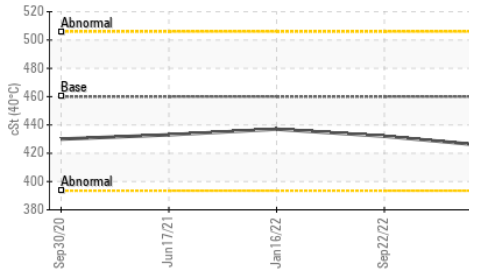

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG


FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	460	425	432

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color




Bottom




GRAPHS


Ferrous Alloys

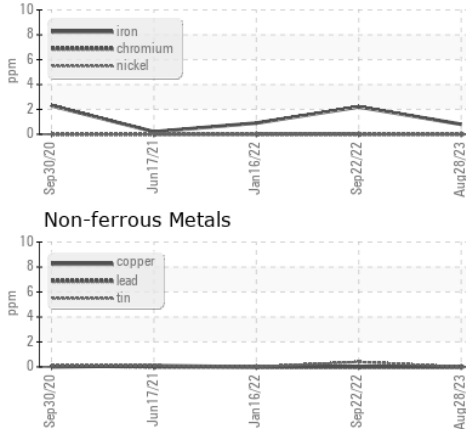


Non-ferrous Metals

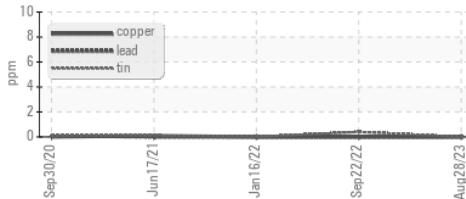


Viscosity @ 40°C

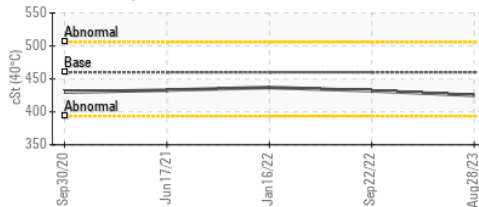

▲ Particle Count

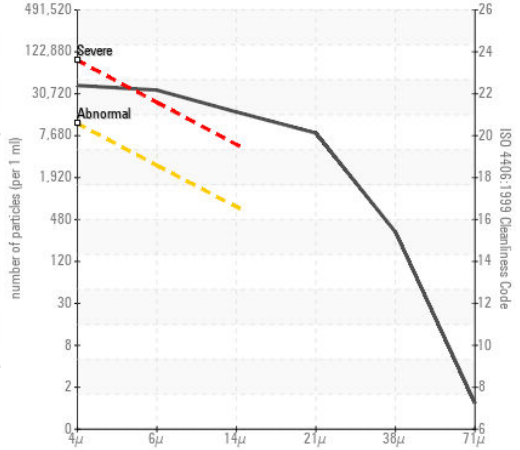

Acid Number

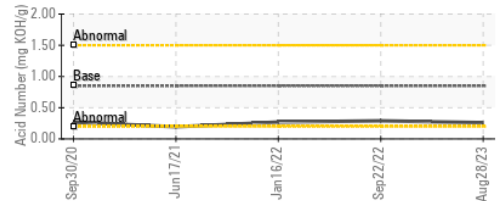

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0094571 **Received** : 08 Sep 2023
Lab Number : 05945701 **Diagnosed** : 13 Sep 2023
Unique Number : 10636313 **Diagnostician** : Jonathan Hester
Test Package : IND 2 (Additional Tests: PrtCount)

KraftHeinz - Springfield - Plant 8311 PCA
 2035 E BENNETT
 SPRINGFIELD, MO
 US 65804
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: