


OIL ANALYSIS REPORT

KEMP QUARRIES / RIVER VALLEY OZARK **OHT082**

Component

Rear Right Final Drive

MOBIL MOBILTRANS HD 50 (--- GAL)

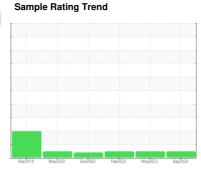



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.

OAMBI E INECES		Mar2019	May2022 Dec2022	Feb2023 May2023	Sep2023	L. Dennis and Company
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0069818	PCA0084643	PCA0084679
Sample Date		Client Info		05 Sep 2023	23 May 2023	15 Feb 2023
Machine Age	hrs	Client Info		2841	2462	1881
Oil Age	hrs	Client Info		1237	1237	2172
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	32	26	22
Chromium	ppm	ASTM D5185m	>10	0	<1	<1
Nickel	ppm	ASTM D5185m	>5	0	0	<1
Titanium	ppm	ASTM D5185m	>15	<1	<1	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>75	3	1	2
Lead	ppm	ASTM D5185m	>10	1	<1	<1
Copper	ppm	ASTM D5185m	>75	5	3	3
Tin	ppm	ASTM D5185m	>8	<1	<1	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		6	6	11
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		3	3	3
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		38	37	38
Calcium	ppm	ASTM D5185m		2233	2301	2495
Phosphorus	ppm	ASTM D5185m		719	760	743
Zinc	ppm	ASTM D5185m		869	929	874
Sulfur	ppm	ASTM D5185m		6520	7178	7580
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	14	15	14
Sodium	ppm	ASTM D5185m		2	1	3
Potassium	ppm	ASTM D5185m	>20	0	0	<1
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPE	RTIES	method	limit/base	current	history1	history2

Visc @ 40°C

cSt

ASTM D445 195


128


131

148



OIL ANALYSIS REPORT

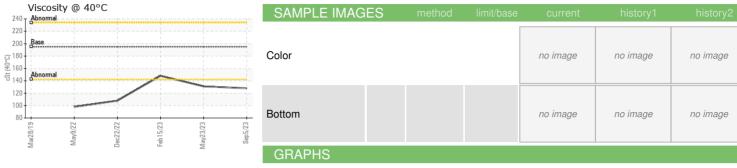

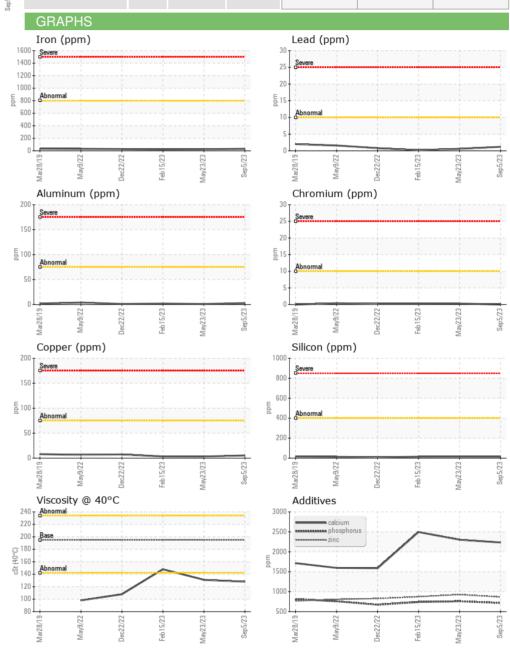





Certificate L2367

Report Id: KEMOZA [WUSCAR] 05950964 (Generated: 09/19/2023 10:46:00) Rev: 1

Laboratory Sample No. Lab Number **Unique Number** Test Package : MOB 1

: 05950964

: PCA0069818 : 10646923

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 13 Sep 2023 : 19 Sep 2023 Diagnostician : Don Baldridge Kemp Quarries - River Valley - Ozark

9446 N Hwy 309 Ozark, AR US 72949

Contact:

ozark@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: