


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

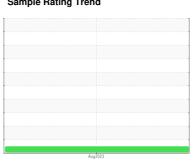

Machine Id **2026849**

Component **Rear Differential**

VOLVO (--- QTS)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition

The condition of the oil is acceptable for the time in service.

				Aug2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0102504		
Sample Date		Client Info		20 Aug 2023		
Machine Age	mls	Client Info		0		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	136		
Chromium	ppm	ASTM D5185m	>10	1		
Nickel	ppm	ASTM D5185m	>10	7		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>100	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		276		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		8		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		7		
Phosphorus	ppm	ASTM D5185m		1282		
Zinc	ppm	ASTM D5185m		16		
Sulfur	ppm	ASTM D5185m		22713		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm		>75	22		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2

Visc @ 40°C

cSt


ASTM D445

107

Contact/Location: MICHAEL DAVIS - PERPRIPCA





OIL ANALYSIS REPORT

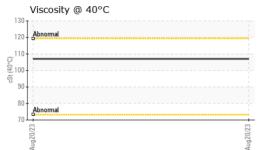




GRAPHS

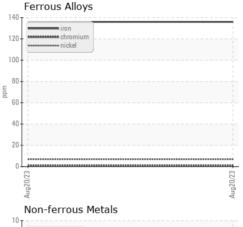

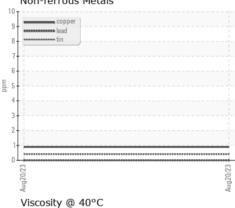

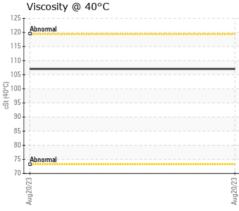



Certificate L2367

Laboratory Sample No. Lab Number

Unique Number : 10659992 Test Package : FLEET

: PCA0102504 : 05958779

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 22 Sep 2023 Diagnosed : 24 Sep 2023 Diagnostician : Don Baldridge

PERDUE FARMS - PRINCE GEORGE

6012 HARDWARE DR PRINCE GEORGE, VA US 23875

Contact: MICHAEL DAVIS

MICHAELP.DAVIS@PERDUE.COM T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: