


OIL ANALYSIS REPORT

DT



NORMAL

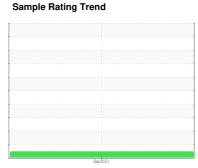

Machine Id 495377 Component

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a components first oil change.

Contamination

There is no indication of any contamination in the

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

AL)				Sep2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0105286		
Sample Date		Client Info		18 Sep 2023		
Machine Age	mls	Client Info		143296		
Oil Age	mls	Client Info		143296		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	29		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>4	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	<1		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	7		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	69		
Manganese	ppm	ASTM D5185m	0	<1		
Magnesium	ppm	ASTM D5185m	950	1068		
Calcium	ppm	ASTM D5185m	1050	1278		
Phosphorus	ppm	ASTM D5185m	995	1128		
Zinc	ppm	ASTM D5185m	1180	1429		
Sulfur	ppm	ASTM D5185m	2600	3166		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	5		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	2		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.8		
Nitration	Abs/cm	*ASTM D7624	>20	11.7		
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.1		
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	19.5		
Base Number (BN)	mg KOH/g	ASTM D2896		6.5		

Contact/Location: ROSTY VITER - MILPHINE



OIL ANALYSIS REPORT

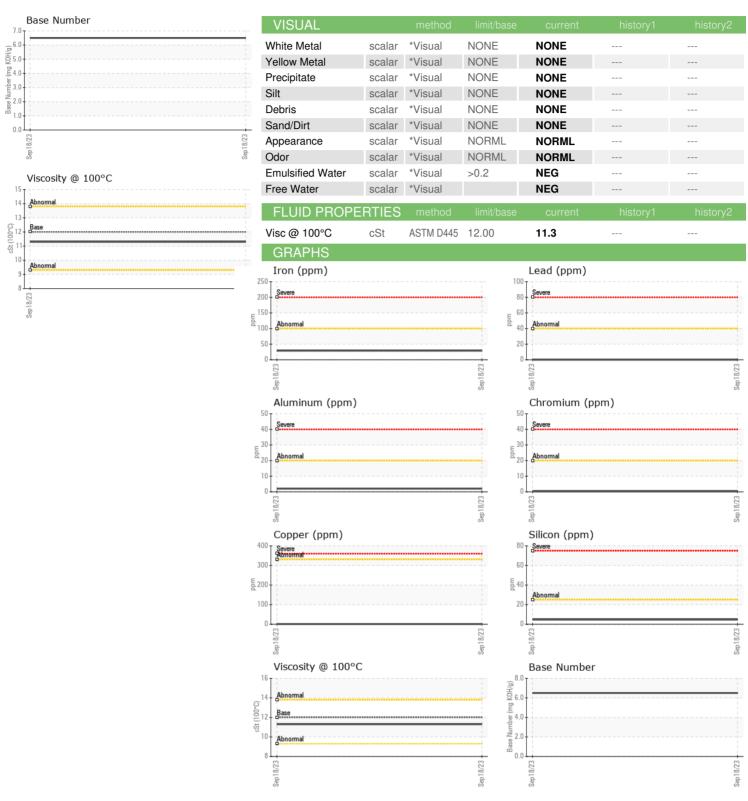



Laboratory Sample No. Lab Number

Unique Number

: 10675299

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0105286 : 05968748

Received : 04 Oct 2023 Diagnosed

: 04 Oct 2023 Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

MILLER TRUCK LEASING #118

2196 BENNETT ROAD PHILADELPHIA, PA US 19116

Contact: ROSTY VITER rviter@millertransgroup.com T: (215)552-9832

Contact/Location: ROSTY VITER - MILPHINE

F: (215)552-9892

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)