




PROBLEM SUMMARY


Area
PASTA [98497960]
Machine Id
A PRESS MAIN MIXER
Component
Gearbox
Fluid
GEAR OIL ISO 320 (--- GAL)

Sample Rating Trend

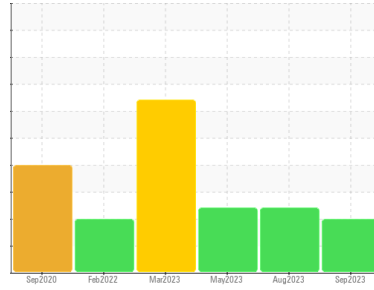

COMPONENT CONDITION SUMMARY

▲ Particle Trend

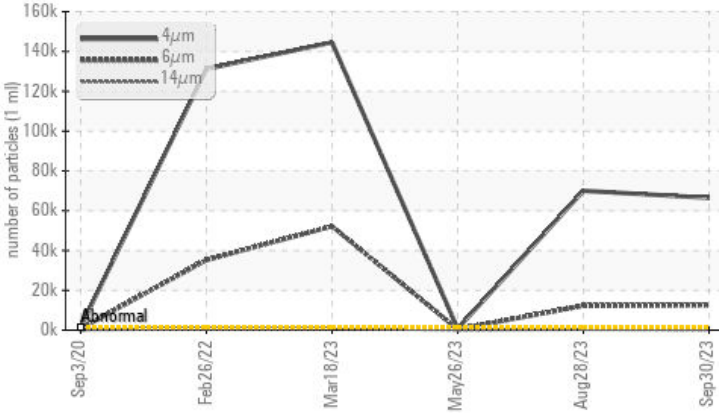

RECOMMENDATION

The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	ABNORMAL
Particles >4µm	ASTM D7647	>1300	▲ 66457	▲ 70007	774
Particles >6µm	ASTM D7647	>320	▲ 12617	▲ 12296	▲ 422
Particles >14µm	ASTM D7647	>80	▲ 171	▲ 357	72
Particles >21µm	ASTM D7647	>20	▲ 40	▲ 112	24
Oil Cleanliness	ISO 4406 (c)	>17/15/13	▲ 23/21/15	▲ 23/21/16	▲ 17/16/13

Customer Id: KRASPRMO
Sample No.: PCA0099588
Lab Number: 05977054
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

28 Aug 2023 Diag: Doug Bogart

ISO



The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

view report



26 May 2023 Diag: Don Baldrige

WATER



We advise that you check for the source of water entry. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. Free water present. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

view report



18 Mar 2023 Diag: Doug Bogart

ISO




The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

view report



Area
PASTA [98497960]
 Machine Id
A PRESS MAIN MIXER
 Component
Gearbox
 Fluid
GEAR OIL ISO 320 (--- GAL)

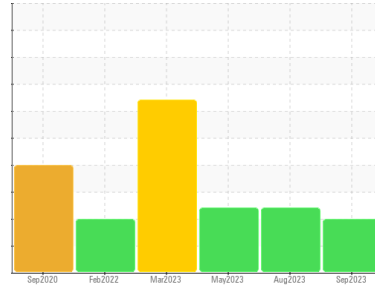

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0099588	PCA0099584	PCA0099604
Sample Date	Client Info	30 Sep 2023	28 Aug 2023	26 May 2023
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	Changed	Changed	Changed
Sample Status		ABNORMAL	ABNORMAL	ABNORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >200	5	7	4
Chromium	ppm	ASTM D5185m >15	0	0	0
Nickel	ppm	ASTM D5185m >15	0	0	0
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >25	0	1	0
Lead	ppm	ASTM D5185m >100	0	0	0
Copper	ppm	ASTM D5185m >200	0	<1	0
Tin	ppm	ASTM D5185m >25	0	0	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m 50	0	0	0
Barium	ppm	ASTM D5185m 15	0	0	0
Molybdenum	ppm	ASTM D5185m 15	0	0	0
Manganese	ppm	ASTM D5185m	0	0	0
Magnesium	ppm	ASTM D5185m 50	0	2	0
Calcium	ppm	ASTM D5185m 50	0	0	0
Phosphorus	ppm	ASTM D5185m 350	541	532	474
Zinc	ppm	ASTM D5185m 100	0	0	0
Sulfur	ppm	ASTM D5185m 12500	1409	1662	1423

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >50	5	5	6
Sodium	ppm	ASTM D5185m	0	1	0
Potassium	ppm	ASTM D5185m >20	2	4	0

FLUID CLEANLINESS


method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >1300	▲ 66457	▲ 70007	774
Particles >6µm	ASTM D7647 >320	▲ 12617	▲ 12296	▲ 422
Particles >14µm	ASTM D7647 >80	▲ 171	▲ 357	72
Particles >21µm	ASTM D7647 >20	▲ 40	▲ 112	24
Particles >38µm	ASTM D7647 >4	2	▲ 6	4
Particles >71µm	ASTM D7647 >3	1	0	0
Oil Cleanliness	ISO 4406 (c) >17/15/13	▲ 23/21/15	▲ 23/21/16	▲ 17/16/13

FLUID DEGRADATION


method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.85	0.39	0.35	0.32

OIL ANALYSIS REPORT


▲ Particle Trend

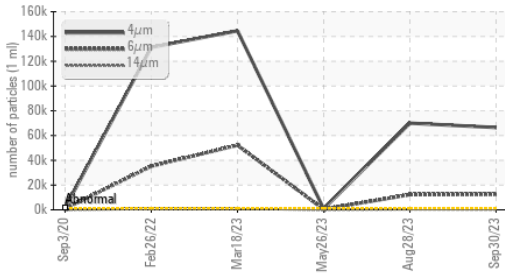


▲ Particle Trend

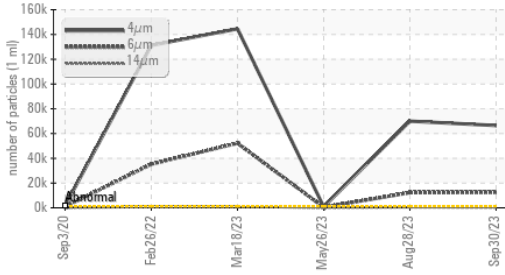

Acid Number

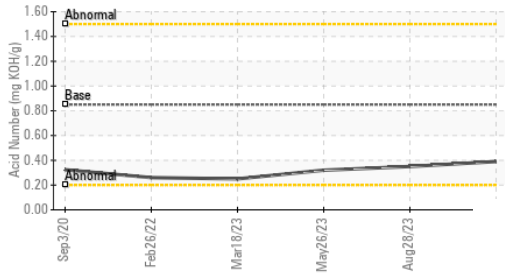


Viscosity @ 40°C

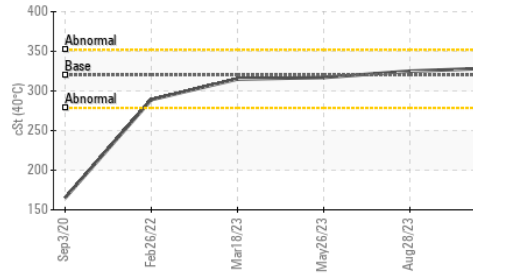






PARAMETER	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	0.2%
Free Water	scalar	*Visual		NEG	▲ 1.0

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 320	329	325	317

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

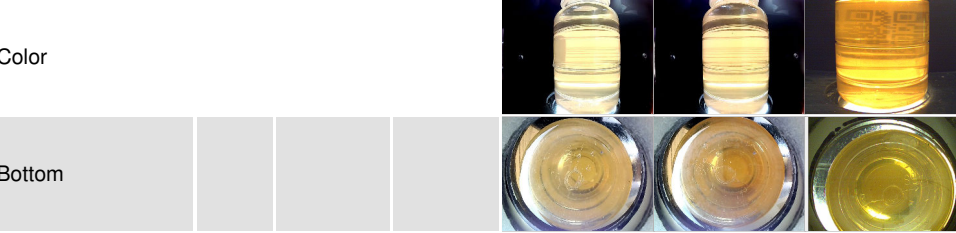

GRAPHS

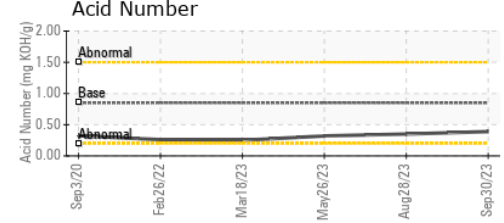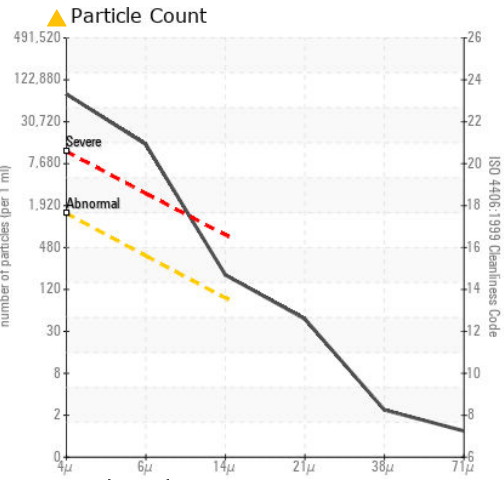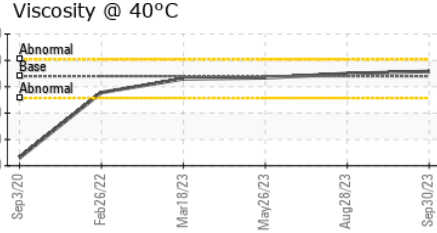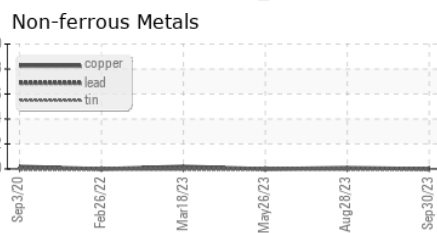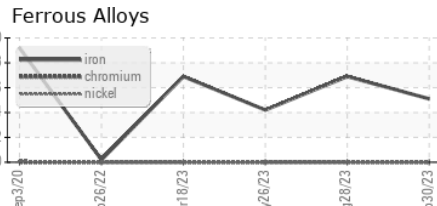

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0099588 **Received** : 12 Oct 2023
Lab Number : 05977054 **Diagnosed** : 15 Oct 2023
Unique Number : 10689004 **Diagnostician** : Don Baldrige
Test Package : IND 2 (Additional Tests: PrtCount)

KraftHeinz - Springfield - Plant 8311 PCA
 2035 E BENNETT
 SPRINGFIELD, MO
 US 65804
 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: