


PROBLEM SUMMARY


Area
[98498090]
 Machine Id
KR-GR-003066 - TUMBLER 1 (S/N TUMBLE ROOM - 11513089)
 Component
Hydraulic System
 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

Sample Rating Trend

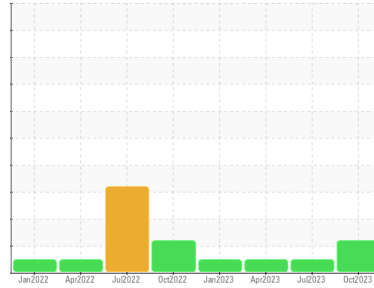

COMPONENT CONDITION SUMMARY

▲ Particle Trend

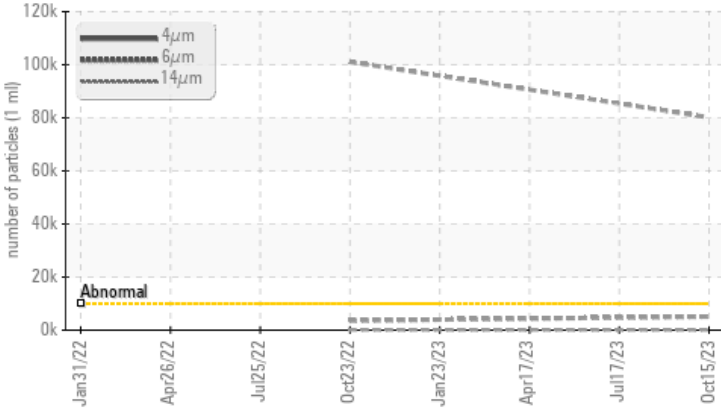

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	NORMAL	NORMAL
Particles >4µm	ASTM D7647	>10000	▲ 80142	---	---
Particles >6µm	ASTM D7647	>2500	▲ 5111	---	---
Oil Cleanliness	ISO 4406 (c)	>20/18/16	▲ 24/20/11	---	---

Customer Id: KRAKIR
 Sample No.: PCA0104782
 Lab Number: 05979583
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

17 Jul 2023 Diag: Don Baldrige

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

view report



17 Apr 2023 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

view report



23 Jan 2023 Diag: Don Baldrige

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

view report



OIL ANALYSIS REPORT

Sample Rating Trend

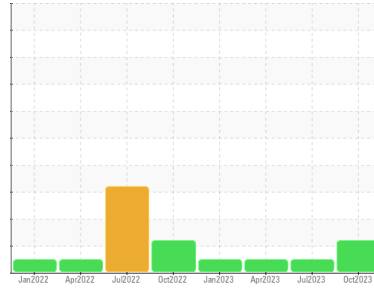

ISO



Area
[98498090]
 Machine Id
KR-GR-003066 - TUMBLER 1 (S/N TUMBLE ROOM - 11513089)
 Component
Hydraulic System
 Fluid
AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PCA0104782	PCA0099362	PCA0094734
Sample Date	Client Info	15 Oct 2023	17 Jul 2023	17 Apr 2023
Machine Age	hrs	0	0	0
Oil Age	hrs	0	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m >20	5	6	6
Chromium	ppm	ASTM D5185m >20	1	1	1
Nickel	ppm	ASTM D5185m >20	<1	<1	<1
Titanium	ppm	ASTM D5185m	0	0	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >20	<1	<1	0
Lead	ppm	ASTM D5185m >20	<1	<1	2
Copper	ppm	ASTM D5185m >20	6	5	6
Tin	ppm	ASTM D5185m >20	0	0	0
Vanadium	ppm	ASTM D5185m	0	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185m 5	0	0	0
Barium	ppm	ASTM D5185m 5	0	0	0
Molybdenum	ppm	ASTM D5185m 5	0	0	0
Manganese	ppm	ASTM D5185m	<1	<1	<1
Magnesium	ppm	ASTM D5185m 25	0	1	1
Calcium	ppm	ASTM D5185m 200	5	16	18
Phosphorus	ppm	ASTM D5185m 300	292	316	305
Zinc	ppm	ASTM D5185m 370	240	279	273
Sulfur	ppm	ASTM D5185m 2500	4655	5945	4775

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185m >15	2	2	3
Sodium	ppm	ASTM D5185m	<1	<1	0
Potassium	ppm	ASTM D5185m >20	0	0	1

FLUID CLEANLINESS


method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >10000	▲ 80142	---	---
Particles >6µm	ASTM D7647 >2500	▲ 5111	---	---
Particles >14µm	ASTM D7647 >640	11	---	---
Particles >21µm	ASTM D7647 >160	3	---	---
Particles >38µm	ASTM D7647 >40	1	---	---
Particles >71µm	ASTM D7647 >10	0	---	---
Oil Cleanliness	ISO 4406 (c) >20/18/16	▲ 24/20/11	---	---

FLUID DEGRADATION


method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D8045 0.57	0.42	---	---

OIL ANALYSIS REPORT


▲ Particle Trend

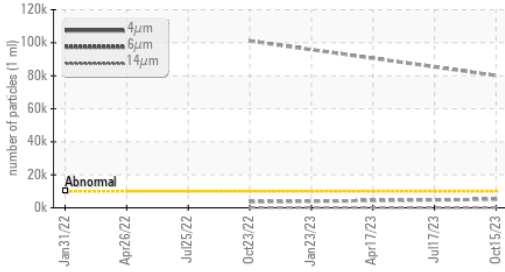


▲ Particle Trend

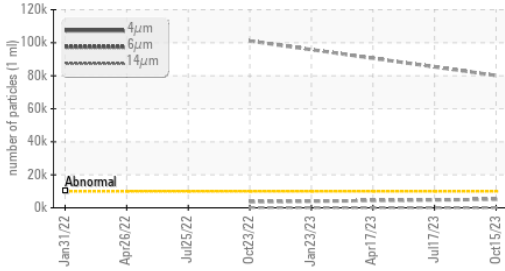

Acid Number

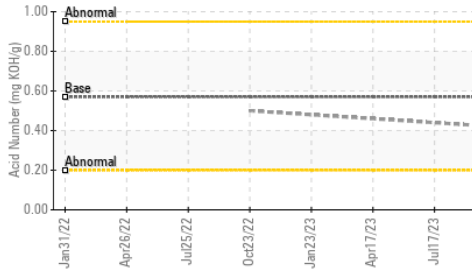

Viscosity @ 40°C

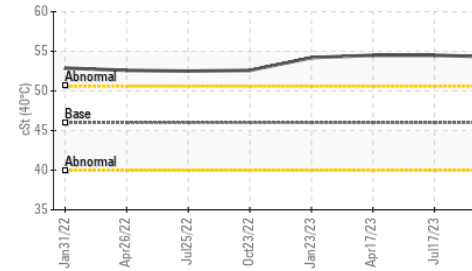






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 46	54.3	54.5	54.5

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color				
Bottom				

GRAPHS

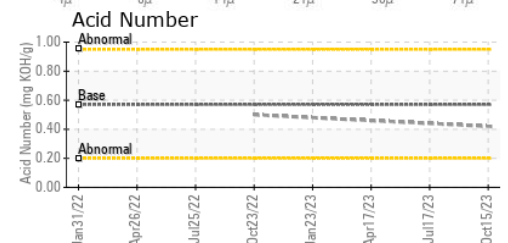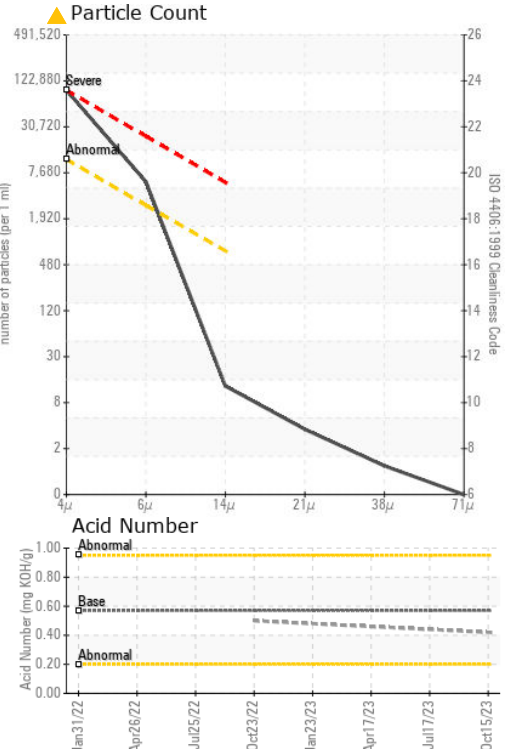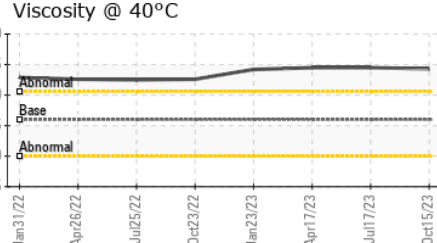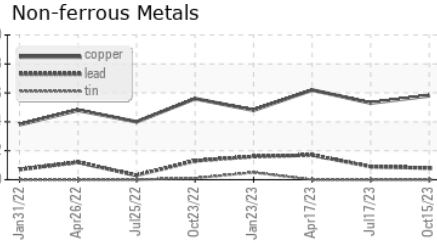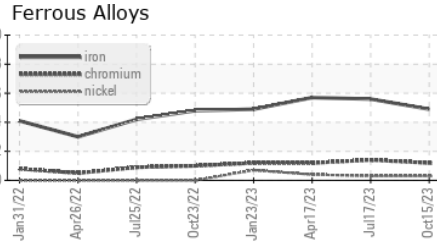

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0104782
Lab Number : 05979583
Unique Number : 10696878
Test Package : IND 2

KraftHeinz - Kirksville - Plant 8333 PCA
 2504 INDUSTRIAL DR
 KIRKSVILLE, MO
 US 63501
 Contact: WALLACE WARD
 wallace.ward@kraftheinzcompany.com
 T: (660)627-1031
 F: (660)627-5887

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)