


OIL ANALYSIS REPORT







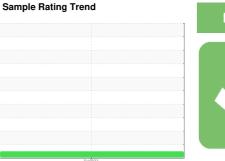

Machine Id **413067** Component 1 Differential

GEAR OIL SAE 80W9

DIAGNOSIS Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: 1st Axle / Pusher)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

) (GAL)						
<u> </u>				0ct2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0085483		
Sample Date		Client Info		10 Oct 2023		
Machine Age	hrs	Client Info		37103		
Oil Age	hrs	Client Info		37103		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>870	107		
Chromium	ppm	ASTM D5185m	>8	<1		
Nickel	ppm	ASTM D5185m	>25	7		
Titanium	ppm	ASTM D5185m	>4	0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>40	2		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>60	<1		
Tin	ppm	ASTM D5185m	>5	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	400	260		
Barium	ppm	ASTM D5185m	200	0		
Molybdenum	ppm	ASTM D5185m	12	0		
Manganese	ppm	ASTM D5185m		3		
Magnesium	ppm	ASTM D5185m	12	0		
Calcium	ppm	ASTM D5185m	150	15		
Phosphorus	ppm	ASTM D5185m	1650	988		
Zinc	ppm	ASTM D5185m	125	0		
Sulfur	ppm	ASTM D5185m	22500	21258		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>285	189		
Sodium	ppm	ASTM D5185m	>170	4		
Potassium	ppm	ASTM D5185m	>20	2		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2





OIL ANALYSIS REPORT

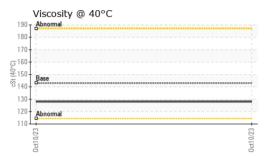


SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			no image	no image	no image
Bottom			no image	no image	no image

GRAPHS

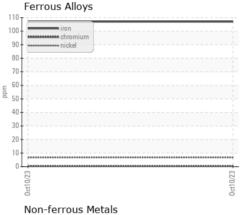

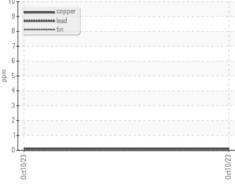

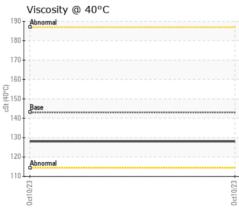





Laboratory Sample No. Lab Number

Unique Number : 10697338 Test Package : FLEET

: GFL0085483 : 05980043

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Oct 2023 Diagnosed : 18 Oct 2023 Diagnostician : Don Baldridge

GFL Environmental - 983 - Sugar Land Hauling 16011 West Belfort Street

Sugar Land, TX US 77498

Contact: TECHNICIAN ACCOUNT

wcgfldemo@gmail.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: