


PROBLEM SUMMARY

Sample Rating Trend




ISO

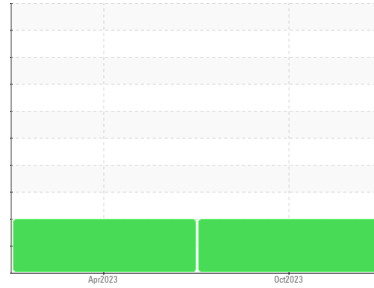

Machine Id
MAX 3
 Component
Hydraulic System
 Fluid
PETRO CANADA CALFLO AF (23 GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

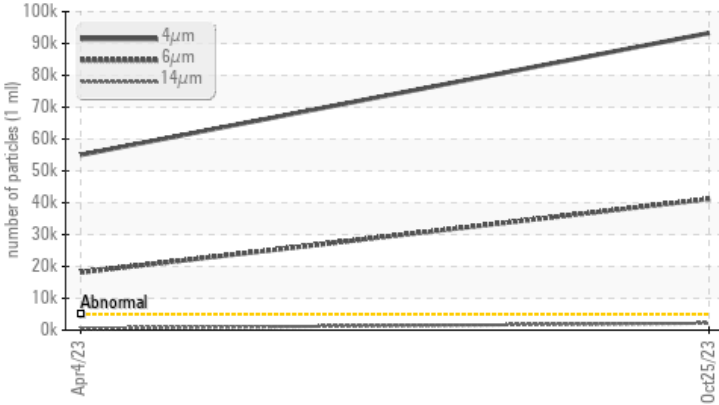

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	---
Particles >4µm	ASTM D7647	>5000	▲ 93277	▲ 55017	---
Particles >6µm	ASTM D7647	>1300	▲ 41174	▲ 18147	---
Particles >14µm	ASTM D7647	>160	▲ 2172	▲ 599	---
Particles >21µm	ASTM D7647	>40	▲ 324	▲ 84	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 24/23/18	▲ 23/21/16	---

Customer Id: GALGURIL
 Sample No.: PCA0096788
 Lab Number: 05994304
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.

HISTORICAL DIAGNOSIS

04 Apr 2023 Diag: Don Baldrige

ISO




We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

view report



OIL ANALYSIS REPORT

Sample Rating Trend

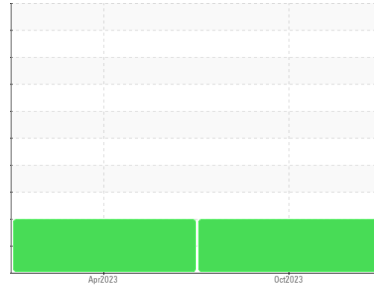

ISO



Machine Id
MAX 3
 Component
Hydraulic System
 Fluid
PETRO CANADA CALFLO AF (23 GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			PCA0096788	PCA0088483	---
Sample Date	Client Info			25 Oct 2023	04 Apr 2023	---
Machine Age	mths	Client Info		10	3	---
Oil Age	mths	Client Info		10	3	---
Oil Changed	Client Info			N/A	N/A	---
Sample Status				ABNORMAL	ABNORMAL	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	0	---
Chromium	ppm	ASTM D5185m	>20	<1	0	---
Nickel	ppm	ASTM D5185m	>20	0	0	---
Titanium	ppm	ASTM D5185m		0	0	---
Silver	ppm	ASTM D5185m		0	0	---
Aluminum	ppm	ASTM D5185m	>20	<1	0	---
Lead	ppm	ASTM D5185m	>20	0	0	---
Copper	ppm	ASTM D5185m	>20	<1	0	---
Tin	ppm	ASTM D5185m	>20	<1	0	---
Vanadium	ppm	ASTM D5185m		0	0	---
Cadmium	ppm	ASTM D5185m		0	0	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	---
Barium	ppm	ASTM D5185m	0	20	0	---
Molybdenum	ppm	ASTM D5185m	0	0	0	---
Manganese	ppm	ASTM D5185m	0	0	<1	---
Magnesium	ppm	ASTM D5185m	0	0	1	---
Calcium	ppm	ASTM D5185m	0	0	<1	---
Phosphorus	ppm	ASTM D5185m	270	158	95	---
Zinc	ppm	ASTM D5185m	0	19	0	---
Sulfur	ppm	ASTM D5185m	10	0	4	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	0	---
Sodium	ppm	ASTM D5185m		3	0	---
Potassium	ppm	ASTM D5185m	>20	0	0	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	▲ 93277	▲ 55017	---
Particles >6µm		ASTM D7647	>1300	▲ 41174	▲ 18147	---
Particles >14µm		ASTM D7647	>160	▲ 2172	▲ 599	---
Particles >21µm		ASTM D7647	>40	▲ 324	▲ 84	---
Particles >38µm		ASTM D7647	>10	4	1	---
Particles >71µm		ASTM D7647	>3	0	0	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	▲ 24/23/18	▲ 23/21/16	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.03	0.08	0.08	---


OIL ANALYSIS REPORT

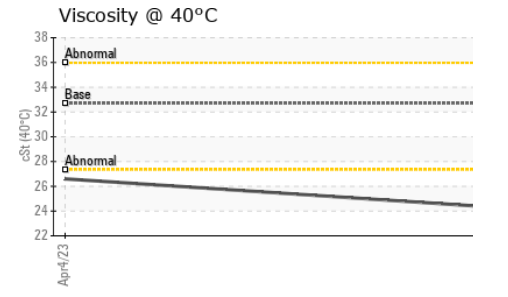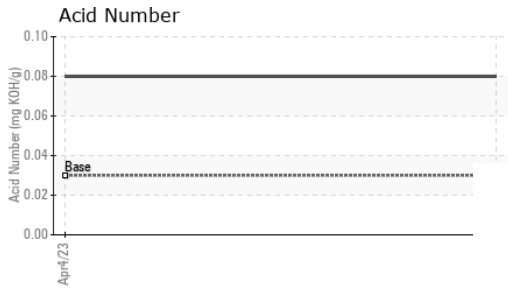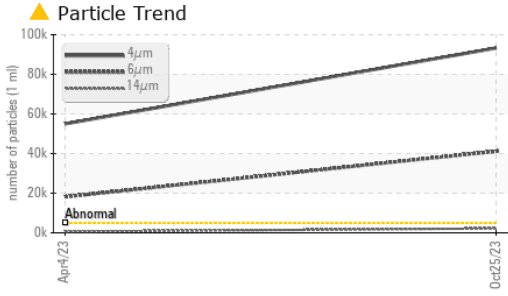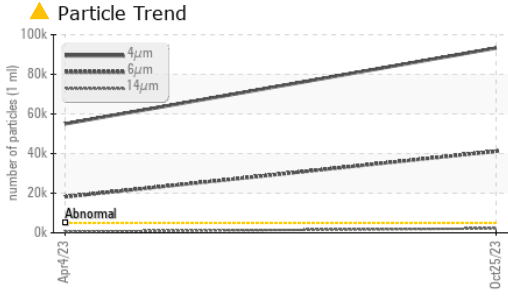





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	32.7	24.3	26.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

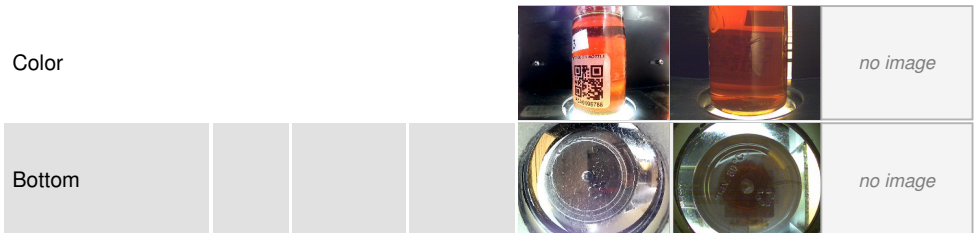

GRAPHS

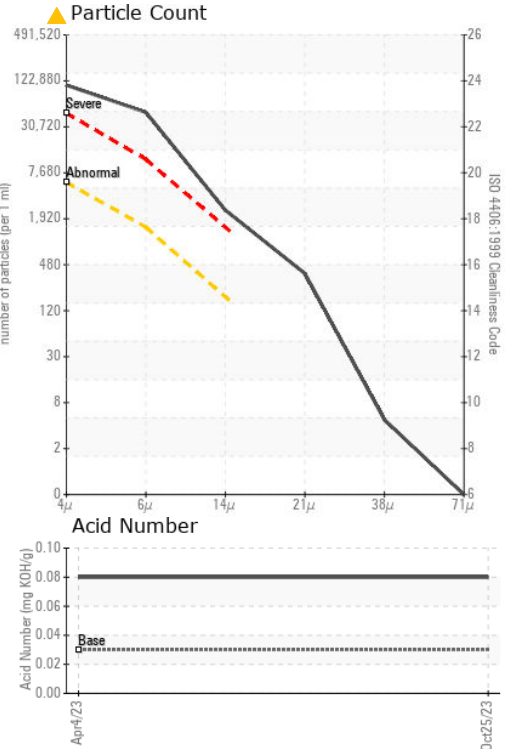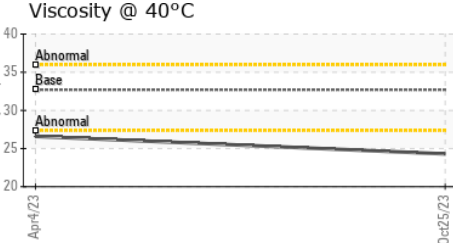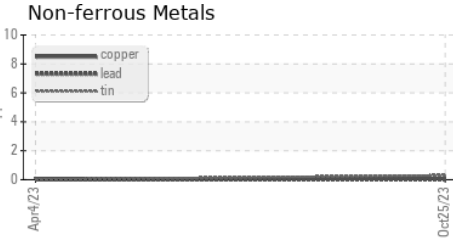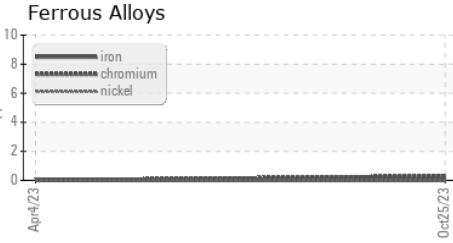

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0096788 **Received** : 31 Oct 2023
Lab Number : 05994304 **Diagnosed** : 01 Nov 2023
Unique Number : 10722664 **Diagnostician** : Don Baldrige
Test Package : IND 2

GALLAGHER CORPORATION
 3908 MORRISON DR
 GURNEE, IL
 US 60031
 Contact: BRAD CLIFF
 bcliff@gallaghercorp.com
 T: (847)249-3440
 F: (847)249-3473

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)