


OIL ANALYSIS REPORT

(31590ME) Walgreens - Tractor [Walgreens - Tractor] 136D25691

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

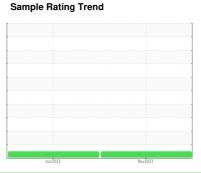



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| | | | Guilloco | | | |
|-----------------|----------|-------------|------------|-------------|-------------|----------|
| SAMPLE INFORMA | ATION | method | | | | history2 |
| Sample Number | | Client Info | | PCA0093469 | PCA0093503 | |
| Sample Date | | Client Info | | 02 Nov 2023 | 27 Jun 2023 | |
| Machine Age | mls | Client Info | | 79846 | 79846 | |
| | mls | Client Info | | 79846 | 79846 | |
| Oil Changed | | Client Info | | Changed | Changed | |
| Sample Status | | | | NORMAL | NORMAL | |
| CONTAMINATIO | N | method | limit/base | current | history1 | history2 |
| Fuel | | WC Method | >5 | <1.0 | <1.0 | |
| Glycol | | WC Method | | NEG | NEG | |
| WEAR METALS | | method | limit/base | current | history1 | history2 |
| | opm | ASTM D5185m | >110 | 11 | 11 | |
| ' | opm | ASTM D5105m | | <1 | 0 | |
| | | ASTM D5185m | >4 | <1 <1 | 0 | |
| | opm | | >८ | | 4 | |
| | opm | ASTM D5185m | . 0 | 6 | | |
| | opm | ASTM D5185m | >2 | 0 | 0 | |
| | opm | ASTM D5185m | | 1 | <1 | |
| | opm | ASTM D5185m | >45 | <1 | 0 | |
| | opm | ASTM D5185m | >85 | <1 | <1 | |
| | opm | ASTM D5185m | >4 | 0 | 0 | |
| Vanadium p | opm | ASTM D5185m | | <1 | 0 | |
| Cadmium | opm | ASTM D5185m | | 0 | 0 | |
| ADDITIVES | | method | limit/base | current | history1 | history2 |
| Boron p | opm | ASTM D5185m | 2 | 30 | 17 | |
| Barium | opm | ASTM D5185m | 0 | 0 | 0 | |
| Molybdenum p | opm | ASTM D5185m | 50 | 49 | 53 | |
| Manganese p | opm | ASTM D5185m | 0 | <1 | <1 | |
| Magnesium | opm | ASTM D5185m | 950 | 853 | 790 | |
| Calcium | opm | ASTM D5185m | 1050 | 1124 | 1164 | |
| | opm | ASTM D5185m | 995 | 999 | 1013 | |
| | opm | | 1180 | 1224 | 1175 | |
| | opm | ASTM D5185m | 2600 | 3194 | 4225 | |
| CONTAMINANT | S | method | limit/base | current | history1 | history2 |
| Silicon | opm | ASTM D5185m | >30 | 4 | 4 | |
| | opm | ASTM D5185m | | 1 | 0 | |
| | opm | ASTM D5185m | >20 | 3 | 2 | |
| INFRA-RED | | method | limit/base | current | history1 | history2 |
| Soot % | % | *ASTM D7844 | >3 | 0.2 | 0.2 | |
| | Abs/cm | *ASTM D7624 | >20 | 6.7 | 6.9 | |
| | Abs/.1mm | *ASTM D7415 | >30 | 17.5 | 17.8 | |
| FLUID DEGRADA | MOITA | method | limit/base | current | history1 | history2 |
| Oxidation / | Abs/.1mm | *ASTM D7414 | >25 | 12.9 | 13.5 | |
| | | ASTM D2896 | | 7.8 | 8.7 | |
| = 3.30 · (2.11) | | | | | 0 | |



OIL ANALYSIS REPORT

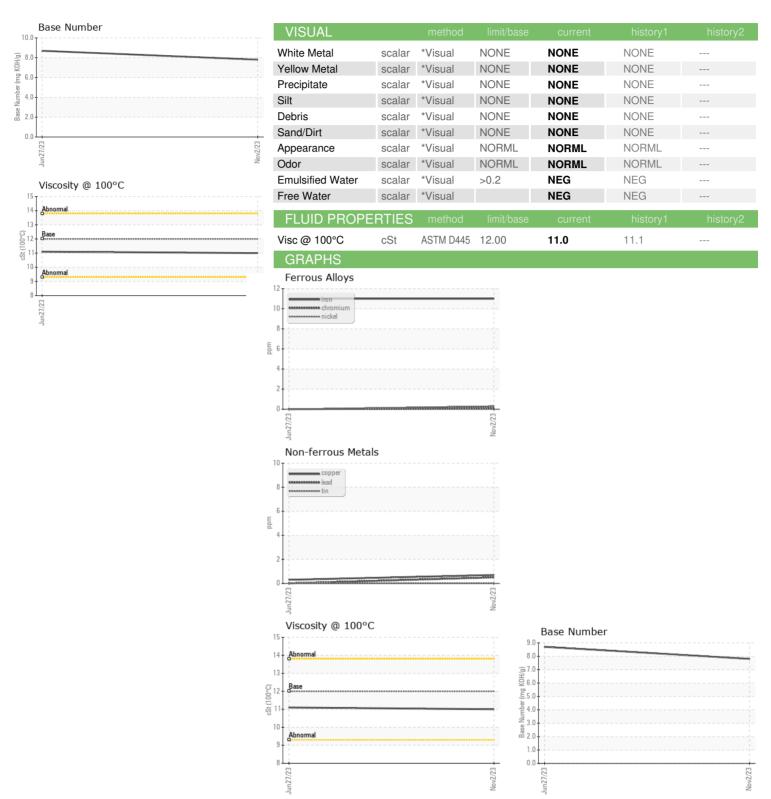





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: 06004828

: PCA0093469 : 10738590 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 10 Nov 2023 Received

Diagnosed : 13 Nov 2023 : Wes Davis Diagnostician

Transervice - Shop 1376 - Berkeley-Linden

3425 Tremley Point Road Linden, NJ US 07036

Contact: Shop 1376 Oil Analysis shop1376@transervice.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: