

# **OIL ANALYSIS REPORT**

# Sample Rating Trend





# KEMP QUARRIES / KEMP STONE - FAIRLAND **WL094**

Component **Rear Differential** 

PETRO CANADA PRODU

# DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. ( Customer Sample Comment: PM-3 sampled fluid)

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.


### **Fluid Condition**


The condition of the oil is acceptable for the time in service.


JRO TO-4 SAE 50 ( GAL)						
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0087080	PCA0086466	PCA0062033
Sample Date		Client Info		02 Nov 2023	08 Aug 2023	11 Jan 2023
Machine Age	hrs	Client Info		32210	31910	31363
Oil Age	hrs	Client Info		32210	31910	31363
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINA	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG	NEG	NEG
WEAR METAI	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	19	18	14
Chromium	ppm	ASTM D5185m	>3	0	<1	<1
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>2	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>30	0	<1	1
Lead	ppm	ASTM D5185m	>13	0	0	<1
Copper	ppm	ASTM D5185m	>103	3	2	<1
Tin	ppm	ASTM D5185m	>5	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	8	0	2
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	1	1
Manganese	ppm	ASTM D5185m	0	0	<1	<1
Magnesium	ppm	ASTM D5185m	9	15	13	17
Calcium	ppm	ASTM D5185m	3114	2643	3115	2823
Phosphorus	ppm	ASTM D5185m	1099	1028	1077	934
Zinc	ppm	ASTM D5185m	1245	1229	1261	1218
Sulfur	ppm	ASTM D5185m	7086	6604	7452	6798
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>100	5	5	6
Sodium	ppm	ASTM D5185m		1	2	<1
Potassium	ppm	ASTM D5185m	>20	0	0	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
11.00\ D						



# **OIL ANALYSIS REPORT**

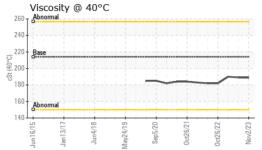

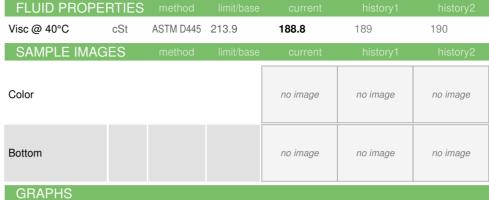

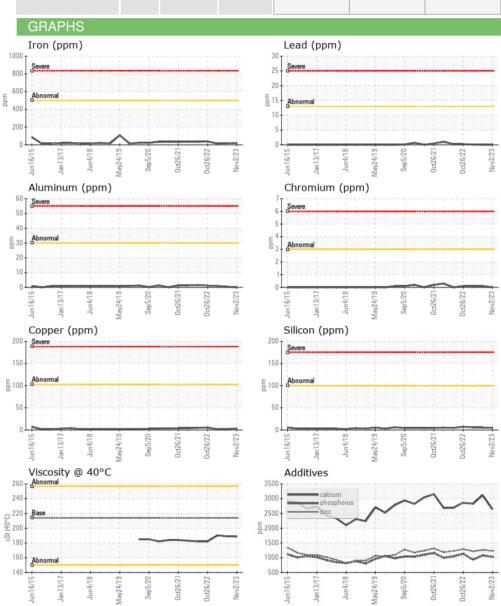



Certificate L2367

Laboratory

Sample No. Lab Number **Unique Number** Test Package : MOB 1

: PCA0087080 : 06006601

: 10740363

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 Nov 2023 Diagnosed : 23 Nov 2023

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Kemp Quarries - Kemp Stone - Fairland

18350 S 590 Rd Fairland, OK US 74343

Contact:

fairland@kempstone.com

T: F: