

OIL ANALYSIS REPORT

Sample Rating Trend NORMAL

Machine Id **Abner Gap 2**

Component

Compressor

CITGO PACEMAKER GAS ENGIN 1700 SERIES 40W (26 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

	-			Nov2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0111847		
Sample Date		Client Info		10 Nov 2023		
Machine Age	hrs	Client Info		161288		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		7		
Calcium	ppm	ASTM D5185m		1255		
Phosphorus	ppm	ASTM D5185m		278		
Zinc	ppm	ASTM D5185m		331		
Sulfur	ppm	ASTM D5185m		2409		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRA	OATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.32		



OIL ANALYSIS REPORT

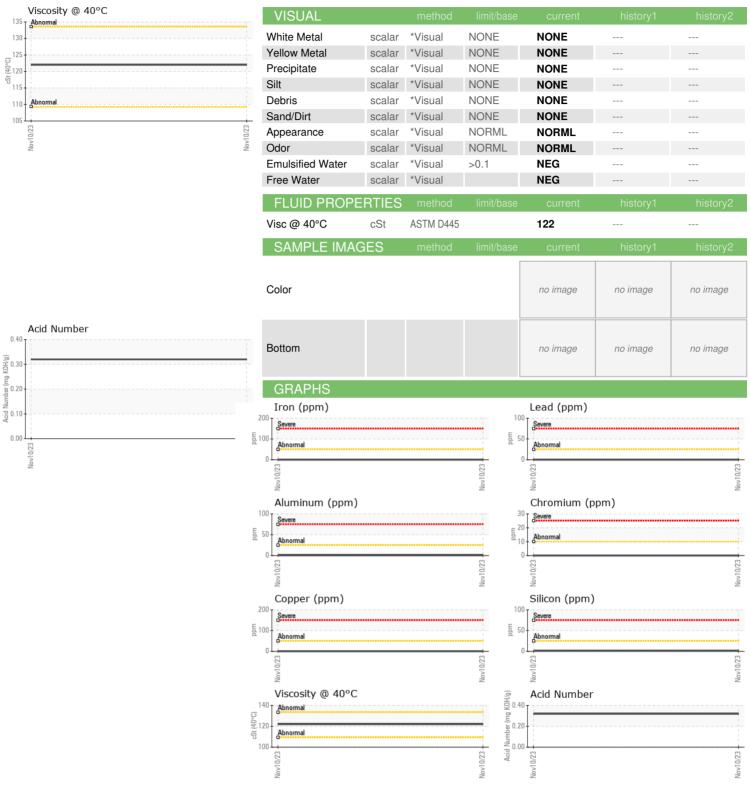





Laboratory Sample No. Lab Number **Unique Number**

: PCA0111847 : 06010243

: 10749387

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 16 Nov 2023 : 20 Nov 2023

Diagnostician : Don Baldridge

Test Package : MOB 2 (Additional Tests: FuelDilution)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ENERVEST OPERATING - ABNER GAP

7556 SANDLICK ROAD BEE, VA

US 24217

Contact: Service Manager

F:

T: