




PROBLEM SUMMARY

Sample Rating Trend

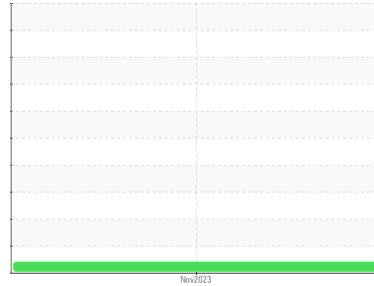

VIS DEBRIS



Machine Id
912066

Component
Hydraulic System

Fluid
PETRO CANADA ENVIRON MV 46 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				ABNORMAL	---	---
Debris	scalar	*Visual	NONE	▲ MODER	---	---

Customer Id: GFL836
Sample No.: GFL0099885
Lab Number: 06012319
Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.


HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

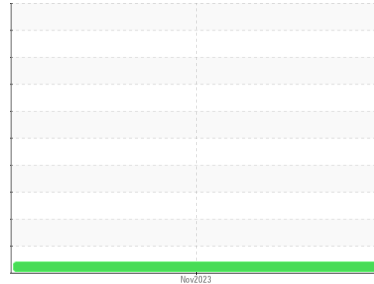

Machine Id
912066

Component
Hydraulic System

Fluid
PETRO CANADA ENVIRON MV 46 (--- GAL)

DIAGNOSIS

▲ Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal for time on oil.

▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0099885	---	---
Sample Date	Client Info		12 Nov 2023	---	---
Machine Age	hrs	Client Info	4771	---	---
Oil Age	hrs	Client Info	4771	---	---
Oil Changed	Client Info		Not Changed	---	---
Sample Status			ABNORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	38	---	---
Chromium	ppm	ASTM D5185m >10	0	---	---
Nickel	ppm	ASTM D5185m >10	0	---	---
Titanium	ppm	ASTM D5185m	<1	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >10	<1	---	---
Lead	ppm	ASTM D5185m >10	0	---	---
Copper	ppm	ASTM D5185m >75	5	---	---
Tin	ppm	ASTM D5185m >10	<1	---	---
Vanadium	ppm	ASTM D5185m	<1	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	0	---	---
Barium	ppm	ASTM D5185m 0	0	---	---
Molybdenum	ppm	ASTM D5185m 0	<1	---	---
Manganese	ppm	ASTM D5185m 0	<1	---	---
Magnesium	ppm	ASTM D5185m 0	28	---	---
Calcium	ppm	ASTM D5185m 0	55	---	---
Phosphorus	ppm	ASTM D5185m 650	282	---	---
Zinc	ppm	ASTM D5185m 0	339	---	---
Sulfur	ppm	ASTM D5185m 1420	1177	---	---

CONTAMINANTS



	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >20	4	---	---
Sodium	ppm	ASTM D5185m	8	---	---
Potassium	ppm	ASTM D5185m >20	2	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.12	0.36	---	---



OIL ANALYSIS REPORT

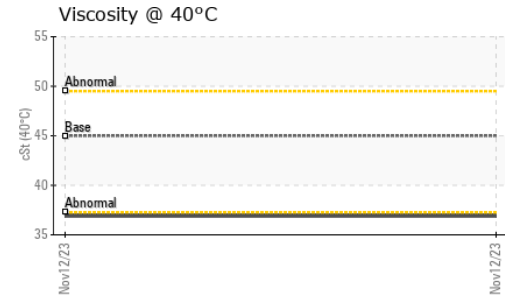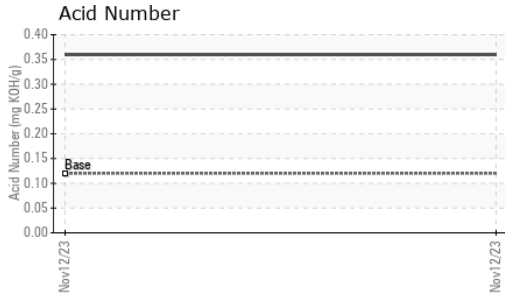





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	NONE	---
Debris	scalar	*Visual	NONE	▲ MODER	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.1	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45.0	36.9	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS

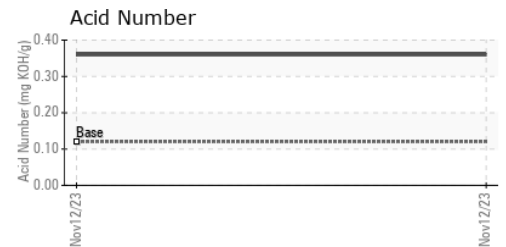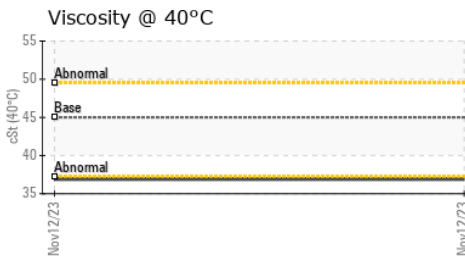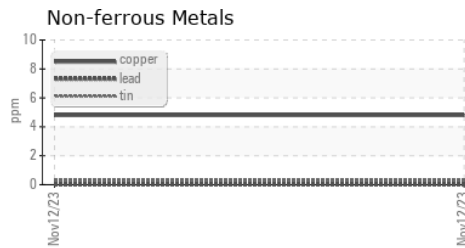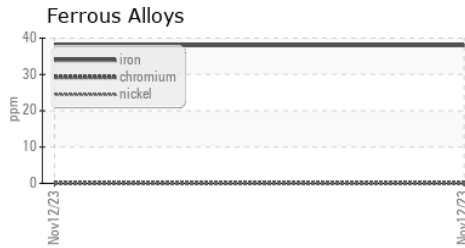

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0099885 **Received** : 20 Nov 2023
Lab Number : 06012319 **Diagnosed** : 22 Nov 2023
Unique Number : 10751463 **Diagnostician** : Don Baldrige
Test Package : FLEET (Additional Tests: PrtCount)

GFL Environmental - 836 - Kansas City Hauling
 7801 East Truman Road
 Kansas City, MO
 US 64126
 Contact: Robert Hart
 rhart@gflenv.com
 T: (580)461-1509
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)