


**OIL ANALYSIS REPORT** 



Component

**Rear Right Final Drive** 

PETRO CANADA PRODURO TO-4 SAE 50 (

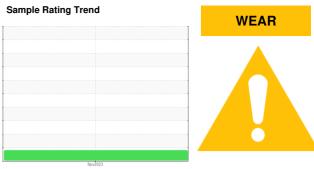

## **DIAGNOSIS**

### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. ( Customer Sample Comment: Sampled only )

Gear wear is indicated.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in

GAL)				Nov2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0087084		
Sample Date		Client Info		13 Nov 2023		
Machine Age	hrs	Client Info		43537		
Oil Age	hrs	Client Info		43537		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>500	<b>973</b>		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
- Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	5		
_ead	ppm	ASTM D5185m	>25	0		
Copper	ppm		>50	18		
in	ppm	ASTM D5185m	>10	0		
/anadium	ppm	ASTM D5185m	>10	0		
Cadmium		ASTM D5185m		0		
	ppm		11 11 11			
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	5		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	1		
Manganese	ppm	ASTM D5185m	0	7		
/lagnesium	ppm	ASTM D5185m	9	16		
Calcium	ppm	ASTM D5185m	3114	3757		
Phosphorus	ppm	ASTM D5185m	1099	886		
Zinc	ppm	ASTM D5185m	1245	1020		
Sulfur	ppm	ASTM D5185m	7086	5513		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	51		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
ellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
ree Water	scalar	*Visual	× 0.2	NEG		
23.48) Rev: 1	Julian	Vidual		ILU		Submitted By



# **OIL ANALYSIS REPORT**

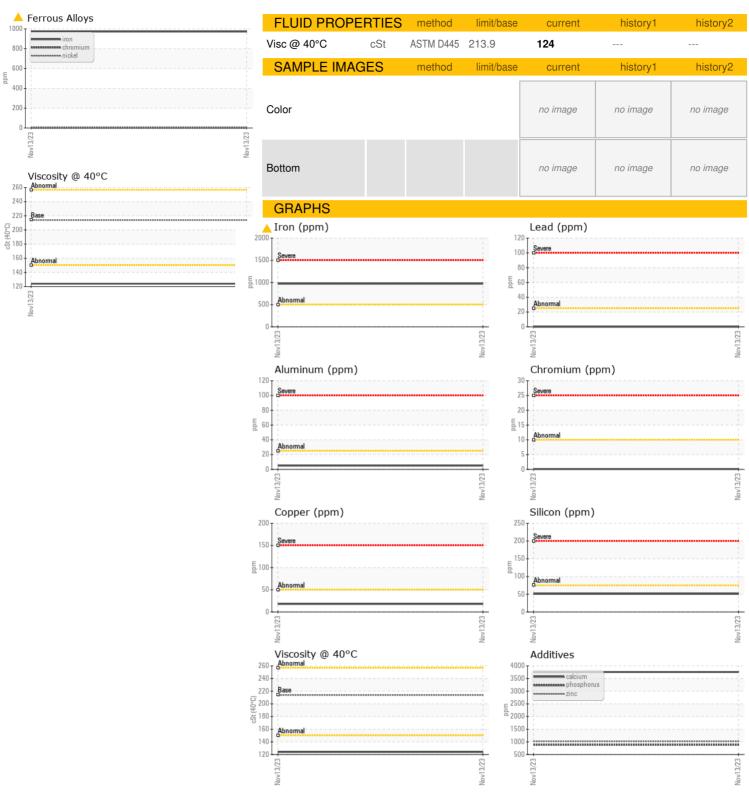



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** 

: PCA0087084 : 06013550 : 10752694 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 20 Nov 2023 Diagnosed : 22 Nov 2023 Diagnostician : Sean Felton

Kemp Quarries - Pryor Stone - Pryor

1050 E 520 Rd Pryor, OK US 74361 Contact: pryor@pryorstone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: