


OIL ANALYSIS REPORT

Sample Rating Trend





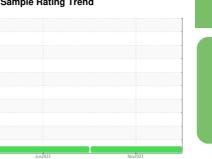

Machine Id 803M Component **Diesel Engine**

PETRO CANADA DURON SHP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

N SHP 15W40 (-	GAL)		Jun 2023	Nov2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0089096	GFL0069839	
Sample Date		Client Info		21 Nov 2023	07 Jun 2023	
Machine Age	hrs	Client Info		15350	14829	
Oil Age	hrs	Client Info		2600	600	
Oil Changed		Client Info		Changed	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
-uel		WC Method	>3.0	<1.0	<1.0	
Water		WC Method	>0.2	NEG	NEG	
Glycol		WC Method		NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>90	28	28	
Chromium	ppm	ASTM D5185m	>20	<1	<1	
Nickel	ppm	ASTM D5185m	>2	0	0	
Γitanium	ppm	ASTM D5185m	>2	<1	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>20	10	3	
_ead	ppm	ASTM D5185m	>40	0	0	
Copper	ppm	ASTM D5185m	>330	1	<1	
Γin	ppm	ASTM D5185m	>15	0	<1	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	<1	3	
Barium	ppm	ASTM D5185m	0	0	0	
Molybdenum	ppm	ASTM D5185m	60	61	52	
Manganese	ppm	ASTM D5185m	0	<1	<1	
Magnesium	ppm	ASTM D5185m	1010	952	854	
Calcium	ppm	ASTM D5185m	1070	1039	928	
Phosphorus	ppm	ASTM D5185m	1150	910	956	
Zinc	ppm	ASTM D5185m	1270	1307	1137	
Sulfur	ppm	ASTM D5185m	2060	2907	2523	
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6	4	
Sodium	ppm	ASTM D5185m		76	4	
Potassium	ppm	ASTM D5185m	>20	1	<1	
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>6	2	1.2	
Vitration	Abs/cm	*ASTM D7624	>20	10.7	11.9	
		********	. 20	00.0	00.0	
Sulfation	Abs/.1mm	*ASTM D7415	>30	23.3	22.8	
Sulfation FLUID DEGRA			limit/base	current	history1	
						history2




OIL ANALYSIS REPORT

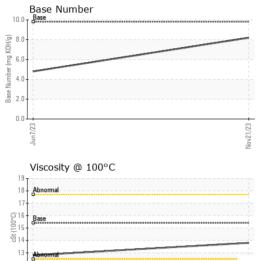


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	
- FILUR DD 000						


	ERITES	method			history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	13.8	12.8	

GRAPHS

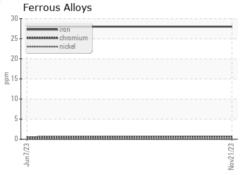

			_	CO	ppe	er i	i																
8	84			lea tin	d																		
6 -	1	 				_																	
4																							
2 -	÷																			-			
0	3 10	 			***			 	-	 	-	-	***	***	***		1111	996		 	-	 	
	Jun7/23																						

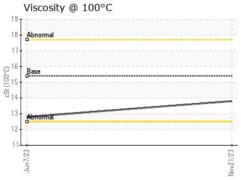

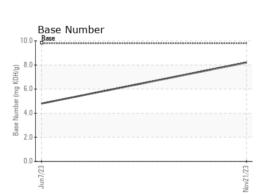



Certificate L2367

Laboratory Sample No. Lab Number

: 06016117 Unique Number : 10755261 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : GFL0089096 Received : 24 Nov 2023 Diagnosed : 27 Nov 2023

Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 415 - Michigan East

6200 Elmridge Sterling Heights, MI US 48313 Contact: Frank Wolak fwolak@gflenv.com T: (586)825-9514