


OIL ANALYSIS REPORT

(31619ME) Feldman Lumber-Tractor [Feldman Lumber-Tractor] 196D115

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

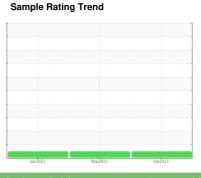



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

,		Jar	2023	May2023 Sep20	23	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0098290	PCA0098278	PCA0089325
Sample Date		Client Info		05 Sep 2023	18 May 2023	26 Jan 2023
Machine Age	mls	Client Info		204836	201683	198025
Oil Age	mls	Client Info		3153	3658	7097
Oil Changed		Client Info		Changed	Changed	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	NC	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METALS	3	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	8	5	9
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>4	0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>20	<1	<1	1
Lead	ppm	ASTM D5185m	>40	<1	0	4
Copper	ppm	ASTM D5185m	>330	1	<1	9
Tin	ppm	ASTM D5185m	>15	0	<1	<1
Vanadium	ppm	ASTM D5185m		<1	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	8	8	15
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	50	63	62	79
Manganese	ppm	ASTM D5185m	0	0	<1	1
Magnesium	ppm	ASTM D5185m	950	940	826	861
Calcium	ppm	ASTM D5185m	1050	914	1115	1199
Phosphorus	ppm	ASTM D5185m	995	866	890	938
Zinc	ppm	ASTM D5185m	1180	1100	1118	1192
Sulfur	ppm	ASTM D5185m	2600	2853	3253	3060
CONTAMINANT	ſS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6	3	5
Sodium	ppm	ASTM D5185m		2	2	4
Potassium	ppm	ASTM D5185m	>20	0	1	6
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.6	0.3	0.3
Nitration	Abs/cm	*ASTM D7624	>20	8.0	7.1	9.1
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.5	17.8	20.4
FLUID DEGRAD	ATI <u>ON</u>	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.4	12.9	17.1
Base Number (BN)	mg KOH/g	ASTM D7414 ASTM D2896	<i>/L</i> J	8.3	7.8	7.5
Dase Mullibel (DIN)	my NON/y	MO I WI DZ030		0.3	7.0	7.5




OIL ANALYSIS REPORT

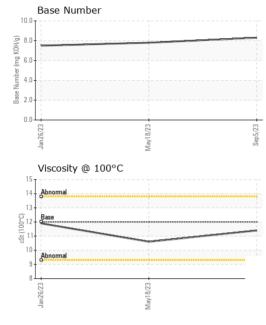



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID FROF	EULIES	memod			HISTORY	HISTORYZ
Visc @ 100°C	cSt	ASTM D445	12.00	11.4	10.6	11.9

GRAPHS

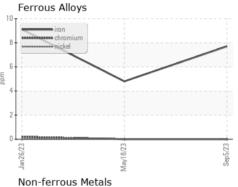

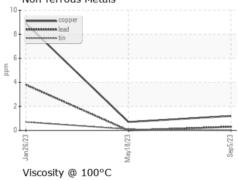

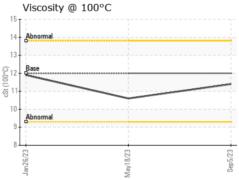

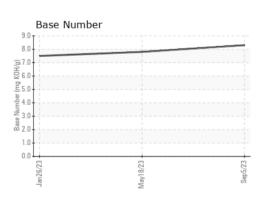





Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10778328 Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0098290 : 06028537

Received Diagnosed

: 07 Dec 2023 : 09 Dec 2023 Diagnostician : Wes Davis

Transervice - Shop 1960 - Feldman Lumber Service

1281 Metropolitan Avenue Brooklyn, NY US 11237

Contact: Marc Fried mfried@transervice.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: