

OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

Chevrolet 002663

Component

Transmission (Auto)

PETRO CANADA TEF 295 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.


Fluid Condition


The condition of the fluid is acceptable for the time in service.

				Dec2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0071442		
Sample Date		Client Info		07 Dec 2023		
Machine Age	mls	Client Info		83755		
Oil Age	mls	Client Info		83755		
Oil Changed		Client Info		Oil Added		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>160	142		
Chromium	ppm	ASTM D5185m	>5	<1		
Nickel	ppm	ASTM D5185m	>5	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>5	0		
Aluminum	ppm		>50	44		
Lead	ppm	ASTM D5185m	>50	3		
Copper	ppm		>225	73		
Tin	ppm	ASTM D5185m	>10	3		
Vanadium	ppm	ASTM D5185m	710	<1		
Cadmium	ppm	ASTM D5185m		0		
	PPIII					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	100	60		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		<1		
Manganese	ppm	ASTM D5185m		13		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m	30	45		
Phosphorus	ppm	ASTM D5185m	220	126		
Zinc	ppm	ASTM D5185m	4	0		
Sulfur	ppm	ASTM D5185m	1060	1555		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	11		
Sodium	ppm	ASTM D5185m		8		
Potassium	ppm	ASTM D5185m	>20	10		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate		*\ /! 1	NONE			
Precipitate	scalar	*Visual	INOINL	NONE		
Silt	scalar	*Visual	NONE	NONE		
<u> </u>						
Silt	scalar	*Visual	NONE	NONE		
Silt Debris	scalar scalar	*Visual *Visual	NONE NONE	NONE NONE NONE NORML		
Silt Debris Sand/Dirt	scalar scalar scalar	*Visual *Visual *Visual	NONE NONE	NONE NONE NONE		
Silt Debris Sand/Dirt Appearance	scalar scalar scalar scalar	*Visual *Visual *Visual *Visual	NONE NONE NORML	NONE NONE NONE NORML		





OIL ANALYSIS REPORT

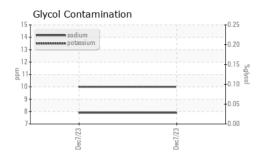


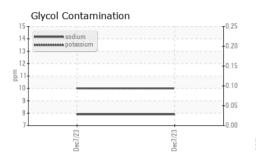



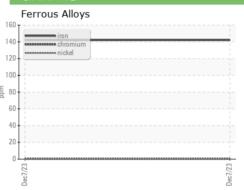

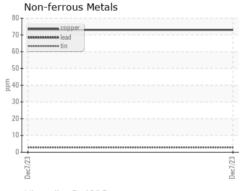

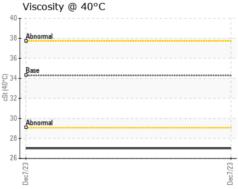



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10796128

: PCA0071442 : 06040899

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved

Diagnosed Diagnostician : Don Baldridge

: 20 Dec 2023 : 22 Dec 2023

Test Package : FLEET (Additional Tests: Glycol) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ICSB370 - Alton 4525 North Alby Road Godfrey, IL

US 62035 Contact: Chad Ingold c.ingold@illinois-central.com

T: (618)466-5400