


OIL ANALYSIS REPORT

Sample Rating Trend





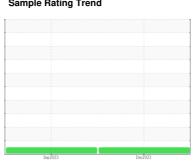

JOHN DEERE 529

Component

Hydraulic System

JOHN DEERE HY-GARD HYD/TRANS (--- G

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The condition of the oil is acceptable for the time in service.

AL)			Sep2023	Dec2023		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0107139	PCA0096387	
Sample Date		Client Info		21 Dec 2023	21 Sep 2023	
Machine Age	hrs	Client Info		4800	3635	
Oil Age	hrs	Client Info		4800	3635	
Oil Changed		Client Info		N/A	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	1	
Chromium	ppm		>10	2	2	
Nickel	ppm	ASTM D5185m	>10	0	<1	
Titanium	ppm	ASTM D5185m	_	0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	<1	
Copper	ppm	ASTM D5185m	>75	<1	2	
Tin	ppm	ASTM D5185m	>10	0	<1	
Vanadium	ppm	ASTM D5185m	>10	0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	6	0	0	
Barium	ppm	ASTM D5185m	0	0	2	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		<1	0	
Magnesium	ppm	ASTM D5185m	145	<1	2	
Calcium	ppm	ASTM D5185m	3570	89	100	
Phosphorus	ppm	ASTM D5185m	1290	650	642	
Zinc	ppm	ASTM D5185m	1640	793	864	
Sulfur	ppm	ASTM D5185m		1597	1882	
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	<1	1	
Sodium	ppm	ASTM D5185m		2	<1	
Potassium	ppm	ASTM D5185m	>20	<1	3	
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	
Precipitate	scalar	*Visual	NONE	NONE	NONE	
Silt	scalar	*Visual	NONE	NONE	NONE	
Debris	scalar	*Visual	NONE	NONE	NONE	
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	
Appearance	scalar	*Visual	NORML	NORML	NORML	
Odor	scalar	*Visual	NORML	NORML	NORML	
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	
Free Water	scalar	*Visual		NEG	NEG	



OIL ANALYSIS REPORT

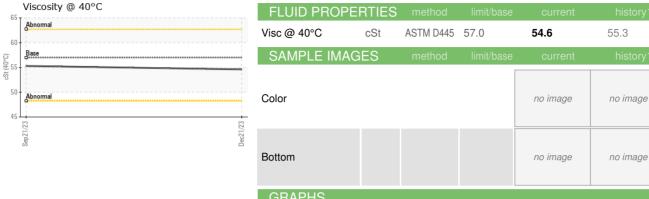

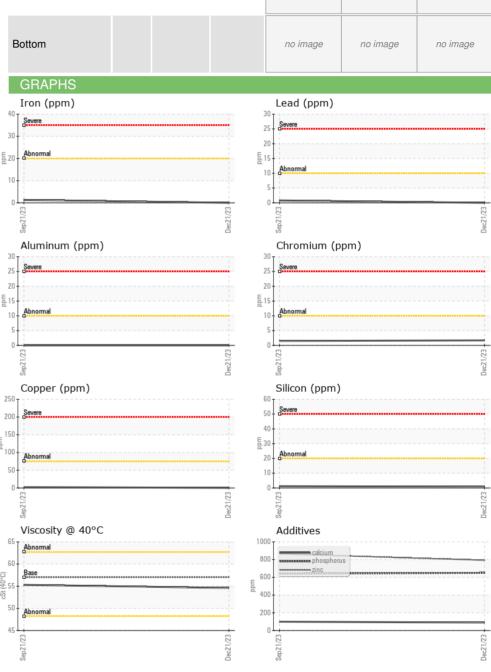





Laboratory Sample No. Lab Number **Unique Number**

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0107139 : 06045748 : 10806356

Recieved : 26 Dec 2023 : 28 Dec 2023 Diagnosed Diagnostician : Angela Borella

Test Package : MOB 1

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) **CENTRAL VALLEY AG**

no image

5707 LANGWORTH OAKDALE, CA US 95361

Contact: S MCHENRY smchenry@cv-ag.com T: (209)630-8094