

OIL ANALYSIS REPORT


Sample Rating Trend

STUFF ROOM A [98677726]

KR-GR-003118 - CONDIMENT DUMPER (S/N STUFF A - 11513097)

Component **Hydraulic System**

AW HYDRAULIC OIL ISO 68 (10 GAL)

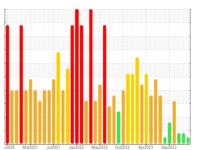



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: 98677726)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0112148	PCA0111180	PCA0108227
Sample Date		Client Info		26 Dec 2023	29 Nov 2023	26 Oct 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	N/A	N/A
Sample Status				NORMAL	ATTENTION	ATTENTION
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water	ION	WC Method	>0.05	NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
						·
Iron	ppm	ASTM D5185m	>20	0	0	<1
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		<1	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	0	<1
Lead	ppm	ASTM D5185m	>20	0	0	0
Copper	ppm	ASTM D5185m	>20	<1	0	<1
Tin	ppm	ASTM D5185m	>20	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	0
Barium	ppm	ASTM D5185m	5	0	0	20
Molybdenum	ppm	ASTM D5185m	5	0	0	<1
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	25	0	0	0
Calcium	ppm	ASTM D5185m	200	0	<1	<1
Phosphorus	ppm	ASTM D5185m	300	455	447	465
Zinc	ppm	ASTM D5185m	370	0	0	22
Sulfur	ppm	ASTM D5185m	2500	485	478	524
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2	2	2
Sodium	ppm	ASTM D5185m		2	0	4
Potassium	ppm	ASTM D5185m	>20	2	0	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
1:50:00\ Dov: 1				0	od Dv: Wilhorto	



OIL ANALYSIS REPORT

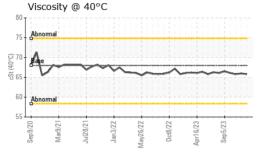



GRAPHS Ferrous Alloys Non-ferrous Metals Viscosity @ 40°C 72 62 60 58 56



Laboratory Sample No.

Lab Number Unique Number : 10808706 Test Package : IND 1

: PCA0112148 : 06048098

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved

: 29 Dec 2023 : 02 Jan 2024 Diagnosed Diagnostician : Don Baldridge KraftHeinz - Kirksville - Plant 8333 PCA 2504 INDUSTRIAL DR

KIRKSVILLE, MO US 63501

F: (660)627-5887

Contact: WALLACE WARD

wallace.ward@kraftheinzcompany.com T: (660)627-1031

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: KRAKIR [WUSCAR] 06048098 (Generated: 01/02/2024 14:58:23) Rev: 1