

OIL ANALYSIS REPORT



Machine Id 130189M

Component Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material.


Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


(15)				Nov2023		
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0105803		
Sample Date		Client Info		06 Nov 2023		
	mls	Client Info		8242		
Oil Age	mls	Client Info		8242		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATIO	ON	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	58		
	ppm	ASTM D5185m	>20	1		
	ppm	ASTM D5185m	>4	0		
	ppm	ASTM D5185m		0		
	ppm	ASTM D5185m	>3	0		
	ppm		>20	7		
	ppm	ASTM D5185m	>40	0		
-	ppm		>330	248		
	ppm	ASTM D5185m	>15	0		
	ppm	ASTM D5185m	210	0		
	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	135		
	ppm	ASTM D5185m	0	10		
	ppm	ASTM D5185m	50	11		
	ppm	ASTM D5185m	0	0		
	ppm	ASTM D5185m	950	98		
5	ppm	ASTM D5185m	1050	1146		
	ppm	ASTM D5185m	995	844		
	ppm	ASTM D5185m	1180	1090		
	ppm	ASTM D5185m	2600	2847		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4 7		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	3		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	8.2		
	Abs/.1mm	*ASTM D7415	>30	21.4		
Sulfation	AU3/.111111	1011101110				
Sulfation FLUID DEGRAD		method	limit/base	current	history1	history2
FLUID DEGRAD				current 19.0	history1	history2




OIL ANALYSIS REPORT

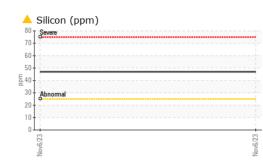

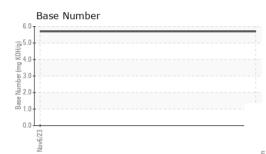

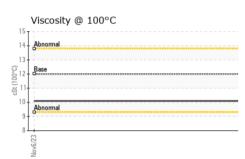

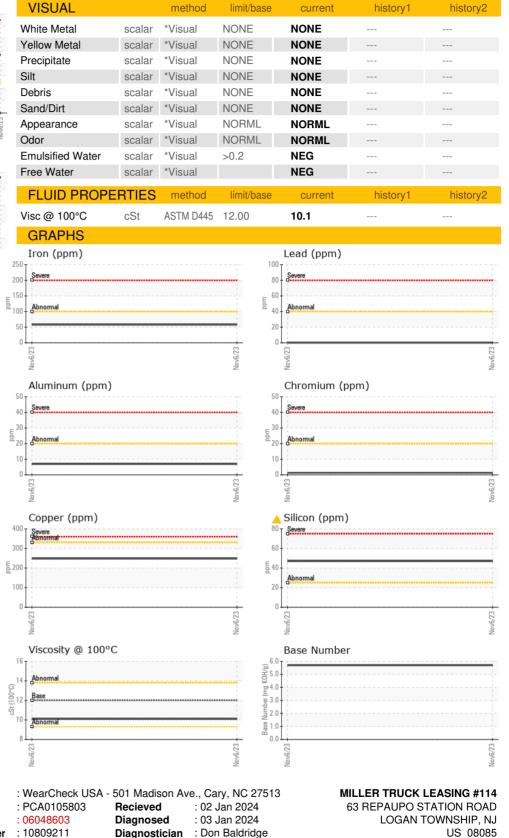

Laboratory

Sample No.

Lab Number

Contact/Location: ED DAVIS - MILLOG

Contact: ED DAVIS

T: (856)214-3521

F: (856)214-3663

edavis@millertransgroup.com