

### **OIL ANALYSIS REPORT**

#### Sample Rating Trend


# NORMAL



## KEMP QUARRIES / RIVER VALLEY BACKBONE WL135

Component
Rear Right Final Drive

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

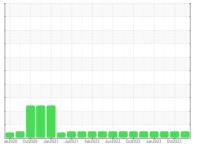

#### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil


#### **Fluid Condition**

The condition of the oil is acceptable for the time in service.


SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0069885	PCA0084858	PCA0084835
Sample Date		Client Info		28 Dec 2023	25 Oct 2023	12 Aug 2023
Machine Age	hrs	Client Info		52934	52934	52602
Oil Age	hrs	Client Info		900	900	900
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
·						
CONTAMINAT	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METAL	_S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	85	40	102
Chromium	ppm	ASTM D5185m	>10	<1	0	0
Nickel	ppm	ASTM D5185m	>5	<1	0	0
Titanium	ppm	ASTM D5185m	>15	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>75	2	1	2
Lead	ppm	ASTM D5185m	>10	<1	0	0
Copper	ppm	ASTM D5185m		2	<1	2
Tin	ppm	ASTM D5185m	>8	- <1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES	ррпп	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		4	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm		0	2	<1	1
Manganese	ppm	ASTM D5185m	0	1	<1	<1
Magnesium	ppm	ASTM D5185m	9	21	22	32
Calcium	ppm	ASTM D5185m	3114	3221	2984	2945
Phosphorus	ppm	ASTM D5185m	1099	962	863	947
Zinc	ppm	ASTM D5185m	1245	1170	1151	1187
Sulfur	ppm	ASTM D5185m	7086	7070	5353	7440
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	25	17	28
Sodium	ppm	ASTM D5185m		0	2	<1
Potassium	ppm	ASTM D5185m	>20	2	0	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG



#### **OIL ANALYSIS REPORT**

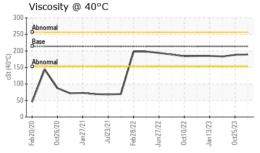



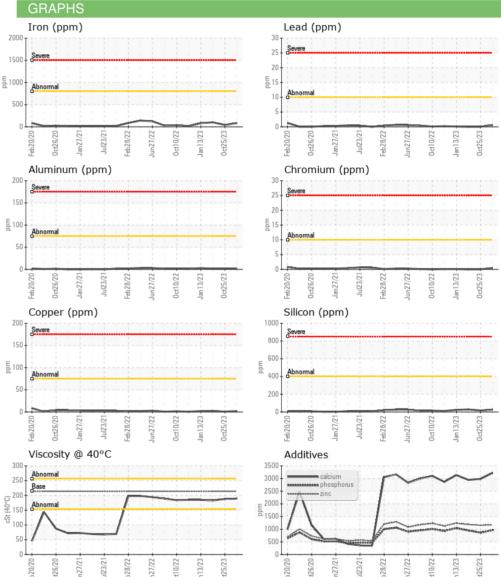





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : MOB 1

: PCA0069885 : 06054422 : 10820371

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 08 Jan 2024 : 09 Jan 2024 Diagnosed

Diagnostician : Wes Davis

Kemp Quarries - River Valley - Backbone

5600 S Hwy 253 Huntington, AR US 72940

Contact:

backbone@rivervalleyquarries.com

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: KEMHUN [WUSCAR] 06054422 (Generated: 01/09/2024 15:42:08) Rev: 1