


# **OIL ANALYSIS REPORT**

# **COOKHOUSE** [98676528] KR-GR-000236 (S/N COOKHOUSE 2 - 11525948)

Component

Gearbox

GEAR OIL ISO 460 (--- GAL)

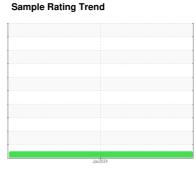



### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. ( Customer Sample Comment: 98676528)

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


The condition of the oil is acceptable for the time in service.

				Jan2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0088766		
Sample Date		Client Info		11 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATI	ON	method	limit/base	current	history1	history2
Water			>0.2	NEG		
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	3		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m	0	0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium		ASTM D5185m	725	0		
Cadmium	ppm	ASTM D5185m		0		
	ррпп	AOTIVI DOTOSIII		<u> </u>		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	4		
Barium	ppm	ASTM D5185m	15	0		
Molybdenum	ppm	ASTM D5185m	15	6		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	50	<1		
Calcium	ppm	ASTM D5185m	50	14		
Phosphorus	ppm	ASTM D5185m	350	332		
Zinc	ppm	ASTM D5185m	100	0		
Sulfur	ppm	ASTM D5185m	12500	977		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	4		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		





# **OIL ANALYSIS REPORT**

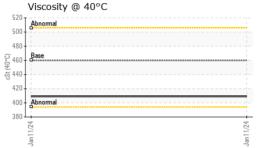


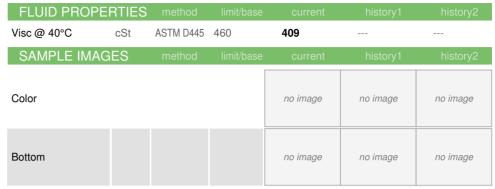

### **GRAPHS**

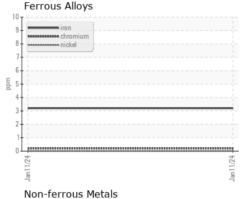

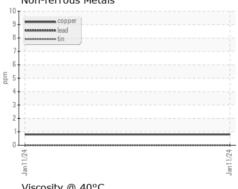

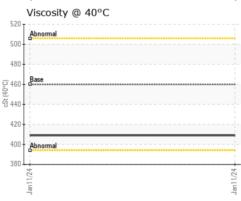



Certificate L2367

Laboratory Sample No. Lab Number

**Unique Number** Test Package : IND 1

: PCA0088766 : 06066039 : 10842716

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved

: 19 Jan 2024 Diagnosed : 23 Jan 2024 Diagnostician : Don Baldridge

KIRKSVILLE, MO US 63501

Contact: Wilberto Pacheco Garcia Wilberto.PachecoGarcia@kraftheinz.com

KraftHeinz - Kirksville - Plant 8333 PCA

2504 INDUSTRIAL DR

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (660)627-5887

T: