


OIL ANALYSIS REPORT

Sample Rating Trend

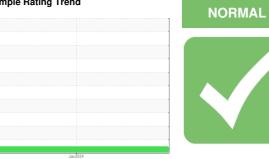

Machine Id **927082-260335**

Component

Transmission (Auto)

PETRO CANADA DuraDrive HD Synthetic 6

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.


Fluid Condition

The condition of the fluid is acceptable for the time in service.

668 (GAL)						
		,		Jan 2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0108152		
Sample Date		Client Info		18 Jan 2024		
Machine Age	hrs	Client Info		13405		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>160	10		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>5	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>5	0		
Aluminum	ppm	ASTM D5185m	>50	2		
_ead	ppm	ASTM D5185m	>50	<1		
Copper	ppm	ASTM D5185m	>225	2		
Γin	ppm	ASTM D5185m	>10	<1		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		76		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		1		
Calcium	ppm	ASTM D5185m		109		
Phosphorus	ppm	ASTM D5185m		183		
Zinc	ppm	ASTM D5185m		2		
Sulfur	ppm	ASTM D5185m		1531		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	4		
Sodium	ppm	ASTM D5185m		13		
Potassium	ppm	ASTM D5185m	>20	8		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
E0:E7\ Dov: 1				Contact/Looction	DDVAN CMAN	ICON CELOS





OIL ANALYSIS REPORT

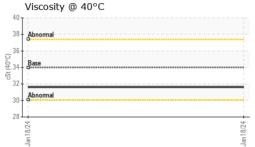




GRAPHS

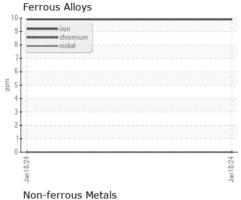

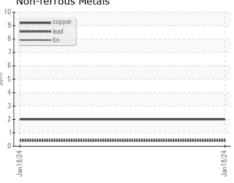

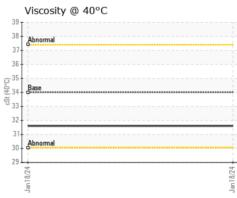



Certificate L2367

Laboratory Sample No. Lab Number Unique Number : 10846842 Test Package : FLEET

: GFL0108152 : 06070165

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 24 Jan 2024 Diagnosed : 25 Jan 2024

Diagnostician : Wes Davis

GFL Environmental - 837 - Harrison TS

22820 S State Route 291 Harrisonville, MO US 64701

Contact: BRYAN SWANSON bryanswanson@gflenv.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: