



PROBLEM SUMMARY

Sample Rating Trend




WEAR



Machine Id
525146 FREIGHTLINER CASCADIA 125
Component
Gearbox
Fluid
GEAR OIL SAE 80W90 (--- GAL)



COMPONENT CONDITION SUMMARY

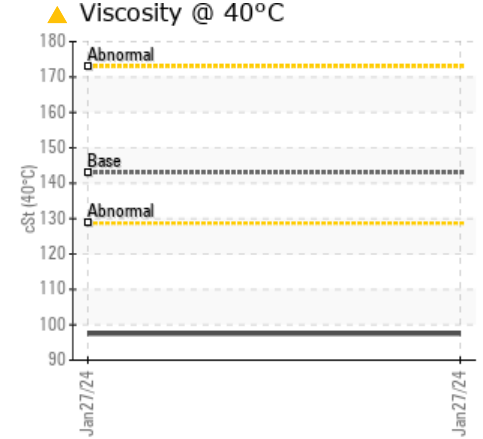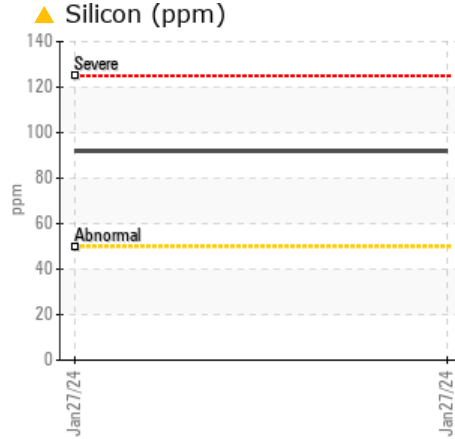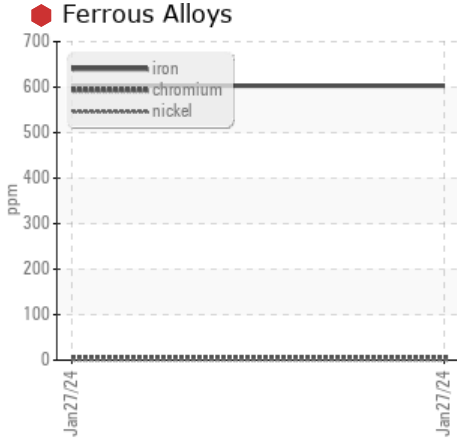

RECOMMENDATION

We advise that you check all areas where dirt can enter the system. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	---	---
Iron	ppm	ASTM D5185m	>200	● 603	---	---
Silicon	ppm	ASTM D5185m	>50	▲ 92	---	---

Customer Id: GFL980
Sample No.: GFL0105490
Lab Number: 06077871
Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Inspect Wear Source	---	---	?	We advise that you inspect for the source(s) of wear.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Dirt Access	---	---	?	We advise that you check all areas where dirt can enter the system.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

WEAR



Machine Id
525146 FREIGHTLINER CASCADIA 125
Component
Gearbox
Fluid
GEAR OIL SAE 80W90 (--- GAL)



DIAGNOSIS

Recommendation

We advise that you check all areas where dirt can enter the system. We advise that you inspect for the source(s) of wear. We recommend an early resample to monitor this condition.

Wear

Gear wear is indicated.

Contamination

Elemental level of silicon (Si) above normal.

Fluid Condition

The oil viscosity is lower than normal. Confirm oil type.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0105490	---	---
Sample Date	Client Info		27 Jan 2024	---	---
Machine Age	hrs	Client Info	15266	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >200	603	---	---
Chromium	ppm	ASTM D5185m >10	4	---	---
Nickel	ppm	ASTM D5185m >10	<1	---	---
Titanium	ppm	ASTM D5185m	<1	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >25	7	---	---
Lead	ppm	ASTM D5185m >50	0	---	---
Copper	ppm	ASTM D5185m >200	2	---	---
Tin	ppm	ASTM D5185m >10	0	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 400	189	---	---
Barium	ppm	ASTM D5185m 200	11	---	---
Molybdenum	ppm	ASTM D5185m 12	<1	---	---
Manganese	ppm	ASTM D5185m	8	---	---
Magnesium	ppm	ASTM D5185m 12	5	---	---
Calcium	ppm	ASTM D5185m 150	56	---	---
Phosphorus	ppm	ASTM D5185m 1650	1270	---	---
Zinc	ppm	ASTM D5185m 125	45	---	---
Sulfur	ppm	ASTM D5185m 22500	24404	---	---

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >50	92	---	---
Sodium	ppm	ASTM D5185m >170	8	---	---
Potassium	ppm	ASTM D5185m >20	7	---	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	---	---
Yellow Metal	scalar	*Visual NONE	NONE	---	---
Precipitate	scalar	*Visual NONE	NONE	---	---
Silt	scalar	*Visual NONE	NONE	---	---
Debris	scalar	*Visual NONE	NONE	---	---
Sand/Dirt	scalar	*Visual NONE	NONE	---	---
Appearance	scalar	*Visual NORML	NORML	---	---
Odor	scalar	*Visual NORML	NORML	---	---
Emulsified Water	scalar	*Visual >0.2	NEG	---	---
Free Water	scalar	*Visual	NEG	---	---






OIL ANALYSIS REPORT

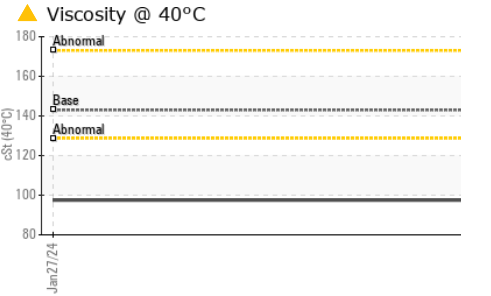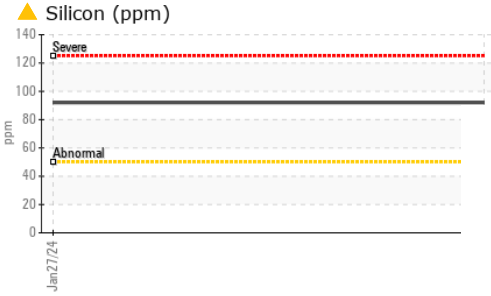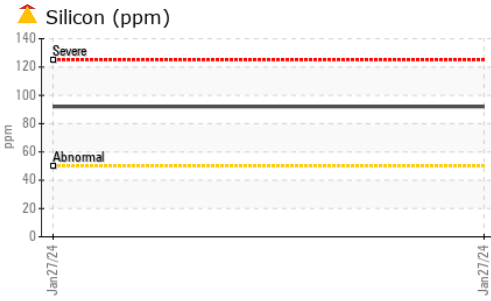

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	143	▲ 97.5	---	---

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color				no image	no image	no image
Bottom				no image	no image	no image

GRAPHS

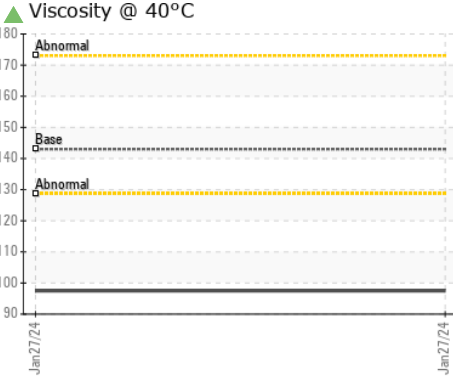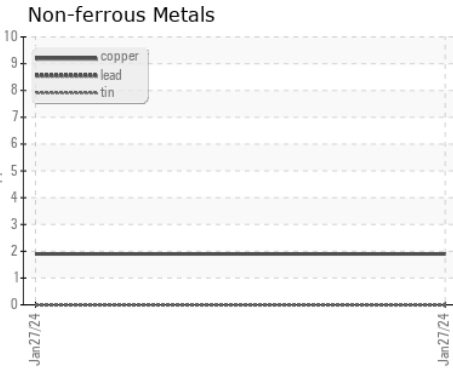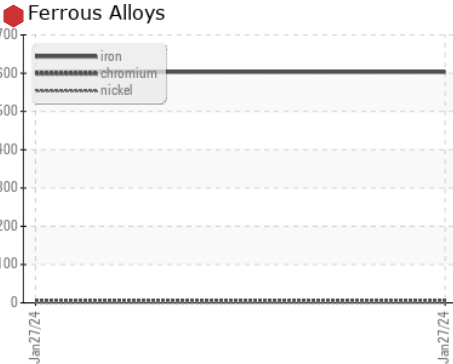

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0105490 **Received** : 01 Feb 2024
Lab Number : 06077871 **Diagnosed** : 04 Feb 2024
Unique Number : 10859962 **Diagnostician** : Don Baldrige
Test Package : FLEET

GFL Environmental - 980 - Northside Hauling
 1820 Candle Ridge Park Dr
 Houston, TX
 US 77073
 Contact: Edwin Collins
 ecolins@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: