


# **OIL ANALYSIS REPORT**



# KEMP QUARRIES / RIVER VALLEY BACKBONE **WL088**

Component **Front Differential** 

**MOBIL MOBILTRANS HD 50 (--- GAL)** 

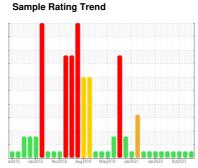



### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.


5 HD 50 ( GAL)  #2015 Jan2016 Nov2016 Aug2018 May2018 Jan2022 0-2023						
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0069722	PCA0084824	PCA0084901
Sample Date		Client Info		30 Jan 2024	10 Nov 2023	02 Oct 2023
Machine Age	hrs	Client Info		43499	6716	36443
Oil Age	hrs	Client Info		1200	900	600
Oil Changed		Client Info		Changed	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	41	35	31
Chromium	ppm	ASTM D5185m	>3	<1	<1	0
Nickel	ppm	ASTM D5185m	>3	0	<1	<1
Titanium	ppm	ASTM D5185m	>2	0	<1	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>30	2	2	0
Lead	ppm	ASTM D5185m	>13	0	<1	<1
Copper	ppm	ASTM D5185m	>103	4	4	3
Tin	ppm	ASTM D5185m	>5	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1	<1	1
Barium	ppm	ASTM D5185m		5	0	1
Molybdenum	ppm	ASTM D5185m		0	<1	<1
Manganese	ppm	ASTM D5185m		0	<1	<1
Magnesium	ppm	ASTM D5185m		12	13	11
Calcium	ppm	ASTM D5185m		2868	2888	2787
Phosphorus	ppm	ASTM D5185m		976	1072	1014
Zinc	ppm	ASTM D5185m		1196	1292	1234
Sulfur	ppm	ASTM D5185m		5392	5226	5046
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>100	38	32	31
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	2	2	2
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG





## **OIL ANALYSIS REPORT**

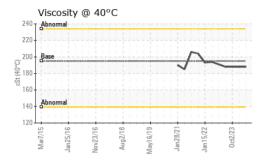





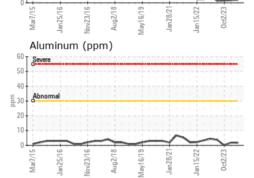


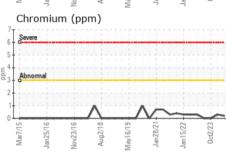

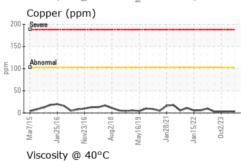

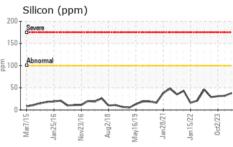

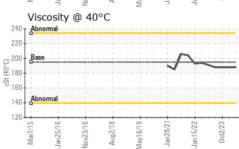

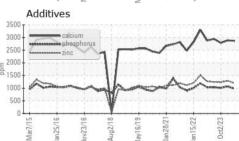



Certificate L2367

Laboratory Sample No.

mdd

200

Lab Number : 06082058

: PCA0069722

Unique Number : 10869503 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 06 Feb 2024

: 07 Feb 2024 **Tested** : 07 Feb 2024 - Wes Davis Diagnosed

Kemp Quarries - River Valley - Backbone

5600 S Hwy 253 Huntington, AR US 72940 Contact:

backbone@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: