




PROBLEM SUMMARY

Sample Rating Trend

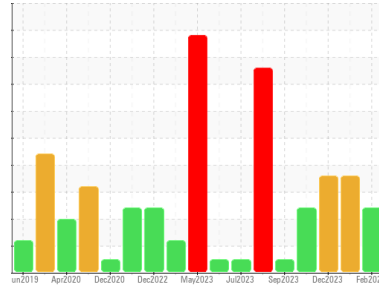


FUEL




Machine Id
822040-101255
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

COMPONENT CONDITION SUMMARY

Fuel Dilution

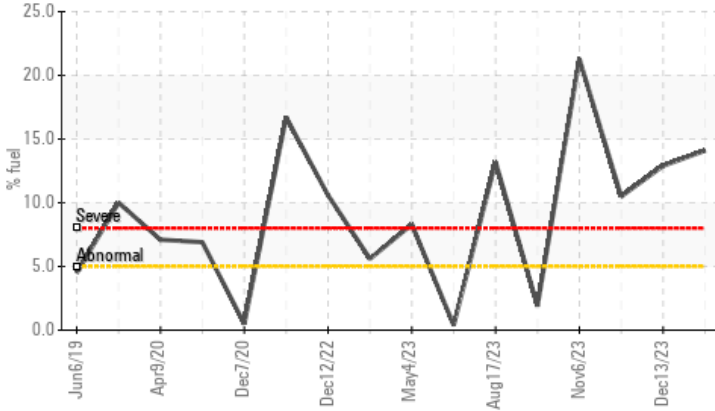

Viscosity @ 100°C

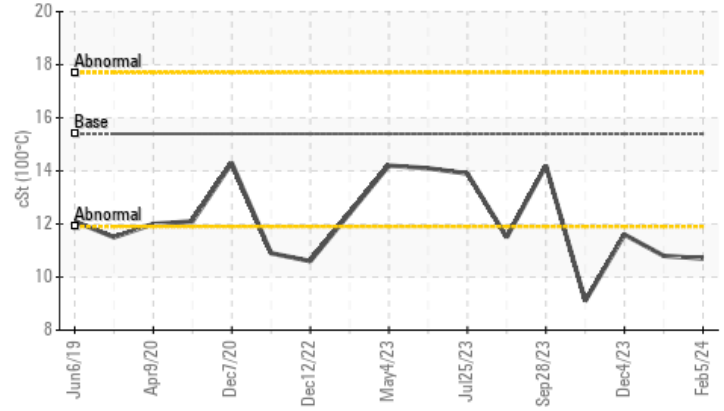

RECOMMENDATION

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	SEVERE	SEVERE
Fuel	%	ASTM D3524	>5	14.1	12.9	10.5
Visc @ 100°C	cSt	ASTM D445	15.4	10.7	10.8	11.6

Customer Id: GFL837
 Sample No.: GFL0108094
 Lab Number: 06088019
 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	We recommend that you drain the oil from the component if this has not already been done.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Fuel/injector System	---	---	?	We advise that you check the fuel injection system.

HISTORICAL DIAGNOSIS

13 Dec 2023 Diag: Jonathan Hester

FUEL



We advise that you check for the source of the coolant leak. Check for low coolant level. We advise that you check the fuel injection system. We recommend that you drain the oil and perform a filter service on this component if not already done. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels are high. There is a high amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

view report



04 Dec 2023 Diag: Jonathan Hester

FUEL



We advise that you check for the source of the coolant leak. Check for low coolant level. We advise that you check the fuel injection system. We recommend that you drain the oil and perform a filter service on this component if not already done. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels are high. There is a high amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

view report



06 Nov 2023 Diag: Jonathan Hester

FUEL



We advise that you check the fuel injection system. We recommend that you drain the oil and perform a filter service on this component if not already done. We recommend an early resample to monitor this condition. All component wear rates are normal. There is a high amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

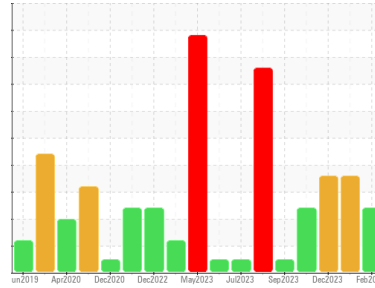

FUEL



Machine Id
822040-101255
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	GFL0108094	GFL0102419	GFL0102519
Sample Date	Client Info	05 Feb 2024	13 Dec 2023	04 Dec 2023
Machine Age	hrs	17712	17559	17520
Oil Age	hrs	16670	0	0
Oil Changed	Client Info	Not Chngd	N/A	N/A
Sample Status		SEVERE	SEVERE	SEVERE

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.2	NEG	NEG	NEG
Glycol	WC Method	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >80	16	9	10
Chromium	ppm ASTM D5185m >5	<1	<1	<1
Nickel	ppm ASTM D5185m >2	<1	0	0
Titanium	ppm ASTM D5185m	0	0	0
Silver	ppm ASTM D5185m >3	0	0	0
Aluminum	ppm ASTM D5185m >30	2	<1	1
Lead	ppm ASTM D5185m >30	<1	<1	<1
Copper	ppm ASTM D5185m >150	2	14	15
Tin	ppm ASTM D5185m >5	<1	0	0
Vanadium	ppm ASTM D5185m	0	<1	0
Cadmium	ppm ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m 0	4	8	10
Barium	ppm ASTM D5185m 0	0	0	0
Molybdenum	ppm ASTM D5185m 60	50	57	60
Manganese	ppm ASTM D5185m 0	<1	<1	0
Magnesium	ppm ASTM D5185m 1010	818	804	818
Calcium	ppm ASTM D5185m 1070	863	874	937
Phosphorus	ppm ASTM D5185m 1150	913	905	888
Zinc	ppm ASTM D5185m 1270	1092	1063	1074
Sulfur	ppm ASTM D5185m 2060	2716	2719	3093

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >20	7	9	11
Sodium	ppm ASTM D5185m	60	▲ 245	▲ 271
Potassium	ppm ASTM D5185m >20	1	3	4
Fuel	% ASTM D3524 >5	● 14.1	● 12.9	● 10.5

INFRA-RED




method	limit/base	current	history1	history2
Soot %	% *ASTM D7844 >3	0.2	0.3	0.2
Nitration	Abs/cm *ASTM D7624 >20	7.5	7.6	7.1
Sulfation	Abs/.1mm *ASTM D7415 >30	18.6	19.5	18.9

FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs/.1mm *ASTM D7414 >25	15.3	16.5	15.8
Base Number (BN)	mg KOH/g ASTM D2896 9.8	8.1	8.3	8.9







OIL ANALYSIS REPORT

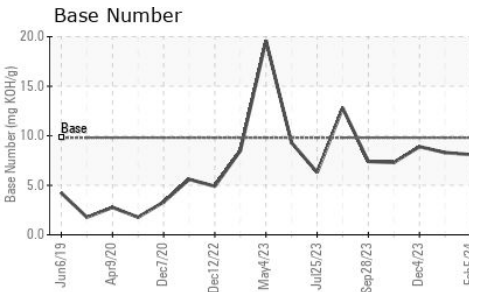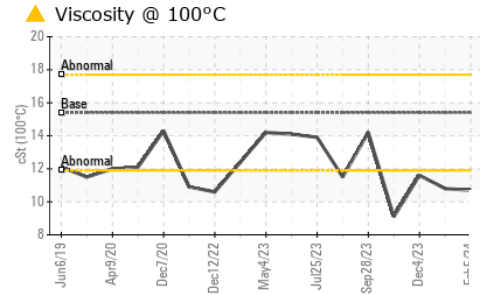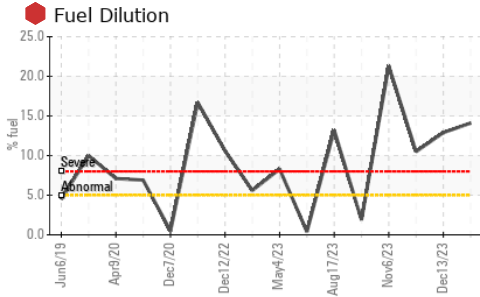

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	▲ 10.7	▲ 10.8

GRAPHS

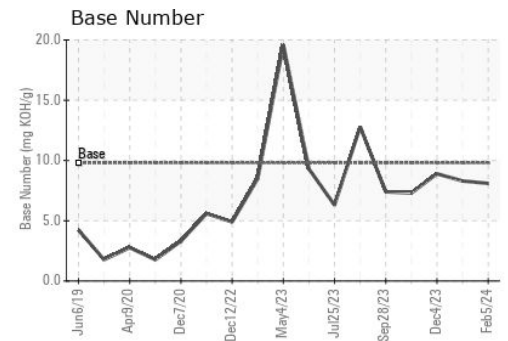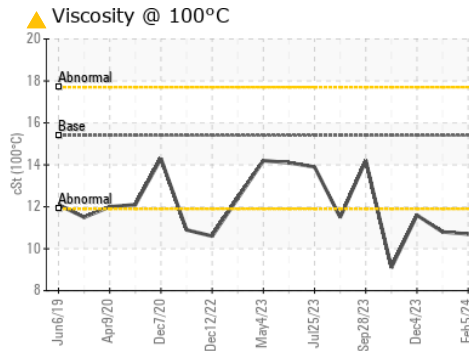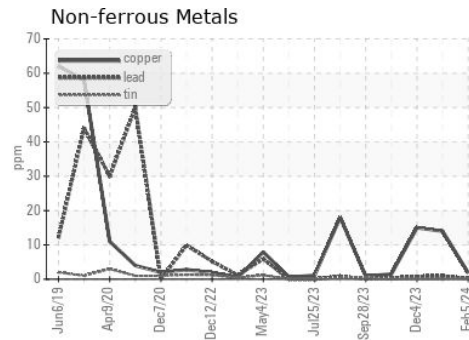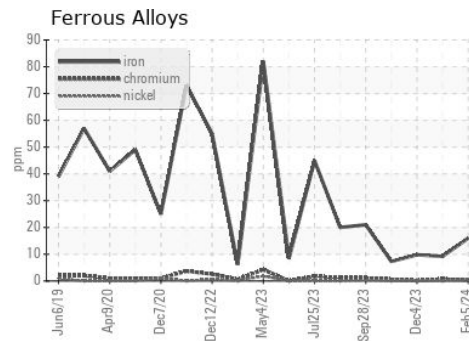

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0108094
Lab Number : 06088019
Unique Number : 10875464
Test Package : FLEET (Additional Tests: PercentFuel)

GFL Environmental - 837 - Harrison TS
 22820 S State Route 291
 Harrisonville, MO
 US 64701
 Contact: JOHNNY PEREZ
 johnny.perez@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: