


OIL ANALYSIS REPORT

(ZKZ1622) 828044-Pete 520

Diesel Engine

PETRO CANADA DURON SHP 15W40 (42 QTS)

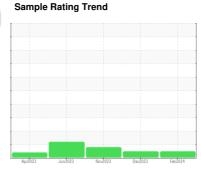



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

•		Apr2023	Jun2023	Nov2023 Dec2023	Feb2024	
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0096512	GFL0096488	GFL0096491
Sample Date		Client Info		20 Feb 2024	05 Dec 2023	20 Nov 2023
Machine Age	hrs	Client Info		11846	11323	11256
Oil Age	hrs	Client Info		585	555	488
Oil Changed		Client Info		Changed	Not Changd	Changed
Sample Status				NORMAL	NORMAL	MARGINAL
CONTAMINATION	NC	method	limit/base	current	history1	history2
Fuel		WC Method	>3.0	<1.0	<1.0	▲ 1.1
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METALS	;	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>165	4	4	9
Chromium	ppm	ASTM D5185m	>5	<1	<1	<1
Nickel	ppm	ASTM D5185m	>4	0	0	<1
Titanium	ppm	ASTM D5185m	>2	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>20	1	2	<1
Lead	ppm	ASTM D5185m	>150	2	0	1
Copper	ppm	ASTM D5185m	>90	3	1	7
Tin	ppm	ASTM D5185m	>5	0	0	<1
Vanadium	ppm	ASTM D5185m		<1	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	10	13	15
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	68	61	55
Manganese	ppm	ASTM D5185m	0	<1	0	0
Magnesium	ppm	ASTM D5185m	1010	1074	931	919
Calcium	ppm	ASTM D5185m	1070	1303	1086	1105
Phosphorus	ppm	ASTM D5185m	1150	1179	978	963
Zinc	ppm	ASTM D5185m	1270	1427	1226	1239
Sulfur	ppm	ASTM D5185m	2060	3210	3158	2536
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	5	4	6
Sodium	ppm	ASTM D5185m		7	5	8
Potassium	ppm	ASTM D5185m	>20	2	1	3
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>7.5	0.3	0.1	0.4
Nitration	Abs/cm	*ASTM D7624	>20	8.4	5.4	8.5
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.0	17.9	19.6
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	16.3	13.6	15.5
	mg KOH/g	ASTM D2896	9.8	7.7	8.8	7.5
Dasc Number (DIN)	my Norly	AOTIVI DZ030	0.0	1.1	0.0	1.0



OIL ANALYSIS REPORT

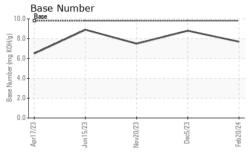


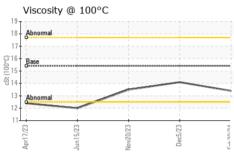



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROPE	:RHES	method				history2
Visc @ 100°C	cSt	ASTM D445	15.4	13.4	14.1	13.5

GRAPHS

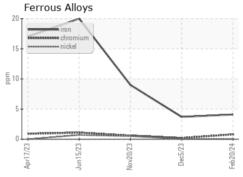

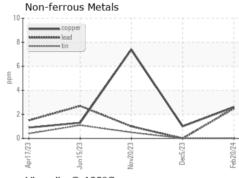

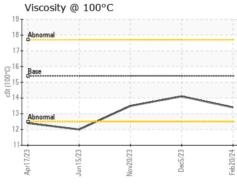

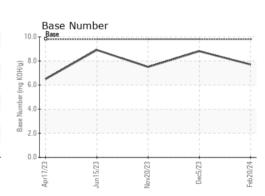





Certificate L2367

Laboratory Sample No.

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06100647 Unique Number: 10898877

: GFL0096512

Received : 26 Feb 2024 **Tested** Diagnosed

: 27 Feb 2024 : 27 Feb 2024 - Wes Davis

GFL Environmental - 656 - Culpeper Hauling

15490 Montanus Drive Culpeper, VA US 22701

Contact: Matt Hanna mhanna@gflenv.com T: (540)727-0887

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)