


OIL ANALYSIS REPORT



KEMP QUARRIES / PRYOR STONE [68210] **OHT066**

Component **Rear Differential**

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

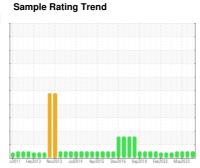



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: Pm4 performed. All oil samples taken. All oils, and all filters changed.)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The condition of the oil is acceptable for the time in service.


RO TO-4 SAE 50 (GAL)						
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0086283	PCA0084304	PCA0084016
Sample Date		Client Info		09 Feb 2024	02 Nov 2023	22 May 2023
Machine Age	hrs	Client Info		64419	63909	63506
Oil Age	hrs	Client Info		1947	1577	1074
Oil Changed		Client Info		Changed	Oil Added	Oil Added
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG	NEG	NEG
WEAR METAI	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	9	7	2
Chromium	ppm	ASTM D5185m	>3	<1	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	<1
Titanium	ppm	ASTM D5185m	>2	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>30	<1	<1	0
Lead	ppm	ASTM D5185m	>13	0	0	0
Copper	ppm	ASTM D5185m	>103	0	0	<1
Tin	ppm	ASTM D5185m	>5	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	0	0	0
Barium	ppm	ASTM D5185m	0	0	0	2
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m	0	<1	0	0
Magnesium	ppm	ASTM D5185m	9	6	9	<1
Calcium	ppm	ASTM D5185m	3114	1321	2650	110
Phosphorus	ppm	ASTM D5185m	1099	511	793	347
Zinc	ppm	ASTM D5185m	1245	693	947	461
Sulfur	ppm	ASTM D5185m	7086	2113	3577	1008
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>100	14	18	<1
Sodium	ppm	ASTM D5185m		0	<1	0
Potassium	ppm	ASTM D5185m	>20	0	0	<1
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.2	NEG	NEG	NEG


scalar *Visual



OIL ANALYSIS REPORT

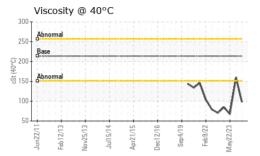

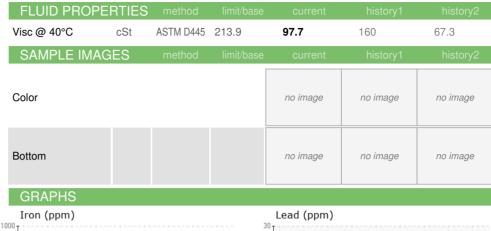

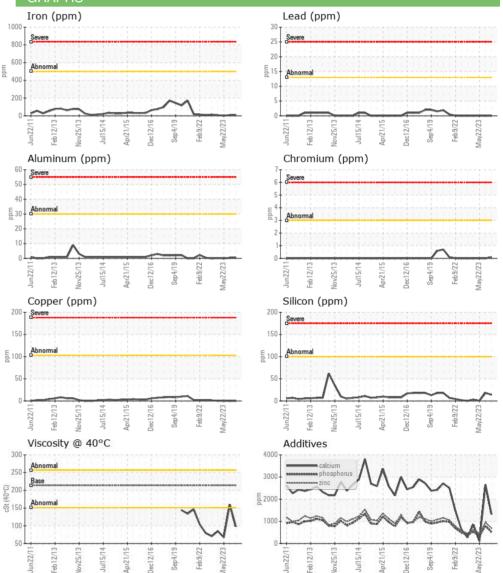



Certificate L2367

Laboratory Sample No.

Lab Number : 06101199 Unique Number: 10899429 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0086283 Received : 26 Feb 2024

: 28 Feb 2024 **Tested** : 28 Feb 2024 - Sean Felton Diagnosed

Kemp Quarries - Pryor Stone - Pryor

1050 E 520 Rd Pryor, OK US 74361

Contact: pryor@pryorstone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: