

OIL ANALYSIS REPORT

Sa

Sample Rating Trend

NORMAL



VOLVO 26553

Component

Hydraulic System

Hydraulic System

AW HYDRAULIC OIL ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Feb 2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0118958		
Sample Date		Client Info		19 Feb 2024		
Machine Age	mls	Client Info		0		
Oil Age	mls	Client Info		0		
Oil Changed	0	Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water			>0.1	NEG		
WEAR METAI	LS	method	limit/base	current	history1	history2
			>20			
Iron	ppm	ASTM D5185m		8		
Chromium Nickel	ppm	ASTM D5185m	>10	0		
	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	10	0		
Aluminum	ppm	ASTM D5185m	>10	1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>75	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	<1		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	<1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	25	13		
Calcium	ppm	ASTM D5185m	200	95		
Phosphorus	ppm	ASTM D5185m	300	392		
Zinc	ppm	ASTM D5185m	370	514		
Sulfur	ppm	ASTM D5185m	2500	1007		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	9		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	LIGHT		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
.00.E1\ Days 1	220.01		0		Camilaa Massass	. DEDCANNIC





OIL ANALYSIS REPORT

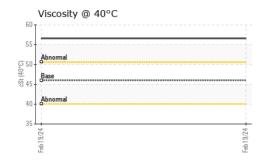




GRAPHS

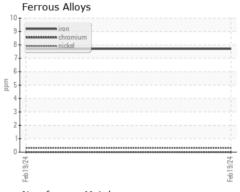

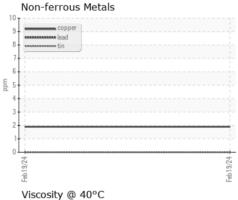

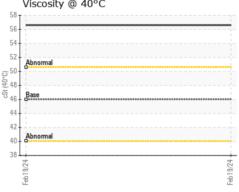





Laboratory Sample No.

Lab Number : 06106833 Unique Number : 10910330

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0118958

Received Tested

: 01 Mar 2024 : 04 Mar 2024

: 05 Mar 2024 - Sean Felton Diagnosed

PERDUE FARMS INC - GARAGE

189 PERDUE WAY CANDOR, NC US 27229

Contact: Service Manager

Test Package : FLEET Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: PERCANNC [WUSCAR] 06106833 (Generated: 03/07/2024 11:20:51) Rev: 1

Contact/Location: Service Manager - PERCANNC

T:

F: