


OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

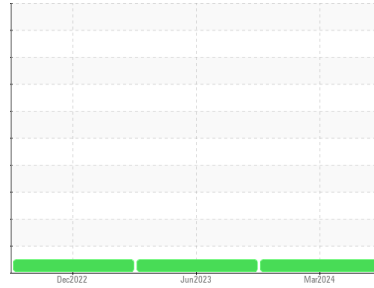

Area
KEMP QUARRIES / BCS - STILLWELL [66212]
 Machine Id
WL090
 Component
Rear Left Final Drive
 Fluid
PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: PM-3 sampled fluid)

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0109260	PCA0086386	PCA0061902
Sample Date	Client Info		26 Mar 2024	30 Jun 2023	28 Dec 2022
Machine Age	hrs	Client Info	23090	22640	22251
Oil Age	hrs	Client Info	23090	22640	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >500	181	184	142
Chromium	ppm	ASTM D5185m >10	1	<1	<1
Nickel	ppm	ASTM D5185m >10	<1	0	0
Titanium	ppm	ASTM D5185m	<1	<1	0
Silver	ppm	ASTM D5185m	0	0	0
Aluminum	ppm	ASTM D5185m >25	2	2	2
Lead	ppm	ASTM D5185m >25	2	<1	2
Copper	ppm	ASTM D5185m >50	13	11	11
Tin	ppm	ASTM D5185m >10	2	<1	<1
Vanadium	ppm	ASTM D5185m	<1	0	0
Cadmium	ppm	ASTM D5185m	<1	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	42	40	37
Barium	ppm	ASTM D5185m 0	0	0	0
Molybdenum	ppm	ASTM D5185m 0	5	3	2
Manganese	ppm	ASTM D5185m 0	2	2	1
Magnesium	ppm	ASTM D5185m 9	62	51	38
Calcium	ppm	ASTM D5185m 3114	2989	2984	2962
Phosphorus	ppm	ASTM D5185m 1099	1045	1031	979
Zinc	ppm	ASTM D5185m 1245	1130	1161	1092
Sulfur	ppm	ASTM D5185m 7086	6448	7211	6410


CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >75	19	18	16
Sodium	ppm	ASTM D5185m	0	<1	<1
Potassium	ppm	ASTM D5185m >20	2	1	0

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	*Visual NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual NONE	NONE	NONE	NONE
Silt	scalar	*Visual NONE	NONE	LIGHT	NONE
Debris	scalar	*Visual NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual NONE	NONE	NONE	NONE
Appearance	scalar	*Visual NORML	NORML	NORML	NORML
Odor	scalar	*Visual NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual >0.2	NEG	NEG	NEG
Free Water	scalar	*Visual	NEG	NEG	NEG

OIL ANALYSIS REPORT








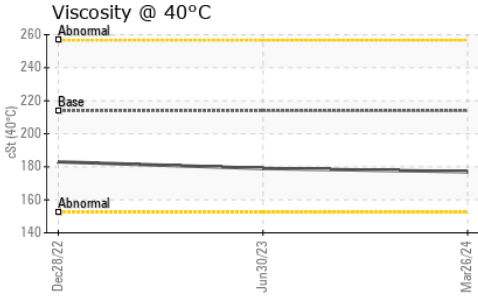


FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	213.9	177	179	183

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image	no image
Bottom				no image	no image	no image

GRAPHS

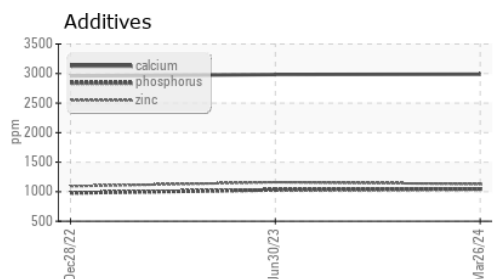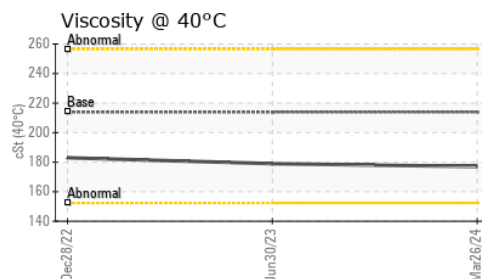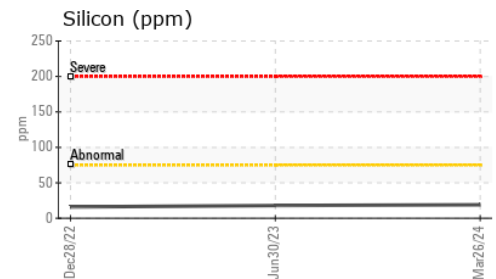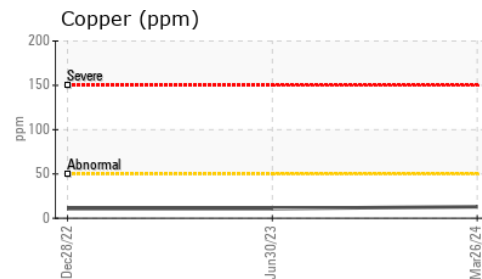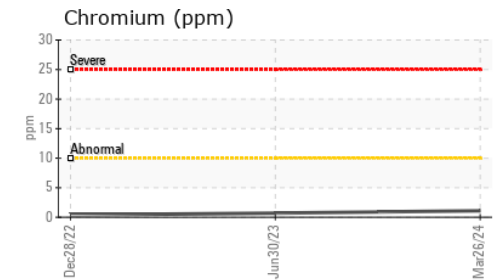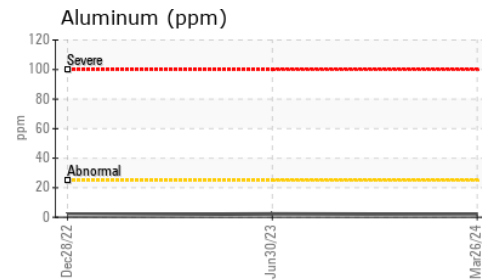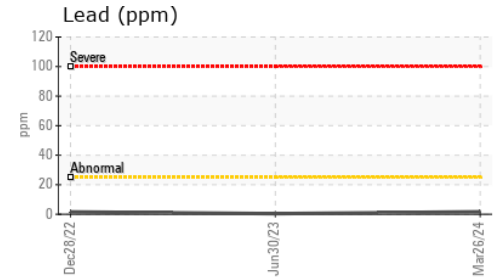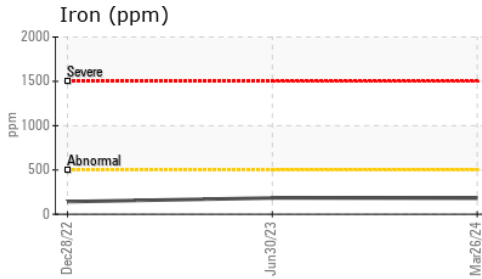

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0109260
Lab Number : **06135320**
Unique Number : 10954785
Test Package : MOB 1

Received : 01 Apr 2024
Tested : 02 Apr 2024
Diagnosed : 04 Apr 2024 - Jonathan Hester

Kemp Quarries - Benton County Stone - Stillwell
 463917 Highway 100
 Bunch, OK
 US 74931

Contact: stillwell@bentoncountystone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:
F: