


OIL ANALYSIS REPORT



Machine Id 420093 - SW4021

Diesel Engine

PETRO CANADA DURON SHP 15W40 (--- GAL)

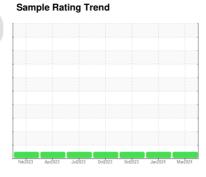



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. (Customer Sample Comment: Engine)

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0112041	GFL0105497	GFL0094142
Sample Date		Client Info		29 Mar 2024	08 Jan 2024	17 Oct 2023
Machine Age	mls	Client Info		140322	130745	122637
Oil Age	mls	Client Info		140322	130745	122637
Oil Changed		Client Info		Changed	Changed	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATION	NC	method	limit/base	current	history1	history2
Fuel	J. 1	WC Method	>3.0	<1.0	<1.0	<1.0
Water		WC Method		NEG	NEG	NEG
Glycol		WC Method	70.L	NEG	NEG	NEG
WEAR METALS	5	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>120	3	3	0
Chromium	ppm	ASTM D5185m	>20	0	0	<1
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m	>2	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	<1
Aluminum	ppm	ASTM D5185m	>20	<1	<1	<1
Lead	ppm	ASTM D5185m	>40	2	1	0
Copper	ppm	ASTM D5185m	>330	<1	<1	0
Tin	ppm	ASTM D5185m	>15	0	0	0
Vanadium	ppm	ASTM D5185m		<1	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	58	51	44
Manganese	ppm	ASTM D5185m	0	0	<1	<1
Magnesium	ppm	ASTM D5185m	1010	8	0	11
Calcium	ppm	ASTM D5185m	1070	2740	2615	2398
Phosphorus	ppm	ASTM D5185m	1150	1156	1138	1061
Zinc	ppm	ASTM D5185m	1270	1427	1303	1247
Sulfur	ppm	ASTM D5185m	2060	3969	3256	3160
CONTAMINANT	rs	method	limit/base			history2
Cilican						
Silicon	ppm	ASTM D5185m	>25	4	7	10
Sodium	ppm ppm	ASTM D5185m ASTM D5185m	>25	4 2	7	10
Sodium	ppm	ASTM D5185m		2	1	0
Sodium Potassium	ppm	ASTM D5185m ASTM D5185m	>20	2 <1	1 2	0 2
Sodium Potassium INFRA-RED Soot %	ppm	ASTM D5185m ASTM D5185m method	>20 limit/base	2 <1 current	1 2 history1	0 2 history2
Sodium Potassium INFRA-RED Soot %	ppm ppm	ASTM D5185m ASTM D5185m method *ASTM D7844	>20 limit/base >4	2 <1 current 0.2	1 2 history1 0.2	0 2 history2 0.1
Sodium Potassium INFRA-RED Soot % Nitration	ppm ppm % Abs/cm Abs/.1mm	ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624	>20 limit/base >4 >20	2 <1 current 0.2 8.3	1 2 history1 0.2 7.8	0 2 history2 0.1 4.9
Sodium Potassium INFRA-RED Soot % Nitration Sulfation FLUID DEGRAD	ppm ppm % Abs/cm Abs/.1mm	ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D7415 method	>20 limit/base >4 >20 >30 limit/base	2 <1 current 0.2 8.3 19.1 current	1 2 history1 0.2 7.8 18.9 history1	0 2 history2 0.1 4.9 14.4 history2
Sodium Potassium INFRA-RED Soot % Nitration Sulfation FLUID DEGRAD Oxidation	ppm ppm % Abs/cm Abs/.1mm	ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D7415	>20 limit/base >4 >20 >30 limit/base >25	2 <1 current 0.2 8.3 19.1	1 2 history1 0.2 7.8 18.9	0 2 history2 0.1 4.9 14.4



OIL ANALYSIS REPORT

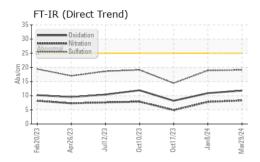

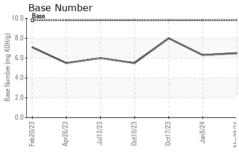


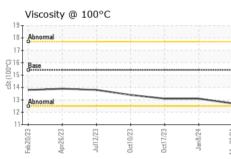



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROP	ERHES	method				history2
Visc @ 100°C	cSt	ASTM D445	15.4	12.7	13.1	13.1

GRAPHS

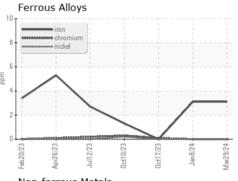

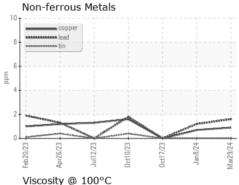

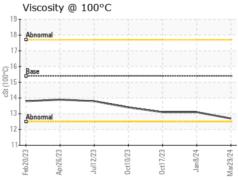

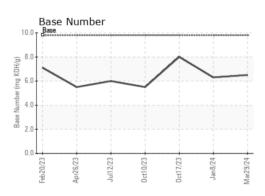





Certificate 12367

Laboratory Sample No.

Lab Number : 06137157 Unique Number : 10956622

: GFL0112041

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 03 Apr 2024 **Tested** : 04 Apr 2024

Diagnosed : 05 Apr 2024 - Sean Felton

16011 West Belfort Street

Sugar Land, TX US 77498 Contact: Adrian Martinez

adrianmartinez@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 983 - Sugar Land Hauling

T:

F: