

OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

DODGE DRUM DRIVE 3

Component Gearbox

PETRO CANADA 220 (5 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORT	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0087869		
Sample Date		Client Info		04 Mar 2024		
Machine Age	yrs	Client Info		4		
Oil Age	yrs	Client Info		2		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	9		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>200	0		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		56		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		2		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		37		
Calcium	ppm	ASTM D5185m		37		
Phosphorus	ppm	ASTM D5185m		292		
Zinc	ppm	ASTM D5185m		50		
Sulfur	ppm	ASTM D5185m		6966		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	8		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.29		



OIL ANALYSIS REPORT

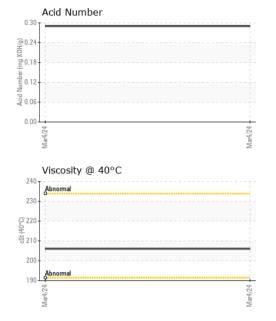


VICLIAL		and the section of	11		la balla second	la la la ma O
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.2	NEG		
Free Water	scalar	*Visual		NEG		
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		206		
SAMPLE IMAGES		method	limit/base	current	history1	history2

Color


Bottom


no image no image no image no image

GRAPHS

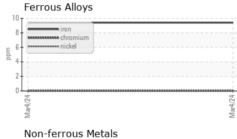



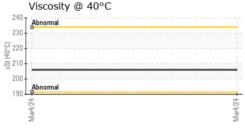

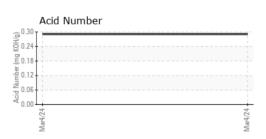





Certificate 12367

Laboratory Sample No. Lab Number : 06142384 Unique Number : 10967192

Test Package : IND 2

: PCA0087869

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received **Tested**

: 08 Apr 2024 : 09 Apr 2024

Diagnosed

: 11 Apr 2024 - Don Baldridge

US 53963 Contact: DAVE KARTECHNER dave@kartechnerbrothers.com T: (920)324-2874

Contact/Location: DAVE KARTECHNER - KARWAU

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

KARTECHNERS N11829 COUNTY RD I

WAUPUN, WI