


OIL ANALYSIS REPORT

KEMP QUARRIES / RIVER VALLEY BACKBONE **CATERPILLAR OHT082**

Rear Differential

MOBIL MOBILTRANS HD 50 (--- GAL)

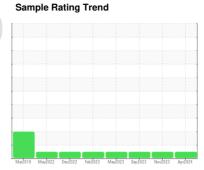



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The condition of the oil is acceptable for the time in service.


		Warzu19 h	nayzuzz Deczuzz Febzu.	23 May2023 Sep2023 Nov2023	Aprzuz4	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0086911	PCA0069699	PCA0069819
Sample Date		Client Info		10 Apr 2024	06 Nov 2023	05 Sep 2023
Machine Age	hrs	Client Info		3400	3045	2841
Oil Age	hrs	Client Info		1237	3045	1237
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	19	35	33
Chromium	ppm	ASTM D5185m	>10	<1	<1	0
Nickel	ppm	ASTM D5185m	>10	<1	<1	0
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		0	<1	0
Aluminum	ppm	ASTM D5185m	>25	2	2	3
Lead	ppm	ASTM D5185m	>25	<1	<1	<1
Copper	ppm	ASTM D5185m	>100	2	6	5
Tin	ppm	ASTM D5185m	>10	<1	<1	<1
Vanadium	ppm	ASTM D5185m		0	<1	<1
Cadmium	ppm	ASTM D5185m		<1	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		3	8	6
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		3	3	3
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		18	36	39
Calcium	ppm	ASTM D5185m		3550	2141	2234
Phosphorus	ppm	ASTM D5185m		972	741	716
Zinc	ppm	ASTM D5185m		1200	876	881
Sulfur	ppm	ASTM D5185m		4812	5925	6290
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	23	14	14
Sodium	ppm	ASTM D5185m		0	0	2
Potassium	ppm	ASTM D5185m	>20	2	2	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
15 10\ D						0 1 10 10



OIL ANALYSIS REPORT

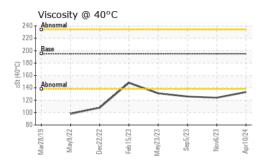

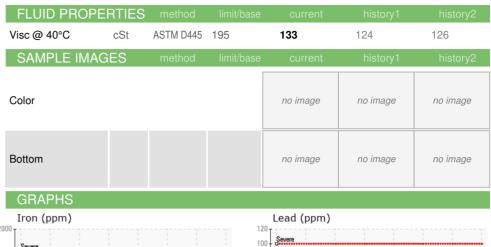

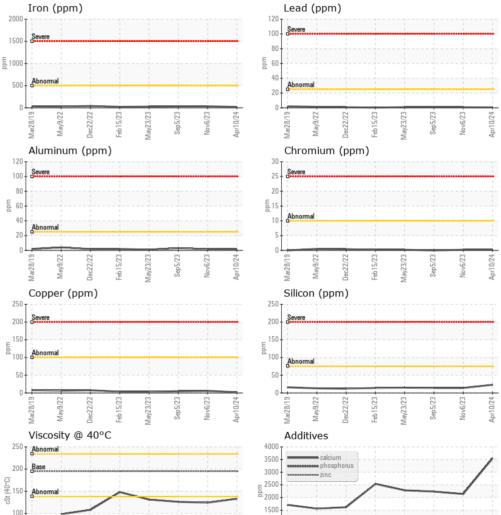



Certificate 12367

Sample No.

Lab Number : 06155358 Unique Number : 10990781

Test Package : MOB 1

: PCA0086911

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 19 Apr 2024 **Tested**

: 23 Apr 2024 Diagnosed : 23 Apr 2024 - Wes Davis

Kemp Quarries - River Valley - Backbone

5600 S Hwy 253 Huntington, AR US 72940

1000 500

> Contact: backbone@rivervalleyquarries.com T:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: