


OIL ANALYSIS REPORT

Area

KEMP QUARRIES / RIVER VALLEY OZARK WL091

Component Front Left Final Drive

MOBIL MOBILTRANS HD 50 (--- GAL)

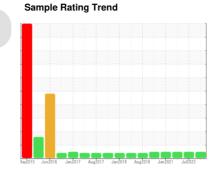



DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

Gear wear is indicated.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0086937	PCA0084557	PCA0086185
Sample Date		Client Info		16 Apr 2024	19 Jul 2023	13 Jan 2023
Machine Age	hrs	Client Info		25576	15252	24686
Oil Age	hrs	Client Info		184746	15252	0
Oil Changed		Client Info		N/A	N/A	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINA [*]	TION	method	limit/base	current	historv1	historv2

NEG
hiotory?
history2
19
<1
)
<1
)
1
<1
2
)
)
)
1 < 0 < 0 1 < 2 0


ADDITIVES		method		history1	history2
Boron	ppm	ASTM D5185m	73	48	44
Barium	ppm	ASTM D5185m	0	0	0
Molybdenum	ppm	ASTM D5185m	6	3	3
Manganese	ppm	ASTM D5185m	1	<1	<1
Magnesium	ppm	ASTM D5185m	96	55	52
Calcium	ppm	ASTM D5185m	4253	2781	2874
Phosphorus	ppm	ASTM D5185m	1392	974	942
Zinc	ppm	ASTM D5185m	1573	1096	1126
Sulfur	ppm	ASTM D5185m	10903	7867	8623


CONTAMINANTS		method				history2
Silicon	ppm	ASTM D5185m	>75	23	13	12
Sodium	ppm	ASTM D5185m		0	0	2
Potassium	ppm	ASTM D5185m	>20	2	<1	0


	1-1-			-		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	LIGHT	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
1 Free Water	scalar	*Visual		NEG	NEG	Sulpheitted By:





OIL ANALYSIS REPORT

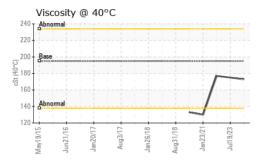


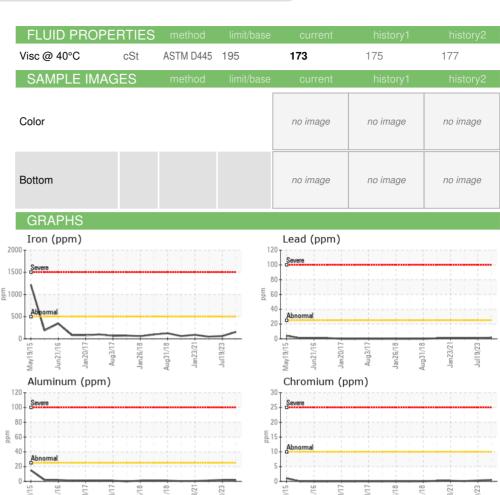

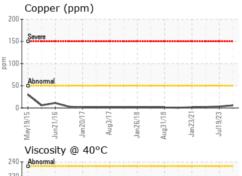

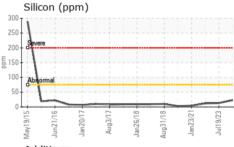

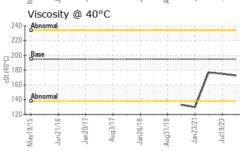

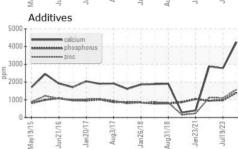



Laboratory Sample No.

Lab Number : 06155373 Unique Number : 10990796

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0086937 Received : 19 Apr 2024

Tested : 24 Apr 2024 Diagnosed : 24 Apr 2024 - Jonathan Hester

Kemp Quarries - River Valley - Ozark

9446 N Hwy 309 Ozark, AR US 72949

Test Package : MOB 1 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

Contact: ozark@rivervalleyquarries.com

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: