


OIL ANALYSIS REPORT

Sample Rating Trend



OFF SPEC

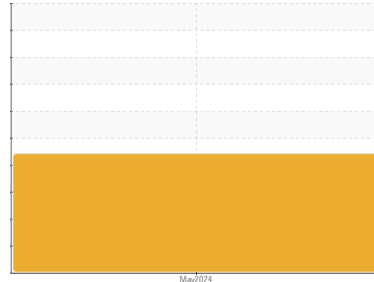

Machine Id
INTERNATIONAL 398274
Component
Diesel Exhaust Fluid (DEF)
Fluid
DEF (Diesel Exhaust Fluid) (--- QTS)

DIAGNOSIS

▲ Recommendation

Fluid does not meet ISO 22241-2 requirements.
Contact supplier.

Contamination

There is no indication of any contamination in the diesel exhaust fluid (def).

▲ Fluid Condition

The diesel exhaust fluid (def) specification testing is lower than normal. Urea content is low.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			PCA0125196	---	---
Sample Date	Client Info			30 May 2024	---	---
Machine Age	mls	Client Info		0	---	---
Oil Age	mls	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				SEVERE	---	---


CONTAMINANTS		method	limit/base	current	history1	history2
Hydrocarbon	scalar	*In-House		NONE	---	---

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---
Precipitate	scalar	*Visual	NONE	NONE	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual		NEG	---	---
Free Water	scalar	*Visual		NEG	---	---



FLUID PROPERTIES		method	limit/base	current	history1	history2
Urea Content	%	ISO 22241	<31.8	▲ 19.2	---	---
Density @ 20°C	g/cm3	ISO 22241	>1.0930	▲ 1.0512	---	---
Refracting Index		ISO 22241	<1.3814	▲ 1.3618	---	---
Appearance	scalar	*Visual		Clear & Bright	---	---

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image

OIL ANALYSIS REPORT

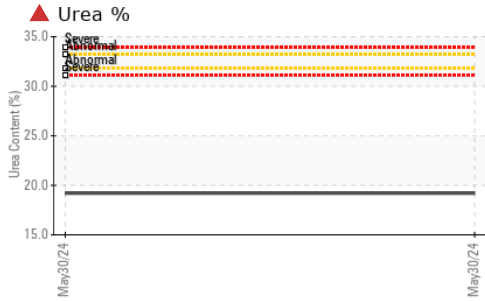

GRAPHS

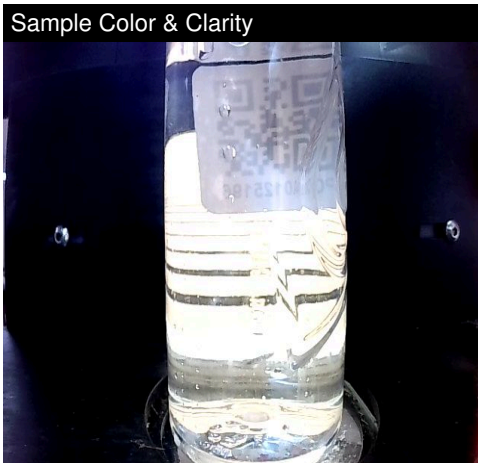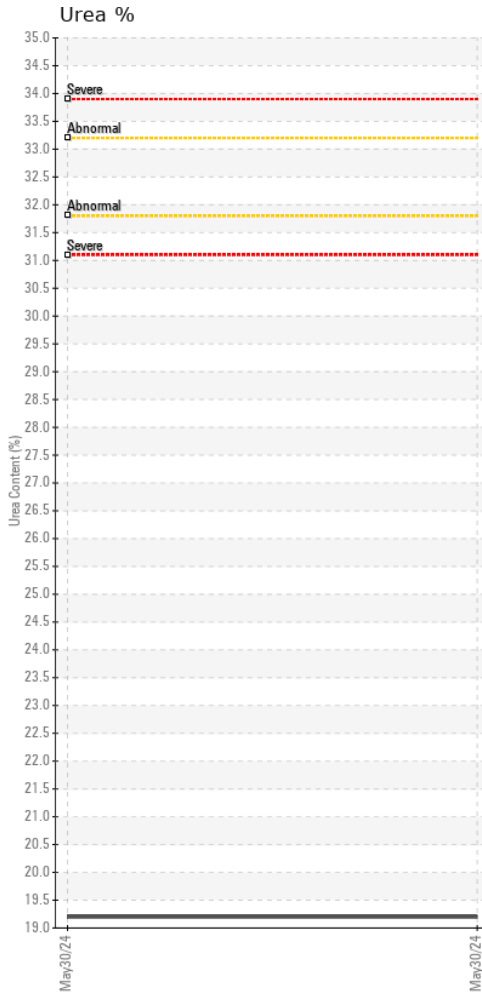

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0125196
Lab Number : **06200708**
Unique Number : 11062831
Test Package : MOB 1 (Additional Tests: DEF1, KF, Visual)

Received : 05 Jun 2024
Tested : 13 Jun 2024
Diagnosed : 13 Jun 2024 - Doug Bogart

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #118
 2196 BENNETT ROAD
 PHILADELPHIA, PA
 US 19116
 Contact: ROSTY VITER
 rviter@millertransgroup.com
 T: (215)552-9832
 F: (215)552-9892