


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

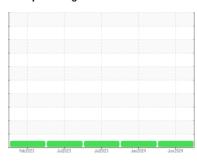

Machine Id
427192
Component
Transmission (Auto)
Fluid
DEXRON III (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.


Fluid Condition

The condition of the fluid is acceptable for the time in service.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0123523	GFL0105496	GFL0089434
Sample Date		Client Info		20 Jun 2024	05 Jan 2024	28 Jul 2023
Machine Age	mls	Client Info		355324	341405	329996
Oil Age	mls	Client Info		355324	341405	329996
Oil Changed		Client Info		Changed	N/A	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>160	21	11	6
Chromium	ppm	ASTM D5185m	>5	0	0	0
Nickel	ppm	ASTM D5185m	>5	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>5	0	0	0
Aluminum	ppm	ASTM D5185m	>50	4	5	3
Lead	ppm	ASTM D5185m	>50	0	0	0
Copper	ppm	ASTM D5185m	>225	101	58	11
Tin	ppm	ASTM D5185m	>10	0	<1	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		14	13	39
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	<1
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m		2	<1	3
Calcium	ppm	ASTM D5185m		283	276	249
Phosphorus	ppm	ASTM D5185m		400	434	375
Zinc	ppm	ASTM D5185m		27	28	32
Sulfur	ppm	ASTM D5185m		901	795	1423
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	10	8	6
Sodium	ppm	ASTM D5185m		4	5	2
Potassium	ppm	ASTM D5185m	>20	2	2	<1
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
• •	scalar scalar	*Visual	NORML >0.1	NORML NEG	NORML NEG	NORML NEG





OIL ANALYSIS REPORT

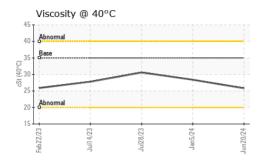




GRAPHS

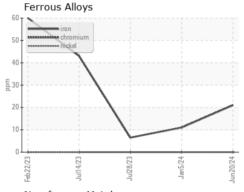

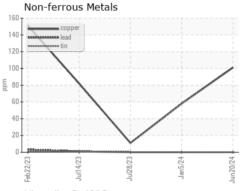

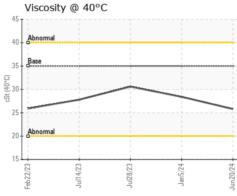



Certificate 12367

Laboratory

Sample No.

Test Package : FLEET

: GFL0123523 Lab Number : 06221725 Unique Number : 11099922

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 26 Jun 2024 Tested : 27 Jun 2024

Diagnosed : 28 Jun 2024 - Don Baldridge

GFL Environmental - 983 - Sugar Land Hauling

16011 West Belfort Street Sugar Land, TX

US 77498 Contact: TECHNICIAN ACCOUNT

wcgfldemo@gmail.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: GFL983 [WUSCAR] 06221725 (Generated: 06/29/2024 06:02:33) Rev: 1

Submitted By: TECHNICIAN ACCOUNT

T:

F: