


OIL ANALYSIS REPORT



KEMP QUARRIES / HULBERT WL085

Component
Front Right Final Drive
Fluid

MOBIL MOBILTRANS HD 50 (--- GAL)

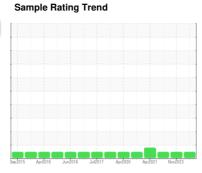



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The condition of the oil is acceptable for the time in service.

HD 50 (GAL)		Sep.2015 A	pr2016 Jun2016 Ju	Z017 AprZ020 AprZ021	Nov2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0085978	PCA0109244	PCA0061825
Sample Date		Client Info		21 Jun 2024	11 Nov 2023	08 Nov 2022
Machine Age	hrs	Client Info		28580	28114	27587
Oil Age	hrs	Client Info		2000	0	0
Oil Changed		Client Info		Changed	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINA	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
WEAR METAI	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>800	203	167	169
Chromium	ppm	ASTM D5185m	>10	<1	<1	<1
Nickel	ppm	ASTM D5185m	>5	0	<1	0
Titanium	ppm	ASTM D5185m	>15	<1	<1	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>75	3	2	2
Lead	ppm	ASTM D5185m	>10	1	<1	<1
Copper	ppm	ASTM D5185m	>75	3	3	2
Tin	ppm	ASTM D5185m	>8	0	<1	0
Antimony	ppm	ASTM D5185m	>50			
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	3	3
Barium	ppm	ASTM D5185m		0	<1	0
Molybdenum	ppm	ASTM D5185m		<1	2	1
Manganese	ppm	ASTM D5185m		2	2	1
Magnesium	ppm	ASTM D5185m		32	28	29
Calcium	ppm	ASTM D5185m		3200	2758	3020
Phosphorus	ppm	ASTM D5185m		1161	983	1035
Zinc	ppm	ASTM D5185m		1354	1186	1254
Sulfur	ppm	ASTM D5185m		9303	8494	8795
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>400	27	23	22
Sodium	ppm	ASTM D5185m		2	0	<1
Potassium	ppm	ASTM D5185m	>20	2	3	1
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Appearance Odor	scalar scalar	*Visual *Visual	NORML NORML	NORML NORML	NORML NORML	NORML NORML

Emulsified Water

scalar

scalar *Visual

*Visual

>0.2

NEG

NEG


NEG


NEG


NEG





OIL ANALYSIS REPORT

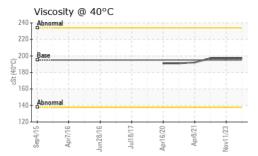


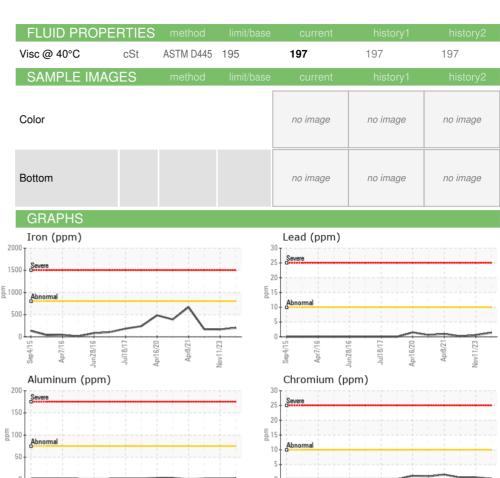

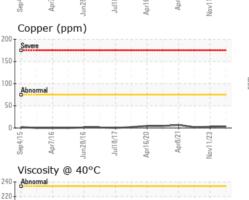

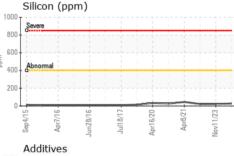

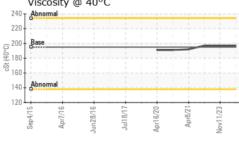

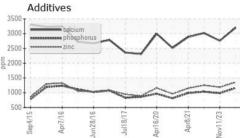



Certificate 12367

Sample No.

Lab Number : 06230560 Unique Number : 11114053 Test Package : MOB 1

: PCA0085978

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Jul 2024

Tested : 10 Jul 2024 Diagnosed : 10 Jul 2024 - Wes Davis

Kemp Quarries - Kemp Stone - Hulbert

17801 Hwy 80 Hulbert, OK US 74441

Contact: hulbert@kempstone.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: