

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



KEMP QUARRIES / RIVER VALLEY BACKBONE **WL079**

Transmission (Manual)

MOBIL MOBILTRANS HD 30 (--- GAL)

DIAGNOSIS Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.


Fluid Condition


The condition of the fluid is acceptable for the time in service.

SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0108631	PCA0084783	PCA0085849
Sample Date		Client Info		28 Jun 2024	28 Dec 2023	13 Oct 2023
Machine Age	hrs	Client Info		49459	48609	48226
Oil Age	hrs	Client Info		1200	383	1200
Oil Changed		Client Info		Changed	Not Changd	Changed
Sample Status				NORMAL	ABNORMAL	NORMAL
CONTAMINATION	ON	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	7	3	<1
Chromium	ppm	ASTM D5185m	>5	0	<1	<1
Nickel	ppm	ASTM D5185m	>5	0	<1	0
Titanium	ppm	ASTM D5185m		0	<1	<1
Silver	ppm	ASTM D5185m	>7	0	0	0
Aluminum	ppm	ASTM D5185m	>25	2	2	2
Lead	ppm	ASTM D5185m	>45	<1	<1	<1
Copper	ppm	ASTM D5185m	>225	1	2	2
Tin	ppm	ASTM D5185m	>10	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1	<1	0
Barium	ppm	ASTM D5185m		0	0	9
Molybdenum	ppm	ASTM D5185m		0	1	<1
Manganese	ppm	ASTM D5185m		<1	<1	0
Magnesium	ppm	ASTM D5185m		12	15	15
Calcium	ppm	ASTM D5185m		3257	3307	3285
Phosphorus	ppm	ASTM D5185m		902	939	901
Zinc	ppm	ASTM D5185m		1015	1149	1126
Sulfur	ppm	ASTM D5185m		3711	4369	4349
CONTAMINANT	ΓS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>125	8	6	6
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	<1	1	2
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	LIGHT
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	0.2%	NEG
Free Water	scalar	*Visual	20.1	NEG	NEG	NEG
1 100 Water	Juaiai	Vioual		ILO	INLU	INLU



OIL ANALYSIS REPORT

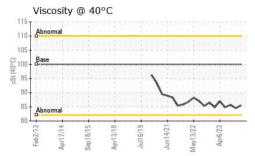

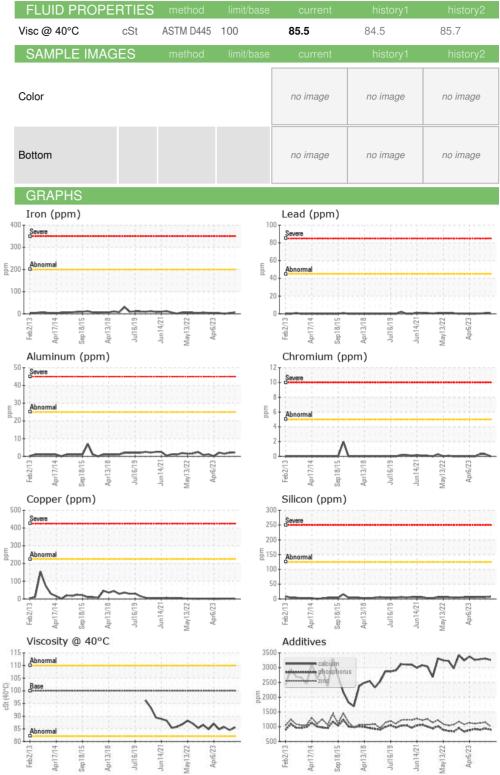





Certificate 12367

Sample No.

Lab Number : 06230962 Unique Number : 11114455

Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0108631

Diagnosed

Received : 08 Jul 2024 **Tested** : 10 Jul 2024

: 10 Jul 2024 - Wes Davis

Kemp Quarries - River Valley - Backbone 5600 S Hwy 253 Huntington, AR US 72940

Contact: backbone@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: KEMHUN [WUSCAR] 06230962 (Generated: 07/10/2024 01:17:44) Rev: 1

Submitted By:

T:

F: