


# **OIL ANALYSIS REPORT**

## Sample Rating Trend





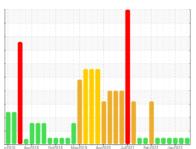



# KEMP QUARRIES / RIVER VALLEY BACKBONE WL100 Component Hydraulic System

MOBIL DELVAC 1300 SUPER15W40 (--- GAL)

# DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the


### **Fluid Condition**


The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0034500	PCA0037180	PCA0037124
Sample Date		Client Info		28 Jun 2024	06 Apr 2023	13 Jan 2023
Machine Age	hrs	Client Info		37291	36257	35941
Oil Age	hrs	Client Info		900	945	600
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185m	>20	14	20	17
Chromium	ppm	ASTM D5185m	>10	2	3	3
Nickel	ppm	ASTM D5185m	>10	0	0	0
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>10	4	5	6
Lead	ppm	ASTM D5185m	>10	<1	0	<1
Copper	ppm	ASTM D5185m	>75	6	12	14
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	1	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	1	2	2
Manganese	ppm	ASTM D5185m		<1	<1	<1
Magnesium	ppm	ASTM D5185m	0	14	31	23
Calcium	ppm	ASTM D5185m		94	112	101
Phosphorus	ppm	ASTM D5185m		363	355	330
Zinc	ppm	ASTM D5185m		448	457	369
Sulfur	ppm	ASTM D5185m		1042	745	665
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	9	16	15
Sodium	ppm	ASTM D5185m		2	0	<1
Potassium	ppm	ASTM D5185m	>20	2	<1	0
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
<b>Emulsified Water</b>	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
4·44·07) Rev: 1						Submitted By:



# **OIL ANALYSIS REPORT**

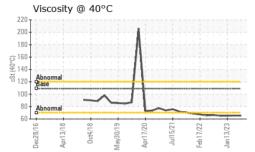

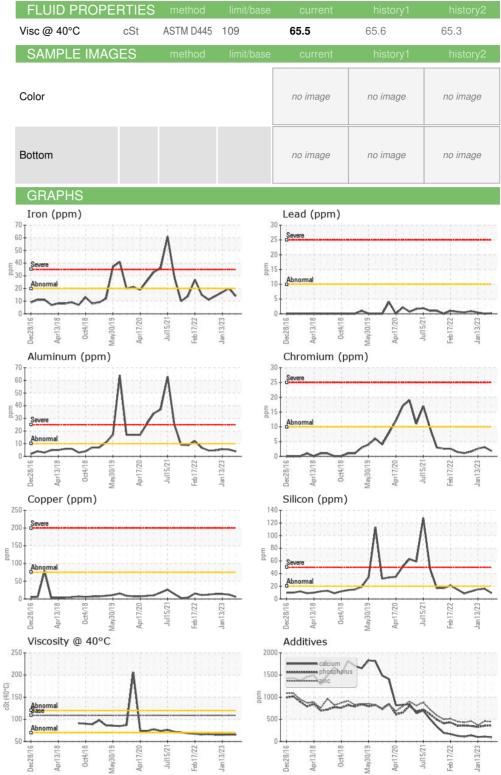





Certificate 12367

Laboratory Sample No.

Lab Number : 06230968 Unique Number : 11114461 Test Package : MOB 1

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0034500

: 08 Jul 2024 Received **Tested** : 10 Jul 2024 Diagnosed

: 10 Jul 2024 - Sean Felton

5600 S Hwy 253 Huntington, AR

Kemp Quarries - River Valley - Backbone

US 72940 Contact: backbone@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: